



ENGLISH HERITAGE

HERITAGE AT
RISK
REGISTER
2012

SOUTH EAST

Contents

HERITAGE AT RISK	3
Reducing the risks	7
Publications and guidance	10
THE REGISTER	12
Content and assessment criteria	12
Key to the entries	15
Heritage at risk entries by local planning authority	17
Bracknell Forest (UA)	20
Brighton and Hove, City of (UA)	20
South Downs (NP)	22
Buckinghamshire	22
East Sussex	26
Hampshire	32
Isle of Wight (UA)	47
Kent	50
Medway (UA)	64
Milton Keynes (UA)	67
Oxfordshire	68
Portsmouth, City of (UA)	77
Reading (UA)	79
Southampton, City of (UA)	79
Surrey	80
West Berkshire (UA)	84
West Sussex	87
Windsor and Maidenhead (UA)	93
Wokingham (UA)	94

*Entries in the South Downs (NP) also appear in the following counties:
East Sussex, Hampshire and West Sussex.




ENGLISH HERITAGE

HERITAGE AT RISK

2012

SOUTH EAST

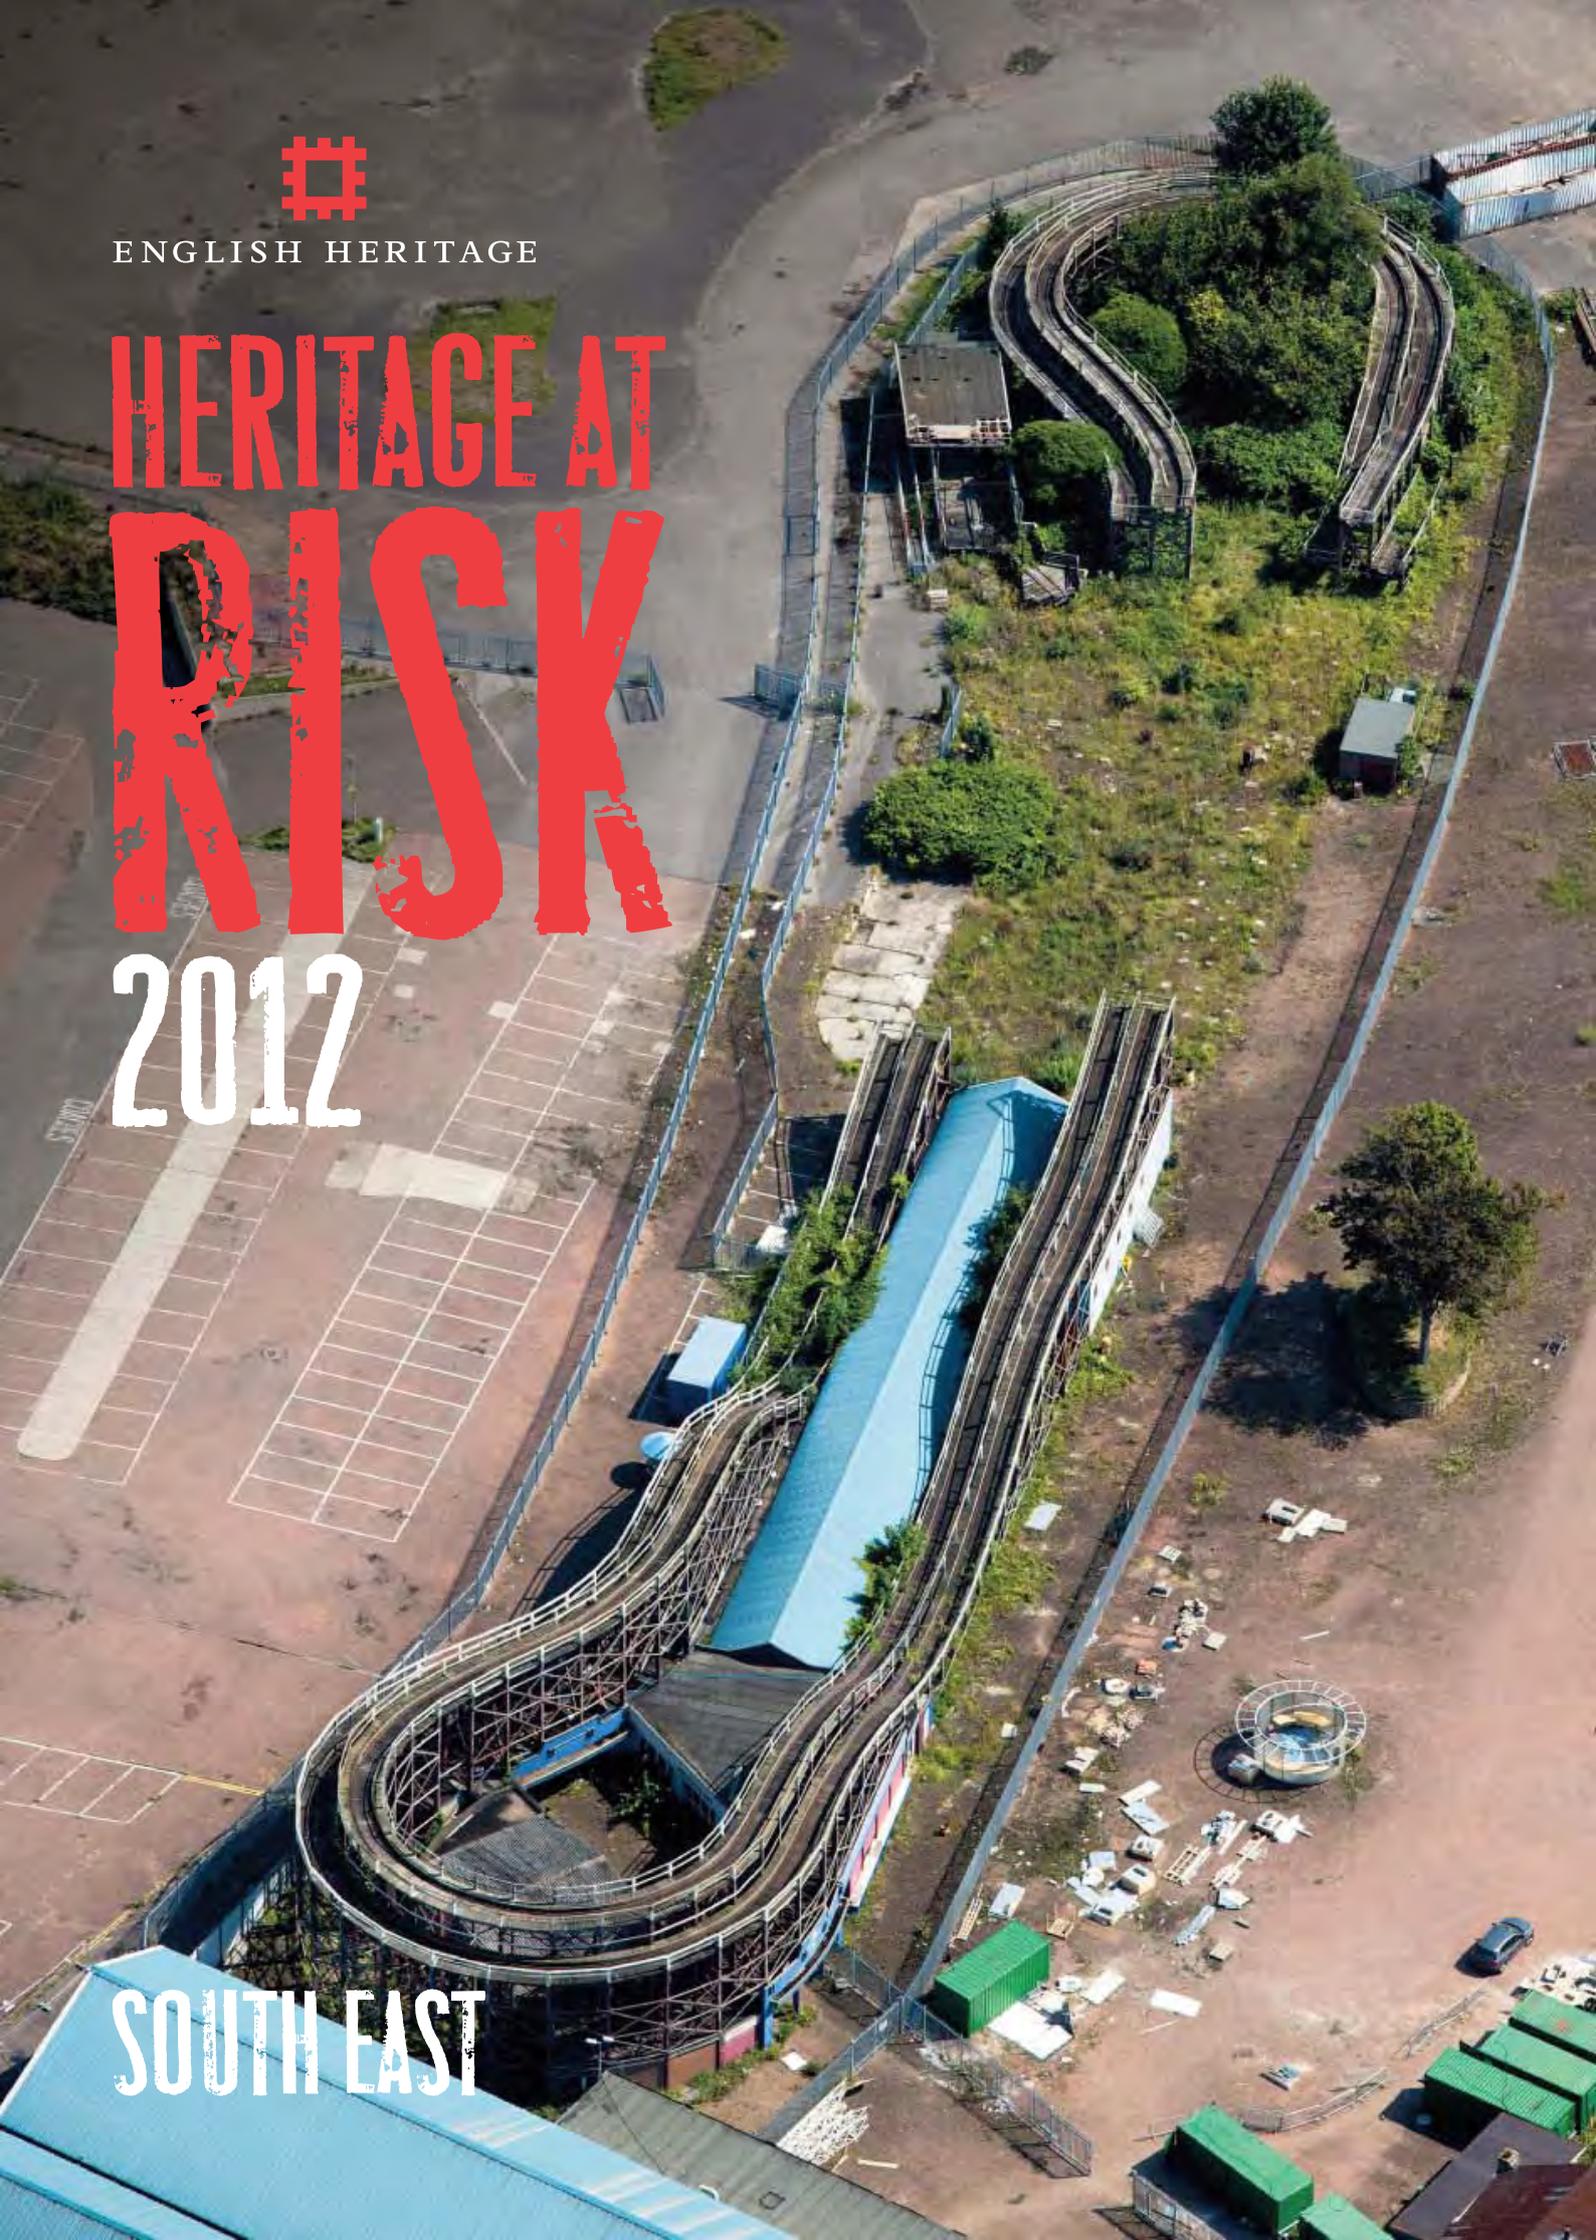

HERITAGE AT RISK

Despite the challenges of recession, the number of sites on the Heritage at Risk Register continues to fall. Excluding listed places of worship, for which the survey is still incomplete, 1,150 assets have been removed for positive reasons since the Register was launched in 2008. The sites that remain at risk tend to be the more intractable ones where solutions are taking longer to implement.

While the overall number of buildings at risk has fallen, the average conservation deficit for each property has increased from £260k (1999) to £370k (2012). We are also seeing a steady increase in the proportion of buildings that are capable of beneficial re-use – those that have become redundant not because of any fundamental lack of potential, but simply as the temporary victims of the current economic climate.


In the last year we have been able to remove 50 sites from the Heritage at Risk Register; although this success has been tempered by the addition of a further 52. This reminds us that the challenge of addressing heritage at risk is here to stay – that for every asset we save, another awaits a solution.

The new additions to the Register are overwhelmingly churches and chapels, as a result of the expansion of our survey of listed places of worship – a trend likely to continue for some years yet. We can nevertheless celebrate the removal of the first two places of worship from the Register following successful repair works this year. We have also grant-aided our second Places of Worship Support Officer, to support congregations in the Canterbury Diocese in tackling their maintenance issues and adapting their buildings to ensure vibrant community use.

We achieved a net reduction of 14 scheduled monuments at risk this year. Of the 237 scheduled monuments that remain on the Register, the overwhelming cause of concern (67%) is arable cultivation. Our new Conservation of Scheduled Monuments in Cultivation (COSMIC) programme will help to address this by providing a detailed assessment of the amount of damage being caused by continued ploughing. As well as improving our understanding of the buried remains it will identify how they can be better managed and subsequently removed from the Register; later this year we will be encouraging landowners to work with us to undertake COSMIC surveys of the monuments in their stewardship.

In 2011 we published for the first time a list of our top ten Heritage at Risk priorities and it is pleasing to report that good progress is being made at several of these sites. For example, at Stowe in Buckinghamshire, the restoration of the New Inn as a visitor centre will help to generate income that can be directed towards tackling listed garden features that remain at risk. Meanwhile, at Sheerness Dockyard repairs to the residential quarter are nearing completion. At other sites, however, the picture remains very challenging and we will be continuing our efforts to broker solutions for them during the coming years.

As the challenges of the current economic climate persist, so too do the challenges of Heritage at Risk. Only 28% of buildings at risk on the South East Register are capable of beneficial use and even fewer are economic to repair. Our limited grants budget will continue to be targeted on Heritage at Risk next year and we will at the same time be supporting local communities and councils to save heritage through their own powers. In this respect we were particularly pleased to hear of Thanet District Council's successful bid to compulsorily purchase the Scenic Railway at Margate, which will now allow its repair to proceed. Looking to the future, we are creating a dedicated local team to sharpen our own focus on addressing Heritage at Risk in the South East.

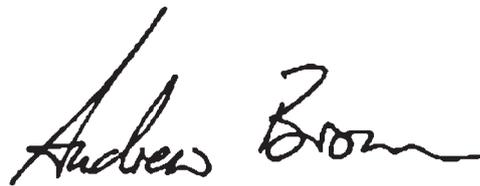

Andrew Brown
Planning and Conservation Director,
South East

SCENIC RAILWAY, MARGATE, KENT

Built in 1919–20 as the main attraction of the Dreamland amusement park, the grade II* Scenic Railway is Britain's oldest surviving roller coaster. Badly damaged by fire in 2008, it has become a sad reminder of Margate's heyday as the south of England's pre-eminent seaside resort. Its restoration is crucial to the cultural and economic regeneration of the town, which is why English Heritage and the Heritage Lottery Fund are supporting Thanet District Council's plan for the Dreamland Trust to breathe life back into the amusement park with the Scenic Railway at its beating heart. © English Heritage

BUILDINGS AT RISK

- Nationally, 3.0% of grade I and II* listed buildings are at risk. In the South East this falls to 1.7% (97 buildings).
- 11 buildings at risk were removed from the 2011 South East Register, and 5 have been added.

PLACES OF WORSHIP AT RISK

- Of the 272 listed places of worship surveyed in the South East, 62 are at risk. 28 have been added this year.

SCHEDULED MONUMENTS

- 3,286 (16.6%) of England's 19,759 scheduled monuments are at risk, of which 237 are in the South East.
- In the South East, 30 scheduled monuments have been removed from the 2011 Register for positive reasons, and 16 have been added.
- 6.3% of scheduled monuments (64) on the South East's baseline 2009 Register have been removed for positive reasons, compared to the national figure of 15.8%.
- Nationally, damage from arable cultivation is the greatest risk factor for scheduled monuments, accounting for 44% of those at risk. In the South East the proportion is 67%.

REGISTERED PARKS AND GARDENS

- 99 (6.1%) of England's 1,617 registered parks and gardens are at risk, a decrease from 103 (6.4%) in 2011. In the South East, 24 (6.5%) of our 368 sites are at risk.
- Nationally, 5 sites were removed from the 2011 Register and 1 has been added. There has been no change in the South East.

REGISTERED BATTLEFIELDS


- Of the 43 registered battlefields in England, 6 are at risk, 2 fewer than the 2008 baseline. Of the 6 registered battlefields in the South East, 1 is at risk.

PROTECTED WRECK SITES

- Of the 46 protected wreck sites off England's coast, 4 are at risk. Of the 10 sites on the 2008 baseline, 9 have been removed. Of the 20 protected wreck sites in the South East, 4 are at risk.

CONSERVATION AREAS

- We now have information on the condition of 7,976 of England's 9,770 conservation areas; 524 (6.6%) are at risk. Of the 1,553 conservation areas surveyed in the South East, 62 (4%) are at risk.
- 3 conservation areas were removed from the 2011 South East Register for positive reasons, and 2 have been added.

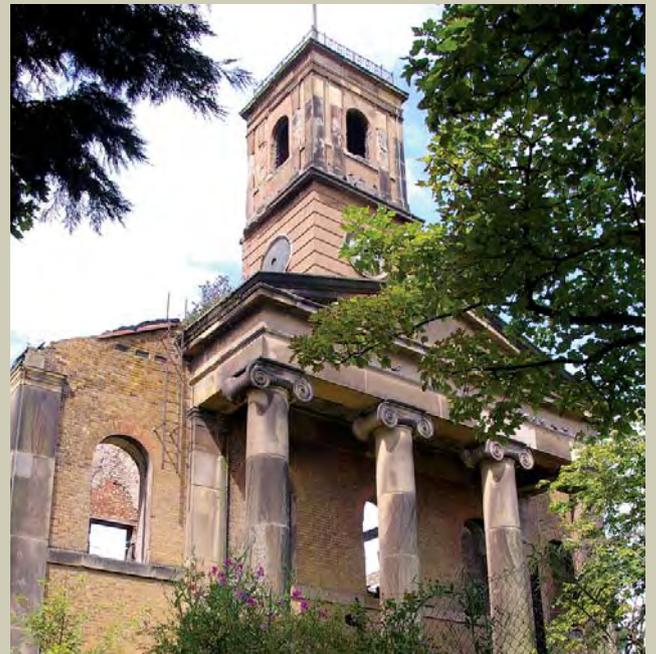

DOCKYARD CHURCH, SHEERNESS, KENT

Built to serve the new Sheerness Dockyard and now a grade II* listed building at risk, the former St Paul's church has lain empty since 1970. English Heritage is supporting Swale Borough Council's plan to compulsorily purchase the church so that a building preservation trust can restore it to beneficial use.

© English Heritage

55% OF
BUILDINGS
AT RISK ON
THE 1999
REGISTER HAVE BEEN
SAVED

62
CONSERVATION
AREAS ARE
AT RISK

9%
OF
SCHEDULED
MONUMENTS
ARE
AT RISK

£607k
IN GRANTS
WAS OFFERED TO
18 SITES AT RISK

PRIORITY HAR SITES

- Brookwood Cemetery, Brookwood, Woking, Surrey
- Castle Goring, Arundel Road, Worthing, West Sussex
- Hammerhead Crane, Thetis Road, West Cowes, Cowes, Isle of Wight
- RAF Bicester: World War II airfield, Laughton, Cherwell, Oxfordshire
- Roman Catholic Church of St Augustine of England with Cloisters attached, St Augustine's Road, Ramsgate, Thanet, Kent
- Sheerness Dockyard (incl. The Boat Store (No. 78), Former Medway Ports Authority Offices (Dockyard House), Coach Houses (Naval Terrace), I-15 (consec.) Regency Close, Former Royal Dockyard Church and attached wall and railings, Former Working Mast House, 26 Jetty Road), Sheerness, Kent
- Stowe Landscape Garden (incl. The Palladian Bridge, Temple of Friendship, The East Boycott Pavilion and The Queens Temple), Stowe, Buckinghamshire
- The Belvedere, Waldershare Park, Shepherdswell with Coldred, Dover, Kent
- The chapel at the former King Edward VII Hospital, Easebourne, Chichester, West Sussex
- The Western Heights fortifications, Castle Hill, Dover, Kent

GRADE II PILOT PROJECTS

English Heritage is looking for people to take part in pilot projects that will explore options for expanding the Heritage at Risk programme to include all grade II listed buildings.


A maximum of 15 pilot projects are required to explore, cost and test various options for undertaking surveys of grade II listed buildings.

For more information and details on how to apply visit:

www.english-heritage.org.uk/risk

FOR MORE INFORMATION CONTACT:

Principal Heritage at Risk Adviser, English Heritage South East, Eastgate Court, 195 – 205 High Street, Guildford, GU1 3EH.
Telephone: 01483 252 000 Email: southeast@english-heritage.org.uk

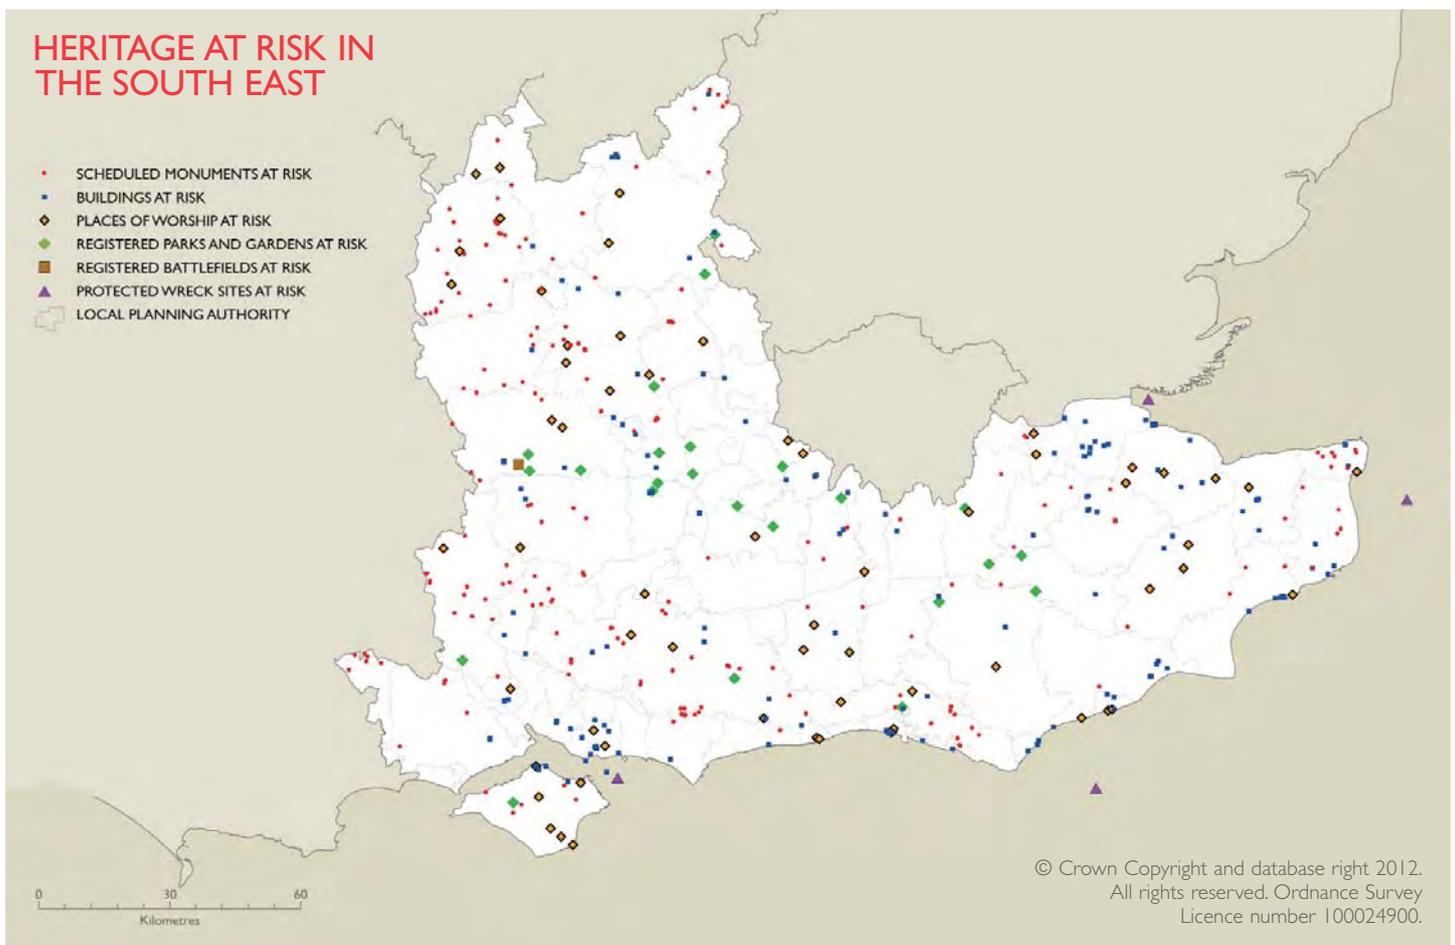

Find out what's at risk by searching or downloading the online Heritage at Risk Register at www.english-heritage.org.uk/har

If you would like this document in a different format, please contact our customer services department on telephone: 0870 333 1181
fax: 01793 414926 textphone: 01793 414878
email: customers@english-heritage.org.uk

Reducing the risks

English Heritage is committed to securing a year-on-year reduction in the number of heritage sites at risk as part of our National Heritage Protection Plan (2011-2015). We have set ourselves a target to remove 25% of entries (1,137) published on the 2010 Register by 2015. This will be challenging given the number of assets on the Register and the different kinds of risk they face.

To help address this challenge we have published our National Heritage at Risk Strategy which will be supported by nine local strategies. Key objectives of the strategy are to understand why assets are at risk and what most influences their removal from the Register and to find solutions for heritage at risk through partnership, stimulating economic regeneration and growth and maximising the benefit of our expertise and resources.

Whilst each asset type and individual site will require its own approach and solution, there are some general approaches that are relevant to all assets at risk. Resolving cases requires working in close partnership with owners, local planning authorities and other relevant organisations and partners. Advice and understanding are essential. Historic Environment Records, maintained by local authorities, are repositories of information on local historic assets. They underpin the work of local authority historic environment services and can help improve the protection, conservation and management of heritage assets.

Maintenance of heritage assets is essential to prevent them becoming at risk, and those that are already at risk from decaying further and the cost of their repair and consolidation from escalating. Buildings, for instance, decay rapidly when left empty. Avoiding vacancy through short-term lets or schemes that provide protection through residential occupation are low-cost ways of maintaining buildings until permanent solutions can be found. English Heritage has published guidance for owners on options for maintaining vacant buildings (*Vacant Historic Buildings: An Owner's Guide to Temporary Uses, Maintenance and Mothballing*).

English Heritage provides on-line advice and guidance to local authorities, owners and managers of sites through the Historic Environment Local Management (HELM) website, www.helm.org.uk

LISTED BUILDINGS

Buildings at risk

English Heritage's role in securing the future of buildings at risk is primarily to provide practical advice, guidance and resources to local authorities, owners and developers. Our involvement in cases is determined by the importance of the building and the complexity of the issues. We can help with analysis of the issues, investigation of the feasibility of options and brokering solutions. Although buildings at risk will continue to be a priority for English Heritage repair grants, grant aid is limited in relation to demand. Grants from other public sources, notably the Heritage Lottery Fund, continue to be essential in helping secure the future of buildings at risk.

In very exceptional cases, English Heritage may acquire and repair a particularly important building at risk, where it is clear that the scale and complexity of problems are such that direct involvement is the best way of securing the building's long-term future.

Local authorities have a primary role in protecting the historic environment. The creation of a local heritage at risk register is the first step in tackling neglected buildings in order to assess and monitor the scale of the problem and prioritise resources and action. Local authorities can also take action to secure the preservation of historic buildings through the use of statutory notices. Some local authorities have a successful track record, but generally these powers are under-used. It is essential that local authorities make best use of their powers to secure buildings at risk, to 'stop the rot' and prevent the costs escalating beyond the point where it is economic to repair. For this reason, English Heritage has published revised guidance (*Stopping the Rot*) for local planning authorities on taking action to save historic buildings.

To help local authorities make more frequent and timely use of their statutory powers, English Heritage runs grant schemes to underwrite a significant proportion of the irrecoverable costs involved in serving Urgent Works Notices and Repairs Notices.

Building preservation trusts can be the key to saving many buildings at risk. Some trusts cover geographical areas; others specialise in particular types of building or are

formed to save just one building. Determined individuals and trusts have saved numerous buildings at risk, working in partnership with other organisations such as local and national amenity societies, including SAVE Britain's Heritage, the Society for the Protection of Ancient Buildings, the Georgian Group, The Victorian Society, The Twentieth Century Society, the Council for British Archaeology and the Ancient Monuments Society. In 2012 English Heritage joined forces with the Architectural Heritage Fund to employ four Heritage at Risk officers to help not-for-profit organisations take building at risk projects forward.

Places of worship at risk

Regular maintenance helps to keep all buildings in good condition but those suffering major problems need repairs to minimise the risks to both the structure and the contents. Keeping drains and gutters clear so that water is taken away from the building efficiently is the most important thing congregations can do as it stops small problems developing into unnecessary crises. The overflowing gutter soon soaks the wall beneath, rots the roof timbers behind it and makes the whole building vulnerable.

In some areas congregations group together to engage reputable contractors at competitive rates to clear gutters and rainwater goods. Such co-operation enables them to get good quality work carried out at reasonable prices by firms that understand historic buildings. It also means volunteers do not take unnecessary risks balancing on ladders.

The Repair Grants for Places of Worship scheme helped under-resourced congregations do urgent works to make buildings wind and watertight. From 2013 the Heritage Lottery Fund will fund a new scheme for places of worship. The Government's Listed Places of Worship scheme, enabling the reclaiming of VAT on eligible repairs, maintenance and authorised alterations, is available to all listed places of worship, whether they have obtained grants or are funding work themselves. Local and national charities also offer grants.

English Heritage supports the congregations wanting to keep their places of worship in use and recognises the need for appropriate new facilities such as kitchens and toilets that are sensitive to the building's special character. *New Work in Historic Places of Worship* (published 2012) helps congregations understand how changes can be achieved.

A network of support officers, employed locally but part-funded by English Heritage, offer advice and encouragement to congregations. Projects to effect repairs, develop necessary new facilities, provide community facilities, and welcome visitors are all transforming buildings that were once thought to be unfit for purpose.

SCHEDULED MONUMENTS

The continuing success in reducing the number of monuments at risk, even in difficult economic times, demonstrates the value which owners and land managers place upon the monuments in their care, and more and more are addressing their long-term care on a regular basis. Over half of all scheduled monuments are now on land subject to an agreement under Natural England's Environmental Stewardship agri-environment scheme, administered on behalf of Defra. Continuing partnership with Defra and Natural England over the last year has seen the introduction of much more effective information sharing so that resources – whether Environmental Stewardship or English Heritage – can be more closely targeted where they will have the greatest impact. Over the next year we will also work more closely with the Heritage Lottery Fund to help identify those important monuments deserving of grant aid for major stabilisation or repair work.

Continued progress is also reliant upon better understanding. As a result, as part of the National Heritage Protection Plan – which sets out English Heritage's commitment to safeguarding heritage for the period 2011 to 2015 – the Conservation of Scheduled Monuments in Cultivation project has begun across England. The project, which started with a questionnaire to all farmers and landowners with a scheduled monument that is being cultivated, will look at ways in which further damage can be avoided whilst enabling cultivation to continue wherever possible. Some causes of risk are neither so obvious nor dramatic in their effects however. Heritage at risk still shows that unmanaged tree, scrub and bracken growth is one of the most widespread causes of long term damage to both urban and rural monuments, even if the effects are not as visible or immediately destructive as other processes. In most cases simple, low cost but regular maintenance is the key, the delivery of which will always be reliant upon the help and goodwill of landowners.

In all cases, however – whether for rural or urban monuments – close co-operation with owners and land managers will remain the key to making further progress in ever more challenging circumstances.

REGISTERED PARKS AND GARDENS

Inclusion on the *Register of Historic Parks and Gardens of Special Historic Interest* confers no additional statutory controls but the Government's new *National Planning Policy Framework* stresses the desirability of sustaining and enhancing the significance of all heritage assets and finding viable uses consistent with their conservation. Registered parks and gardens carry the same weight as listed buildings in the *National Planning Policy Framework* and substantial harm or loss can only be justified in exceptional cases.

English Heritage's landscape architects can help tailor plans and funding packages for individual landscape features as well as strategies for the whole site. We encourage the development of conservation management plans for registered historic parks and gardens, especially those in multiple ownership. We will continue to tackle the skills crisis facing historic parks and gardens through sector-wide initiatives.

Further information and conservation guidance for parks, gardens and designed landscapes is available at: www.english-heritage.org.uk/professional/advice/advice-by-topic/parks-and-gardens

REGISTERED BATTLEFIELDS

As with registered parks and gardens, this designation brings no additional statutory controls, but there is a presumption in favour of conservation of registered battlefields in the *National Planning Policy Framework*.

English Heritage will continue to work with owners to develop management plans for registered sites and, in appropriate cases, contribute towards the cost of management plans. We will develop positive landscape strategies with owners and partners such as Defra. In some circumstances, we may encourage the conversion from arable to pasture of especially sensitive locations to protect battlefield archaeology from the effects of ploughing and as part of a wider drive to prevent unauthorised or damaging metal-detecting.

English Heritage will also continue to encourage greater access to battlefields and improve their amenity value and visitors' appreciation of the impact these historic events had on our development as a nation.

Local authorities can also invite comments from the Battlefields Trust on planning applications affecting the setting of registered sites.

PROTECTED WRECK SITES

At the strategic level, the major sources of risk to designated wreck sites have been identified. In terms of high-priority sites, practical requirements have also been implemented through conservation management plans.

Risks to protected wreck sites can often be reduced through education, provision of marker buoys, or planning policies that take full account of their national importance. However, some sites require significant resources to stabilise their condition or to carry out detailed archaeological assessments of their conservation requirements. Although English Heritage has statutory

power to allocate funds to promote the preservation and maintenance of protected wreck sites, its financial resources can solve only a small proportion of the problems.

In spite of the inherent difficulties with caring for this type of site, careful management must be maintained if we are to avoid the loss of wreck sites. It is therefore close co-operation between the owners of protected wreck sites (where known), authorised divers and all organisations charged with care for the marine and coastal environment, that will make the real difference to their long-term survival.

Practical advice on the management of historic wreck sites, whether at the coast-edge or under water, is available from English Heritage (maritime@english-heritage.org.uk) and from www.helm.org.uk

CONSERVATION AREAS

The risks to conservation areas are difficult to address as they cover large areas of land: they include the spaces between buildings and trees as well as buildings and structures and therefore involve many different owners and methods of management. Looking after them is a responsibility shared by those of us who own homes and businesses in them as well as those of us whose job it is to manage the spaces between the buildings or make decisions about their future.

The Conservation Areas Survey, completed by local authorities, provides us with an understanding of what is particularly affecting the character and appearance of our conservation areas: what is working well or what is putting them at risk. Strong planning policies, guidance and a clear management strategy for individual conservation areas, backed up by effective enforcement, are all critical in managing change in these areas. However, this is extremely difficult at a time when local authorities across the country are reducing their staff numbers. Armed with the information provided by conservation area surveys, we, local authorities and other partners will have the evidence to direct resources much more accurately towards those conservation areas at greatest risk.

There are opportunities for members of the local community to get involved as well, either individually or through groups. Some local groups have helped to prepare character Appraisals and Management Plans for conservation areas whilst others have carried out their own assessments to identify management issues. Further information on how you can get involved is available at: www.english-heritage.org.uk/caring/get-involved/improving-your-neighbourhood

Publications and guidance

English Heritage has produced the following publications relating to heritage at risk, including:

Buildings at Risk: a New Strategy (1998)

Caring for Places of Worship 2010 (2010) – a report on the condition of England's listed places of worship and the needs of the congregations

Heritage at Risk 2010 – report (2010)

Heritage at Risk: Conservation Areas (2009)

Heritage at Risk 2012 – national report and summary leaflets for: East Midlands, East of England, London, North East, North West, South East, South West, West Midlands, Yorkshire and the Humber

Heritage at Risk Register 2012 – detailed listings for: East Midlands, East of England, London, North East, North West, South East, South West, West Midlands, Yorkshire and the Humber can be downloaded from our website or viewed as an interactive database: www.english-heritage.org.uk/risk

Monuments at Risk (2008) – summary of scheduled monuments at risk for: East Midlands, East of England, London, North East, North West, South East, South West, West Midlands, Yorkshire and the Humber

The Monuments at Risk initiative 2003–08 (2010)

Protected Wreck Sites at Risk: A Risk Management Handbook (2007)

Saving London: 20 Years of Heritage at Risk in the Capital (2010)

Stopping the Rot: A Guide to Enforcement Action to Save Historic Buildings (2011)

Vacant Historic Buildings: An Owner's Guide to Temporary Uses, Maintenance and Mothballing (2011)

HERITAGE AT RISK ON THE WEB

To find out more about the Heritage at Risk programme visit www.english-heritage.org.uk/risk where you will find an interactive database providing detailed information on all heritage sites at risk nationally.

For further information about the different classes of designated heritage assets, including listed buildings, scheduled monuments, registered parks and gardens, registered battlefields and protected wreck sites visit the Heritage Protection section of our website www.english-heritage.org.uk/heritageprotection

Details of all nationally designated historic places in England are available in one place on the National Heritage List for England online database: <http://list.english-heritage.org.uk>

CONSERVATION POLICIES AND GUIDANCE

The following publications are among the numerous guidance documents available on our website: www.english-heritage.org.uk/publications or www.english-heritage.org.uk/helm

Caring for Historic Graveyard and Cemetery Monuments (2011)

Caring for Our Shipwreck Heritage: Guidelines on the First Aid Treatment and Conservation Management of Finds Recovered from Designated Wreck Sites Resulting from Licensed Investigations (2012)

Caring for Places of Worship (2010) – a practical booklet for everyone involved in caring for England's listed places of worship

Constructive Conservation in Practice (2008)

Conservation Principles, Policies and Guidance for the Sustainable Management of the Historic Environment (2008)

Creativity and Care: New Works in English Cathedrals (2009)

The Disposal of Historic Buildings: Guidance Note for Government Departments and Non-Departmental Public Bodies (2010)

Enabling Development and the Conservation of Significant Places (2008)

Farming the Historic Landscape: Caring for Archaeological sites on Arable Land (2004)

Farming the Historic Landscape: Caring for Archaeological Sites in Grassland (2004)

Guidance on the Management of Conservation Areas (2006)

Guidance on Conservation Area Appraisals (2006)

Guidance Notes and Application Forms for Grants to Local Authorities:

- *Grants to Local Authorities to Underwrite Urgent Works Notices (1998)*
- *Acquisition Grants to Local Authorities to Underwrite Repairs Notices (1998)*
- *Grants for Historic Buildings, Monuments and Designed Landscapes (2004)*

Heritage at Risk: Conservation Areas (2009) – guidance for local authorities on conservation area management

Heritage Works: the use of Historic Buildings in Regeneration (2006)

Managing Local Authority Heritage Assets: Some Guiding Principles for Decision Makers (2003)

New Uses for Former Places of Worship (2010)

New Work in Historic Places of Worship (2012)

Options for the Disposal of Redundant Churches and Other Places of Worship (2010)

Paradise Preserved: An Introduction to the Assessment, Evaluation, Conservation and Management of Historic Cemeteries (2002)

Pillars of the Community: the Transfer of Local Heritage Assets (2011)

Scheduled Monument Consent: a Guide for Owners and Occupiers (2009)

Shared Interest: Celebrating Investment in the Historic Environment (2006)

Theft of Metal from Church Buildings (2011)

Valuing Places: Good Practice in Conservation Areas (2011)

If you would like further information about any of these publications, please contact:

English Heritage Customer Services Department
PO Box 569, Swindon SN2 2YP
Telephone: 0870 333 1181
Fax: 01793 414926
Email: customers@english-heritage.org.uk

THE REGISTER

Content and criteria

DESIGNATION

All the historic environment matters but there are some elements which warrant extra protection through the planning system. Since 1882, when the first Act protecting ancient monuments and archaeological remains was passed, government has been developing the designation system. Listing emerged from the post-blitz 1940s Planning Acts, and is now applied to about half a million buildings ranging from palaces to street lamps. Almost 20,000 archaeological sites are scheduled, which introduces tight management controls. Some 1,617 designed landscapes are registered, as are 43 battlefields, and 46 wreck sites are protected.

English Heritage, as the government's expert adviser, is responsible for making recommendations – but it is still the Secretary of State at the Department for Culture Media and Sport who makes the decisions on whether a site is designated. Understanding and appreciation develop constantly, which makes keeping the designation base up-to-date a never-ending challenge. While responding to threat-driven cases, we also seek to work strategically. Recent developments have seen a greater striving for openness and transparency in the process of designating a site, and better communication of what makes something special.

Conservation areas are designated locally by local planning authorities. They are areas of special architectural or historic interest the character or appearance of which it is desirable to preserve or enhance.

LISTED BUILDINGS

Definition

A listed building is a building (or structure) that has been designated as being of 'special architectural or historic interest'. The older and rarer a building is, the more likely it is to be listed. Buildings less than 30 years old are listed only if they are of outstanding quality and under threat.

Listed buildings are graded I, II* and II. Grade I and II* are particularly important buildings of outstanding interest; together they amount to 8% of all listed buildings. The remaining 92% are of special interest and are listed grade II.

Entries on the statutory list of buildings of special architectural or historic interest may comprise a number of separate buildings. Formal residential

terraces are the most obvious example. Entries on this Register reflect how buildings are grouped and recorded on the statutory list.

Structures can occasionally be both listed as buildings and scheduled as monuments.

Criteria for inclusion on this Register

Buildings (not in use as a public place of worship) considered for inclusion on this Register must be listed grade I or II*, (or grade II in London) or be a structural scheduled monument. Buildings are assessed for inclusion on the basis of condition and, where applicable, occupancy (or use). The condition of buildings on the Register ranges from 'very bad' to 'poor', 'fair' and (occasionally) 'good'. The Register also includes buildings that are vulnerable to becoming at risk because they are empty, under-used or face redundancy without a new use to secure their future.

Occupancy (or use) is noted as 'vacant', 'part occupied', 'occupied', or occasionally, 'unknown'; for many structural monuments, occupancy is not applicable.

Assessing vulnerability in the case of a building in fair condition necessarily involves judgement and discretion. A few buildings on the Register are in good condition, having been repaired or mothballed, but a new use or owner is still to be secured.

Buildings are removed from the Register when they are fully repaired/consolidated, their future secured, and where appropriate, occupied or in use.

Listed places of worship

Places of worship are the largest single group of non-domestic historic buildings still in use primarily for the purpose for which they were built. Their complex development over centuries is a testament to the changes in social, political and liturgical attitudes over time. This reflects the developing mission of congregations and means that they protect a wide range of fittings and furnishings of national and international importance. Their architectural, archaeological, aesthetic and historic significance is outstanding but so too is their value as the record of the endeavours and experiences of individuals and communities.

To date English Heritage has assessed a proportion of the 14,500 listed places of worship. In the coming years an increasing number of places of worship will be assessed to identify those that are at risk. Future registers will provide stronger evidence which will help us build upon our understanding of the challenges.

Criteria for inclusion on this Register

Places of worship considered for inclusion on this Register must be listed grade I, II* or II and be used as a public place of worship at least six times a year.

Places of worship are assessed on the basis of condition only. If the place of worship is in 'very bad' or 'poor' condition it is added to the Register. Places of worship previously included on the Register may be in any condition category.

Once on the Register, all places of worship can move through the condition categories (e.g. from very bad to poor; to fair; even good) as repairs are implemented and the condition improves, until they are fully repaired and can be removed from the Register.

Priority for action

Once a building is identified as at risk or vulnerable and included on the Register, priority for action is assessed on a scale of A to F, where 'A' is the highest priority for a building which is deteriorating rapidly with no solution to secure its future, and 'F' is the lowest priority where a repair scheme is in progress and an end use has been secured.

SCHEDULED MONUMENTS

Definition

Scheduled monuments include archaeological sites and landscapes, and 19,759 examples have been designated because of their national importance. Scheduled monuments are not graded, and most have limited potential for beneficial use. They cover human activity from the prehistoric era, such as burial mounds, to 20th century military and industrial remains. For the millennia before written history, archaeology is the only testament to innumerable generations of people of whom there is no other record.

The later 20th century saw unprecedented changes to the landscape. As a result, types of historic site that once were commonplace began to become rare. Those that survive often represent just small islands of what once characterised broad sweeps of our towns and countryside. Although protected by law, scheduled monuments are still at risk from a wide range of processes. In particular, they can frequently be exposed to intense pressures beyond the reach of the planning system. These include damage from cultivation, forestry and – often most seriously of all – wholly natural processes such as scrub growth, animal burrowing and erosion.

Criteria for inclusion on this Register

Scheduled monuments included on this Register have been identified as being at risk because of their condition and vulnerability, the trend in their condition, and their likely future vulnerability. A site's condition is expressed in terms of the scale and severity of adverse effects on it, ranging from those with 'extensive significant problems' to others that have only 'minor localised problems'.

Monuments are removed from the Register once sufficient progress has been made to address identified issues, demonstrating a significant reduction in the level of risk.

REGISTERED PARKS AND GARDENS

Definition

There are 1,617 designed landscapes on the current English Heritage *Register of Historic Parks and Gardens of Special Historic Interest*. These registered landscapes are graded I, II* or II, and include private gardens, public parks and other green spaces, country estates and cemeteries. They are valued for their design, diversity and historical importance and in contrast to the number of listed buildings and scheduled monuments, registered parks and gardens is a very small group of assets.

Inclusion on the English Heritage *Register of Historic Parks and Gardens* brings no additional statutory controls, but there is a presumption in favour of conservation of the designated site. Local authorities are required to consult English Heritage on applications affecting sites registered as grade I or II* and the Garden History Society on sites of all grades.

Criteria for inclusion on this Register

The identification of registered parks and gardens at risk begins with an appraisal of the condition and vulnerability of each registered landscape. Steps being taken by owners to address problems are also taken into consideration.

Landscapes assessed as being at risk are typically affected by development and neglect. They have frequently been altered by development or are faced with major change. The original function of these landscapes has often changed; and divided ownership often results in the loss of the cohesive conservation of the historic designs.

Landscapes are removed from the Register once plans are put in place to address issues and positive progress is being made.

REGISTERED BATTLEFIELDS

Definition

English Heritage's *Register of Historic Battlefields* has identified 43 nationally significant sites ranging in date from 991 to 1685. These are places where people risked their lives fighting for a cause and where history was made. The outcome of these battles was influenced by where they were fought and traces of the events will have been left across the landscape. Battlefields are cherished for many reasons, as a commemoration of the event and those who died, as a resource for understanding the course of the battle, and for the light they can shed on the times in which the battle was fought. They are vulnerable to insensitive development and to poorly managed investigation such as large-scale metal-detecting. While this designation introduces no additional statutory controls, one of its primary objectives is to encourage policies and other mechanisms that ensure that change and development affecting battlefields is sensitive and appropriate.

Criteria for inclusion on this Register

Battlefields deemed to be at risk of loss of historic significance are included on this Register.

The identified risks and threats come from development pressure – for example, because they lie on urban fringes or are subject to development pressures within the site; arable cultivation, and unregulated metal-detecting. One major impact or a combination of several factors can be enough to raise the risk at a particular site.

Battlefields are removed from the Register when either actual damaging activities are reversed or managed, or threats recede due to effective management planning.

PROTECTED WRECK SITES

Definition

England's 46 protected wreck sites represent a tiny proportion of the 32,476 pre-1945 wrecks and recorded casualties that are known to lie in the territorial sea. Wreck sites can be of importance for different reasons: the distinctive design or construction of a ship, the story it can tell about its past, its association with notable people or events, its cargo, flora and fauna or its role as a focus for the local community. The Protection of Wrecks Act 1973 empowers the appropriate Secretary of State to designate a restricted area around a vessel to protect it or its contents from unauthorised interference.

Local authorities are able to react to foreshore infrastructure projects through the planning process, thereby securing the preservation of important remains in this intertidal zone.

Criteria for inclusion on this Register

English Heritage has audited all designated wreck sites to identify those most at risk based on their current condition, vulnerability and the way they are being managed. Wrecks are vulnerable to both environmental and human impacts. Risks that contribute to the inclusion on the Register range from unauthorised access to erosion and fishing damage.

The monitoring process ensures that the significance of the site is identified and maintained.

In spite of the inherent difficulties in caring for this type of site, careful management must be maintained.

Wrecks are removed from the Register once an appropriate management and monitoring regime is operational.

CONSERVATION AREAS

Definition

Conservation areas are designated by local authorities and are areas of special architectural or historic interest the character or appearance of which it is desirable to preserve or enhance. For more than 40 years conservation areas have proved a highly effective mechanism for managing change on an area-wide basis. There are currently some 9,700 conservation areas in England including town and city centres, suburbs, industrial areas, rural landscapes, cemeteries and residential areas. They form the historic backcloth to national and local life and are a crucial component of local identity and community cohesion.

Criteria for inclusion on this Register

English Heritage has asked every local authority in England to complete (and update as appropriate) a survey of its conservation areas, highlighting current condition, threats and trends, identifying those that are deteriorating, or are in very bad or poor condition and are not expected to change significantly in the next three years, as being defined as at risk.

The methodology for assessing conservation areas at risk has been refined since the first survey in 2008/2009. The information collated provides a detailed assessment of each conservation area and an overall category for condition, vulnerability and trend is included for each conservation area on this Register. Conservation areas identified as at risk in 2009, but not reassessed since using the revised methodology, are included on the Register but with limited information.

Conservation areas are removed from the Register once plans have been put in place to address the issues that led to the conservation area being at risk, and once positive progress is being made.

Key to the entries

This Register includes the following heritage assets at risk:

- grade I and II* listed buildings and structural scheduled monuments
- grade I, II* and II listed places of worship
- scheduled monuments
- registered parks and gardens
- registered battlefields
- protected wreck sites
- conservation areas

ORDER

Entries are grouped and ordered alphabetically first by County or Unitary Authority, and then by Local Planning Authority (National Park/Unitary Authority/District or Borough).

Sites that straddle more than one local planning authority are included under the lead authority.

Asset types are grouped within the relevant planning authority in the following order:

- listed buildings and structural scheduled monuments
- places of worship
- scheduled monuments
- registered parks and gardens
- registered battlefields
- protected wreck sites (listed at the end of the County off which they are located)
- conservation areas

Within each asset type, sites are ordered alphabetically by district for sites in National Parks, otherwise by parish and street/site name. Conservation areas and protected wreck sites are ordered by site name only.

DESIGNATION

The principal designation is noted for each entry and includes:

- Listed Building (LB) Grade I, II* or II
- Listed Place of Worship Grade I, II* or II
- Scheduled Monument (SM)
- Registered Park and Garden (RPG) Grade I, II* or II
- Registered Battlefield
- Protected Wreck Site
- Conservation Area (CA)

Other designations that apply to buildings at risk and registered parks and gardens at risk, including their location within a World Heritage Site (WHS), are also noted where applicable.

The National Heritage List for England reference number is noted for scheduled monuments.

CONDITION

For buildings (including places of worship) at risk, condition is graded as: 'very bad', 'poor', 'fair' and 'good'.

For sites that cover areas (scheduled monuments, registered parks and gardens, registered battlefields and protected wreck sites) one overall condition category is recorded. The category may relate only to the part of the site or monument that is at risk and not the whole site:

- extensive significant problems
- generally unsatisfactory with major localised problems
- generally satisfactory but with significant localised problems
- generally satisfactory but with minor localised problems
- optimal
- unknown (is noted for a number of scheduled monuments that are below-ground and where their condition cannot be established).

For conservation areas, condition is categorised as: 'very bad', 'poor', 'fair' and 'optimal'.

If a site has suffered from heritage crime it is noted in the summary. Heritage crime is defined as any offence which harms the heritage asset or its setting and includes arson, graffiti, lead theft and vandalism.

OCCUPANCY / USE

For buildings (excluding places of worship) that can be occupied or have a use, the main vulnerability is vacancy, or under-use. Occupancy (or use) is noted as follows:

- vacant
- part occupied
- occupied
- unknown
- not applicable

VULNERABILITY

Principal vulnerability is noted for scheduled monuments and may relate only to the part of the monument which is at risk, and include:

- animal burrowing
- arable ploughing
- coastal erosion
- collapse
- deterioration – in need of management
- scrub/tree growth
- visitor erosion.

For registered parks and gardens, registered battlefields, protected wreck sites and conservation areas, vulnerability is noted as high, medium or low.

PRIORITY

For buildings at risk, the following priority categories are used as an indication of trend and as a means of prioritising action:

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

2011 priority categories are given in brackets.

TREND

Trend for scheduled monuments, registered parks and gardens, registered battlefields and protected wreck sites may relate only to the part of the site that is at risk and is categorised as:

- declining
- stable
- improving
- unknown

For conservation areas trend is categorised as:

- deteriorating
- deteriorating significantly
- no significant change
- improving
- improving significantly
- unknown

OWNERSHIP

A principal ownership category is given for each entry, although many scheduled monuments, registered parks and gardens, and registered battlefields are in divided ownership. For registered parks and gardens, single or multiple ownership is noted.

CONTACT

This is the member of the English Heritage regional team who acts as a first point of contact for the case, and to whom enquiries should be addressed.

For conservation areas, the contact is the conservation/planning officer at the relevant local planning authority (indicated by 'LPA').

We are not in any sense agents for the owners of the sites included, but we will endeavour to put people in touch with them where appropriate.

ABBREVIATIONS

CA	Conservation Area
EH	English Heritage
HLF	Heritage Lottery Fund
LPA	Local Planning Authority
LB	Listed Building
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

Heritage at risk entries by local planning authority

	Buildings at risk	Places of worship at risk	Scheduled monuments at risk	Registered parks and gardens at risk	Registered battlefields at risk	Protected wreck sites at risk	Conservation areas at risk
BRACKNELL FOREST (UA)							
Bracknell Forest (UA)	0	0	0	2	0	0	0
BRIGHTON AND HOVE, CITY OF (UA)							
Brighton and Hove, City of (UA)	5	3	0	0	0	0	5
SOUTH DOWNS (NP)							
South Downs (NP)	1	0	1	0	0	0	0
South Downs (NP) / Brighton and Hove, City of (UA) / Lewes*	0	0	0	1	0	0	0
BUCKINGHAMSHIRE							
Aylesbury Vale	6	2	2	1	0	0	0
Aylesbury Vale / Dacorum*	0	0	0	1	0	0	0
Chiltern	0	0	0	0	0	0	0
South Bucks	1	0	0	0	0	0	6
Wycombe	0	2	6	0	0	0	0
Wycombe / South Oxfordshire / Wokingham (UA)*	0	0	0	1	0	0	0
EAST SUSSEX							
Eastbourne	3	0	0	0	0	0	0
Hastings	3	2	0	0	0	0	0
Lewes	1	0	0	0	0	0	1
Rother	6	1	1	0	0	0	0
South Downs (NP)	2	1	11	0	0	0	0
Wealden	2	1	2	1	0	0	0
OFF EAST SUSSEX							
Off East Sussex	0	0	0	0	0	1	0
HAMPSHIRE							
Basingstoke and Deane	2	1	8	0	0	0	0
East Hampshire	0	1	1	0	0	0	0
Eastleigh	0	0	0	0	0	0	0
Fareham	3	1	0	0	0	0	0
Gosport	4	0	0	0	0	0	0
Hart	2	0	0	2	0	0	0
Havant	0	0	0	0	0	0	0
New Forest	0	0	6	0	0	0	0
New Forest (NP)	2	0	5	0	0	0	0
Rushmoor	2	0	0	0	0	0	0
South Downs (NP)	3	1	14	0	0	0	10
Test Valley	0	1	16	1	0	0	0
Winchester	2	0	7	0	0	0	11
OFF HAMPSHIRE							
Off Hampshire	0	0	0	0	0	1	0
ISLE OF WIGHT (UA)							
Isle of Wight (UA)	4	6	5	1	0	0	5

KENT								
Ashford	2	3	1	0	0	0	0	0
Canterbury	4	1	1	0	0	0	0	0
Dartford	0	0	2	0	0	0	0	0
Dover	4	0	5	0	0	0	0	0
Gravesham	1	2	0	0	0	0	0	0
Maidstone	7	1	2	0	0	0	0	2
Sevenoaks	0	1	1	1	0	0	0	7
Sevenoaks / Tunbridge Wells*	0	0	0	1	0	0	0	0
Shepway	5	1	4	0	0	0	0	0
Swale	10	3	0	0	0	0	0	0
Thanet	3	1	8	0	0	0	0	0
Tonbridge and Malling	1	0	3	0	0	0	0	0
Tunbridge Wells	1	0	1	0	0	0	0	1
Tunbridge Wells / Tonbridge and Malling*	0	0	0	1	0	0	0	0
Tunbridge Wells / Wealden*	0	0	0	1	0	0	0	0
OFF KENT								
Off Kent	0	0	0	0	0	2	0	0
MEDWAY (UA)								
Medway (UA)	12	0	0	0	0	0	0	3
MILTON KEYNES (UA)								
Milton Keynes (UA)	1	0	6	0	0	0	0	0
OXFORDSHIRE								
Cherwell	1	2	6	0	0	0	0	3
Oxford	0	1	1	0	0	0	0	0
South Oxfordshire	5	4	10	0	0	0	0	0
Vale of White Horse	1	0	8	0	0	0	0	0
West Oxfordshire	0	3	24	0	0	0	0	0
PORTSMOUTH, CITY OF (UA)								
Portsmouth, City of (UA)	11	1	0	0	0	0	0	0
READING (UA)								
Reading (UA)	2	0	1	0	0	0	0	0
SLOUGH (UA)								
Slough (UA)	0	0	0	0	0	0	0	0
SOUTHAMPTON, CITY OF (UA)								
Southampton, City of (UA)	3	1	0	0	0	0	0	0
SURREY								
Elmbridge	3	0	0	0	0	0	0	1
Epsom and Ewell	1	0	0	0	0	0	0	4
Guildford	0	1	0	1	0	0	0	0
Mole Valley	2	1	3	1	0	0	0	0
Reigate and Banstead	1	0	0	0	0	0	0	0
Runnymede	0	0	0	1	0	0	0	0
Spelthorne	0	2	0	0	0	0	0	0
Surrey Heath	0	0	0	0	0	0	0	0
Tandridge	1	0	1	0	0	0	0	0
Waverley	0	0	1	0	0	0	0	0
Woking	0	0	0	1	0	0	0	0
WEST BERKSHIRE (UA)								
West Berkshire (UA)	6	2	6	3	1	0	0	0

WEST SUSSEX							
Adur	0	0	0	0	0	0	1
Arun	2	0	1	0	0	0	0
Chichester	1	1	3	1	0	0	1
Crawley	0	0	0	0	0	0	0
Horsham	1	4	2	0	0	0	0
Mid Sussex	0	0	1	0	0	0	0
South Downs (NP)	4	1	17	0	0	0	0
Worthing	0	2	0	0	0	0	0
WINDSOR AND MAIDENHEAD (UA)							
Windsor and Maidenhead (UA)	2	0	0	0	0	0	1
WOKINGHAM (UA)							
Wokingham (UA)	2	0	4	1	0	0	0
TOTAL	154	62	208	24	1	4	62

*Sites that cross local planning authority boundaries

BRACKNELL FOREST (UA)



SITE NAME:	Newbold College (formerly Moor Close), Binfield
DESIGNATION:	Registered Park and Garden Grade II*, also 7 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Corporate, single owner

Moor Close estate, now the home of Newbold College, was Oliver Hill's first house and garden design in an early C20 Arts & Crafts style. The hard landscape features are deteriorating and in urgent need of renovation. A condition survey was completed with a grant from English Heritage but an ensuing application to the Heritage Lottery Fund was unsuccessful. Further resources and action are urgently needed. The garden and park setting is also threatened by a cluster of housing development under consideration. Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Broadmoor Hospital, Crowthorne
DESIGNATION:	Registered Park and Garden Grade II, also I LB
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Corporate, single owner

A mid C19 asylum, built for the criminally insane to designs by Joshua Jebb. The site is undergoing major redevelopment. The secure psychiatric hospital is to be relocated and the main building converted to an hotel. The extensive walled garden is to be developed for housing. The ornamented farmland has survived but needs managing. Close liaison with the owner and local authority is necessary to ensure what remains in terms of historic significance can be salvaged. Contact: Principal Heritage at Risk Adviser 01483 252000

BRIGHTON AND HOVE, CITY OF (UA)



SITE NAME:	Saltdean Lido, Marine Drive, Saltdean
DESIGNATION:	Listed Building Grade II*
CONDITION:	Poor
OCCUPANCY:	Occupied
PRIORITY:	C (C)
OWNER TYPE:	Local authority

Lido of 1938 by RWH Jones in Moderne style, operated by a private leaseholder. It is suffering from a maintenance backlog and there is a particular deterioration of its reinforced concrete and metal-framed windows. Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	The West Pier, Kings Road, Brighton
DESIGNATION:	Listed Building Grade I, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Trust

Pier, 1864-66 by Eugenius Birch. Closed in 1975. English Heritage has declared its view that the combination of significant damage and cost of repair make restoration from public funds uneconomic. Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Marlborough House, 54 Old Steine, Brighton and Hove, Brighton
DESIGNATION:	Listed Building Grade I, CA
CONDITION:	Fair
OCCUPANCY:	Vacant
PRIORITY:	E (E)
OWNER TYPE:	Private

House, now office. Built 1765, remodelled in 1786 by Robert Adam. Some holding repairs have recently been carried out, but the building is currently vacant. Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	53 Brunswick Square, Hove
DESIGNATION:	Listed Building Grade I, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied
PRIORITY:	C (C)
OWNER TYPE:	Private

Terraced house by A Wids and C A Busby, 1825-27. Used for multiple occupancy but now largely vacant. The rear elevation and outbuildings are in poor condition and parts of the building are not habitable. Made temporarily weathertight but no long-term solution in place. Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.
- E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA Conservation Area
- LB Listed Building
- LPA Local Planning Authority
- NP National Park
- RPG Registered Park and Garden
- SM Scheduled Monument
- UA Unitary Authority
- WHS World Heritage Site



SITE NAME: **Mews building to the rear of No. 14, 14 Brunswick Square, East Sussex, Hove**

Terraced house, 1825-7. Mews to the rear of 14 Brunswick Square. Repair works underway, but not complete.

DESIGNATION: Listed Building Grade I, CA

CONDITION: Fair

OCCUPANCY: Part occupied

PRIORITY: F (F)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Chapel Royal, North Street, Brighton**

The chapel was built between 1793-95, by Thomas Saunders, for the Vicar of Brighton, Thomas Hudson. In 2012 urgent repairs with funds from English Heritage and Heritage Lottery Fund are being carried out to the main roof and tower roof; parapet gutters and clearance and redecoration of rainwater goods.

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Poor

PRIORITY: F (New entry)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Peter, St Peters Place, Brighton**

Repair Grant for Places of Worship offered 2009 for project development and repairs to the lower tower roof, north aisle roof, north aisle ceiling, south aisle roof and ceiling, nave roof and ceiling and north clerestory walls. Repairs are currently underway. However, further urgent repairs are needed to the main tower roof, associated masonry and other areas, and this will be the subject of a grant application in 2012.

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Poor

PRIORITY: B (New entry)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Church of St Paul and attached walls, West Street, Brighton**

St Paul's is an Anglican church designed by Richard Cromwell Carpenter in 1846-8 and built by George Cheeseman. The tower and spire are by Richard Herbert Carpenter; the narthex, fishermen's institute (west end) and covered way by George Frederick Bodley. Large fragments of stone and flint have fallen from the tower, which is adjacent to a busy shopping street. This has been temporarily protected. Tower suffers from apparent maintenance problems.

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Poor

PRIORITY: A (New entry)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Benfield Barn	
DESIGNATION:	Conservation Area	CONDITION: Poor
VULNERABILITY:	Low	TREND: Deteriorating
CONTACT:	Tim Jefferies (LPA) 01273 293152	NEW ENTRY: No

SITE NAME:	East Cliff	
DESIGNATION:	Conservation Area	CONDITION: Poor
VULNERABILITY:	Low	TREND: Deteriorating
CONTACT:	Tim Jefferies (LPA) 01273 293152	NEW ENTRY: No

SITE NAME:	Queen's Park	
DESIGNATION:	Conservation Area	CONDITION: Poor
VULNERABILITY:	Medium	TREND: Deteriorating
CONTACT:	Tim Jefferies (LPA) 01273 293152	NEW ENTRY: No

SITE NAME:	Sackville Gardens	
DESIGNATION:	Conservation Area	CONDITION: Poor
VULNERABILITY:	Medium	TREND: Deteriorating
CONTACT:	Tim Jefferies (LPA) 01273 293152	NEW ENTRY: No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA** Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WH World Heritage Site

SITE NAME:	Valley Gardens		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Tim Jefferies (LPA) 01273 293152	NEW ENTRY:	No

SOUTH DOWNS (NP)

SITE NAME:	The stables at Stanmer House, Stanmer Park, Brighton	Stables probably C18. Much altered and empty for some years.
DESIGNATION:	Listed Building Grade II*, CA	
CONDITION:	Poor	
OCCUPANCY:	Vacant	
PRIORITY:	C (D)	
OWNER TYPE:	Private	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Earthworks and lynchets near Eastwick Barn, Patcham, Brighton and Hove		
DESIGNATION:	Scheduled Monument (No.1002303)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SOUTH DOWNS (NP) / BRIGHTON AND HOVE, CITY OF (UA) / LEWES

SITE NAME:	Stanmer Park, Stanmer, Falmer/Ditchling	C18 estate village set in a landscape park with informal pleasure grounds. Brighton Borough bought it in 1947 as a public amenity but the park was left to decline. There are multiple ownership issues and implementation of the landscape restoration management plan (2003) progresses as opportunities arise. A road widening scheme is to slice through the southern boundary wall. However, the 2010 extension of the Conservation Area should increase protection for that part of the park and garden.
DESIGNATION:	Registered Park and Garden Grade II, also part in CA, 19 LBs, 3 SMs	
CONDITION:	Extensive significant problems	
VULNERABILITY:	High	
TREND:	Stable	
OWNER TYPE:	Mixed, multiple owners	Contact: Principal Heritage at Risk Adviser 01483 252000

BUCKINGHAMSHIRE**AYLESBURY VALE**

SITE NAME:	Barn at New Manor Farm, Broughton Lane, Bierton with Broughton	Barn, late C12 and later. Propped with scaffolding and with a temporary roof covering. Urgent works have been carried out. A historic building analysis has been carried out with English Heritage grant aid.
DESIGNATION:	Listed Building Grade II*	
CONDITION:	Very bad	
OCCUPANCY:	Vacant	
PRIORITY:	C (A)	
OWNER TYPE:	Private	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Mentmore Towers, Mentmore	Building vacant for a number of years. Listed building consent and planning permission granted for conversion to a hotel together with a major extension. Planning for the implementation of these consents has stopped 2009. Emergency works undertaken to central roof lantern. The service wing roof remains in very poor condition.
DESIGNATION:	Listed Building Grade I, RPG II*	
CONDITION:	Poor	
OCCUPANCY:	Vacant	
PRIORITY:	A (A)	
OWNER TYPE:	Company	Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Temple of Friendship, Stowe Landscape Garden, Stowe
DESIGNATION:	Listed Building Grade I, CA, RPG I
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	C (C)
OWNER TYPE:	Trust

Garden temple, 1739, situated in the south-east corner of the pleasure gardens, close to the Palladian Bridge and with views to the north over the lake and Hawkwell Field beyond. The Tuscan portico has been consolidated and has a new roof, however the cellar and two flanking loggias remain roofless.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	The East Boycott Pavilion, Stowe Landscape Garden, Stowe
DESIGNATION:	Listed Building Grade I, CA, RPG I
CONDITION:	Poor
OCCUPANCY:	Part occupied
PRIORITY:	C (C)
OWNER TYPE:	Trust

One of a pair of large stone pavilions, circa 1728, by James Gibbs, incorporating domestic accommodation. Situated either side of the Oxford Avenue, at the south-west of The Course which is the main approach to the house. Roof repairs needed and cupola needs reinstating.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	The Palladian Bridge, Stowe Landscape Garden, Stowe
DESIGNATION:	Listed Building Grade I, CA, RPG I
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY:	D (D)
OWNER TYPE:	Trust

Covered bridge built in 1738; attributed to James Gibbs, situated in the south-east corner of the pleasure grounds. Bridge is viewed from the west across the Octagon Lake, and from the north-west and north across Hawkwell Fields. Steady decay of the roof covering, ceiling plaster and masonry. Holding repairs have been carried out, but more work needed.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	The Queens Temple, Stowe Landscape Garden, Stowe
DESIGNATION:	Listed Building Grade I, CA, RPG I
CONDITION:	Fair
OCCUPANCY:	Occupied
PRIORITY:	F (F)
OWNER TYPE:	Trust

Pavilion of 1740, attributed to James Gibbs, remodelled 1770. Sited c300m to east of house in pleasure grounds. Main views from the temple to the south, over fields to the Gothic temple, Palladian Bridge and Temple of Friendship. Overflow detection installed in roof, including a new chute. Masonry repairs completed. Works to interior and roofs to be carried out. Structural monitoring of portico being carried out.


Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of All Saints, Church End, Hillesden
DESIGNATION:	Listed Place of Worship Grade I
CONDITION:	Poor
PRIORITY:	A (New entry)
OWNER TYPE:	Religious organisation

Parish church. Mid C15 west tower of rubble stone. Remainder rebuilt after 1493 in ashlar; restored 1874-5 by Sir George Gilbert Scott, and again in 1960. The high level stonework is in very bad condition which puts this church on the Heritage at Risk Register.

Contact: Principal Heritage at Risk Adviser 01483 252000

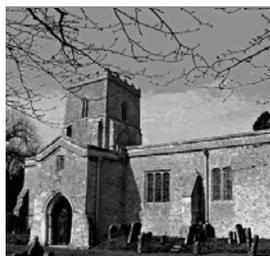

SITE NAME:	Church of St Mary the Virgin, Church Lane, Ludgershall
DESIGNATION:	Listed Place of Worship Grade I, CA
CONDITION:	Poor
PRIORITY:	F (D)
OWNER TYPE:	Religious organisation

Largely C14 church with C19 restorations. In March 2010 much of the nave roof was vandalised, leaving the timber work open to the elements. Repairs required to decaying roof timbers and roof covering. Renewal of rainwater disposal systems on tower, nave aisles and porch and stonework repairs and repointing. Deathwatch beetle infestation to damp timbers evident. A Repair Grant for Places of Worship was offered to support these remedial works, and repairs are taking place in 2012-13.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

A small multivallate hillfort on Southend Hill, Cheddington

DESIGNATION:	Scheduled Monument (No.1017517)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	A slight univallate hillfort 600m south east of Home Farm, Maids Moreton		
DESIGNATION:	Scheduled Monument (No.1018453)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Halton House, Halton/Aston Clinton	A Rothschild country house with late C19 formal gardens and park with woodland rides. The estate was sold to the RAF in 1918 and Halton House is now the Officers' Mess. The Forestry Commission manage the woodland rides. Some of the ornamental features of the garden are in poor condition. A landscape Conservation Management Plan has been written and will be used for assessing options for a proposed accommodation block.
DESIGNATION:	Registered Park and Garden Grade II, also part in CA, 5 LBs	
CONDITION:	Extensive significant problems	
VULNERABILITY:	High	
TREND:	Stable	
OWNER TYPE:	Mixed, multiple owners	Contact: Principal Heritage at Risk Adviser 01483 252000

BUCKINGHAMSHIRE / HERTFORDSHIRE

AYLESBURY VALE / DACORUM



SITE NAME:	Mentmore Towers, Mentmore/Tring Rural/Cheddington	Sir Joseph Paxton designed both the house and the park and gardens. The house and gardens were sold in 2000 and permission granted in 2005 to convert to an hotel. The adjacent golf course was also bought by the developer thus reuniting most of the site. The permission has not yet been implemented and Mentmore's future is still uncertain.
DESIGNATION:	Registered Park and Garden Grade II*, also CA, 10 LBs	
CONDITION:	Extensive significant problems	
VULNERABILITY:	High	
TREND:	Declining	
OWNER TYPE:	Mixed, multiple owners	Contact: Principal Heritage at Risk Adviser 01483 252000

BUCKINGHAMSHIRE

SOUTH BUCKS



SITE NAME:	Aviary at Dropmore House, Heathfield Road, Taplow	Aviary, early C19, situated on south side of range of buildings to west of the house. Vandalised and neglected for some years. Situated within late C18 to early C19 gardens in a ruinous condition. Woodland to the north and west in poor condition. Park to south and east is in good condition. Mansion has been repaired and converted to residential use. Consent granted for repair of aviary, but work has not started.
DESIGNATION:	Listed Building Grade I, RPG II	
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY:	B (B)	
OWNER TYPE:	Private	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Burnham		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Conservation & Design Team (LPA) 01895 837 374	NEW ENTRY:	No

SITE NAME:	Gerrards Cross Common		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	No significant change
CONTACT:	Conservation & Design Team (LPA) 01895 837 374	NEW ENTRY:	No

SITE NAME:	Iver		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Conservation & Design Team (LPA) 01895 837 374	NEW ENTRY:	No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Stoke Green		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	No significant change
CONTACT:	Conservation & Design Team (LPA) 01895 837 374	NEW ENTRY?:	No

SITE NAME:	Taplow Riverside		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Unknown
CONTACT:	Conservation & Design Team (LPA) 01895 837 374	NEW ENTRY?:	No

SITE NAME:	Uxbridge Lock		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Unknown
CONTACT:	Conservation & Design Team (LPA) 01895 837 374	NEW ENTRY?:	No

WYCOMBE



SITE NAME:	Church of St Mary the Virgin, Well Hill Road, Fawley Green, Fawley
DESIGNATION:	Listed Place of Worship Grade II*, CA
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

Village church of medieval origins with extensive remodelling in the mid-C18 and major restoration in 1882-3. At risk due to stone decay to tower; including string courses and openings, roof tiling uneven, especially to south transept and defective valley gutter; north of the chancel. A Repair Grant for Places of Worship has been offered to support the cost of repair work.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of St Francis, Terriers, High Wycombe
DESIGNATION:	Listed Place of Worship Grade II*
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

Skillfully planned and detailed suburban church set well back from the main road to the north east of the town centre. Has poor rainwater disposal system which has led to internal damage to plaster work. A Repair Grant for Places of Worship has been offered to assist with the cost of repairs.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bell barrow 260m WNW of Slough Glebe Farm, part of the Saunderton Lee barrow cemetery, Bledlow cum Saunderton		
DESIGNATION:	Scheduled Monument (No.1013953)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 140m WNW of Slough Glebe Farm, part of the Saunderton Lee round barrow cemetery, Bledlow cum Saunderton		
DESIGNATION:	Scheduled Monument (No.1013954)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Roman villa east of Lodge Hill Farm, Bledlow cum Saunderton		
DESIGNATION:	Scheduled Monument (No.1014599)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Two bowl barrows 450m north west of Slough Glebe Farm, part of the Saunderton Lee barrow cemetery, Bledlow cum Saunderton		
DESIGNATION:	Scheduled Monument (No.1013952)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Motte and bailey castle, moated site and Roman villa immediately east of All Saint's Church, Great and Little Kimble		
DESIGNATION:	Scheduled Monument (No.1018007)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive stock erosion	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Roman villa north of Yewden Lodge, Hambleden		
DESIGNATION:	Scheduled Monument (No.1014606)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

BUCKINGHAMSHIRE / OXFORDSHIRE

WYCOMBE / SOUTH OXFORDSHIRE / WOKINGHAM (UA)

	SITE NAME:	Fawley Court and Temple Island, Fawley/Henley-on-Thames/Remenham	Early C18 garden and pleasure grounds surrounding a 1680s house set within a park landscaped by Lancelot Brown. Most of the estate and park are in separate ownership. Discussions with the new owner of the house and pleasure grounds are underway. English Heritage agreed to works to improve the vegetation structure within the gardens but requested a landscape Conservation Management Plan that engages with the other key owners, before agreeing to any further major works. A joined up approach to management is essential. Contact: Principal Heritage at Risk Adviser 01483 252000
	DESIGNATION:	Registered Park and Garden Grade II*, also CA, 18 LBs	
	CONDITION:	Generally unsatisfactory with major localised problems	
	VULNERABILITY:	High	
	TREND:	Stable	
	OWNER TYPE:	Private, multiple owners	

EAST SUSSEX

EASTBOURNE

	SITE NAME:	Eastbourne Redoubt, Eastbourne	A redoubt built as part of the Martello system, 1806. Main parts are in use as a museum. The aquarium building, which occupies casemates and the mast on the south west side, is in very poor condition. The surviving caponieres suffer from water ingress. Moat walls are decaying. Contact: Principal Heritage at Risk Adviser 01483 252000
	DESIGNATION:	Listed Building Grade II, SM, CA	
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied	
	PRIORITY:	C (C)	
	OWNER TYPE:	Local authority	

	SITE NAME:	Martello Tower No. 64, Eastbourne	Martello tower, 1806. On the beach with a housing development nearby. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use. Contact: Principal Heritage at Risk Adviser 01483 252000
	DESIGNATION:	Listed Building Grade II, SM	
	CONDITION:	Poor	
	OCCUPANCY:	Vacant	
	PRIORITY:	C (C)	
	OWNER TYPE:	Company	

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Martello Tower No. 66,
Langney Point,
Eastbourne**

DESIGNATION: Listed Building Grade II, SM

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: E (C)

OWNER TYPE: Company

Martello tower, 1806. On the beach near the harbour entrance. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use.

Contact: Principal Heritage at Risk Adviser 01483 252000

HASTINGS



SITE NAME: **Pelham Arcade,
1-12 and 12A Pelham Place,
Hastings**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Poor

OCCUPANCY: Part occupied

PRIORITY: E (A)

OWNER TYPE: Private

Semi-subterranean arcade of shops, developed as the first part of the Pelham scheme by Joseph Kay in 1823-5. Poor drainage from the carriage drive above the Arcade and structural failures in its formerly glazed lantern have resulted in problems of damp, particularly to the rear. A package of repairs, grant aided by English Heritage is underway.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Statue of Queen Anne south east
of Holmhurst St Mary's School,
The Ridge, Baldslow, Hastings**

DESIGNATION: Listed Building Grade II*

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: A (A)

OWNER TYPE: Trust

Statue, 1711-12 in grounds of former convent (now sold separately). The statue is not being maintained and is deteriorating more rapidly through rainwater from overhanging trees and saline rain off the sea.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Remains of Manor House,
Ore Place, Ore,
Hastings**

DESIGNATION: Scheduled Monument, CA

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: A (A)

OWNER TYPE: Local authority

Ruins of late medieval manor house surrounded by new housing development, close to Old St Helens Church. The ruins are being damaged by heavy vegetation growth.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Mary Magdalen,
St Margaret's Road**

DESIGNATION: Listed Place of Worship Grade II, CA

CONDITION: Very bad

PRIORITY: A (A)

OWNER TYPE: Religious organisation

Decorated-style church in prominent position in St Leonards, with four-stage south west tower. Facing stonework and roofs in a fair condition but the tracery stonework is in a very poor condition.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **United Reformed Church,
Cambridge Road,
Hastings**

DESIGNATION: Listed Place of Worship Grade II

CONDITION: Poor

PRIORITY: A (New entry)

OWNER TYPE: Religious organisation

Very large and significant building in central Hastings. Very unspoilt interior; good example of building type and by local architect who has contributed to many local buildings. Good planning of difficult site. Rainwater system very poor and needs replacing with more outlets, wider rainwater goods, more efficient drops. Movement cracks are allowing rain penetration.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

D Slow decay; solution agreed but not yet implemented.

E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

F Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

LEWES



SITE NAME: **Newhaven Fort; Caponier, Fort Road, Newhaven**

Caponier of Newhaven Fort. Victorian caponier is in very poor condition in places. Lunette battery was repaired with English Heritage grant by Lewes District Council in 2009.

DESIGNATION: Scheduled Monument

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Local authority

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Seaford Town Centre

DESIGNATION: Conservation Area

CONDITION: Poor

VULNERABILITY: Medium

TREND: Deteriorating

CONTACT: Chris Morris (LPA) 01273 471600

NEW ENTRY: No

ROTHER



SITE NAME: **Martello Tower No. 55, Normans Bay, Bexhill**

Martello tower built 1806. Work is underway to convert the tower for occasional residential use. This tower has been substantially altered in the past and the new work has been designed to have limited additional impact on its heritage significance and character.

DESIGNATION: Listed Building Grade II, SM

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: F (F)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Martello Tower No. 28, Rye Harbour, Icklesham**

A derelict martello tower built 1806. Situated on the edge of a caravan park. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use.

DESIGNATION: Listed Building Grade II, SM

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: A (A)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Grey Friars (Winchelsea Priory), Friars Road, Winchelsea, Icklesham**

Ruins of a monastic church circa 1310-20, in the grounds of a C19 mansion.

DESIGNATION: Listed Building Grade I, SM, CA

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: C (D)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Grey Friars boundary wall, Friars Road, Winchelsea, Icklesham**

The C19 boundary wall to the Grey Friars mansion has suffered from multiple collapses and further collapses are likely.

DESIGNATION: Scheduled Monument, CA

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: A (A)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Austin Friars Chapel, Conduit Hill, Rye
DESIGNATION:	Listed Building Grade II, SM, CA
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

Remains of a friary chapel dating from about 1380. Vacant at present, but a new use is being sought. The window tracery is suffering from decay.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Martello Tower No. 30, Winchelsea Road, Rye
DESIGNATION:	Listed Building Grade II, SM
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

Martello tower built 1806. Now nearly derelict and the moat and glacis on the east side lost. Unconnected with destruction of the moat and glacis, a small housing development was built adjacent to the east. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Parish Church of St Barnabas, Sea Road, Bexhill
DESIGNATION:	Listed Place of Worship Grade II
CONDITION:	Poor
PRIORITY:	B (New entry)
OWNER TYPE:	Religious organisation

Late C19 and early C20 church in flint and red brick. In 2011, the PCC applied for a Repair Grant for Places of Worship which has now been offered. Repair works will be carried out in 2013 to recover the south aisle roof and the spire, renewal of rainwater goods, window stonework repair and window glass repair.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Romano-British iron working site in Beauport Park, Battle

DESIGNATION:	Scheduled Monument (No.1002250)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SOUTH DOWNS (NP)



SITE NAME:	Dovecote 160m north west of Coombe Place, Offham, Hamsey, Lewes
DESIGNATION:	Listed Building Grade II, SM
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (New entry)
OWNER TYPE:	Private

Early C19 dovecote within the grounds of Coombe Place. Ornate octagonal building of flint with dressings and quoins of red and grey brick. Water ingress and collapse of chalk and brick nesting boxes inside is the cause of risk.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Icehouse 140m west of Coombe Bank, Offham, Hamsey, Lewes
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (New entry)
OWNER TYPE:	Private

Late C18 ice house within the grounds of Coombe Place. The risk arises from heavy vegetation growth on the structure and collapse of the entrance tunnel vault.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WH	World Heritage Site



SITE NAME: **Parish Church of St Michael and All Angels, Plumpton, Lewes**

Small parish church with large square tower to the west. Dates to the C12 with a C13 chancel, and contains rare surviving Norman wall paintings. There are slipped tiles to the north, blocked guttering, inappropriate cement renders and dense ivy causing structural problems to the tower and internal damp. A programme of repairs is currently in preparation.

DESIGNATION: Listed Place of Worship Grade I

CONDITION: Poor

PRIORITY: D (D)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Round barrow south west of Bopeep Bostal, Alciston, Wealden

DESIGNATION: Scheduled Monument (No.1002269)

CONDITION: Generally satisfactory but with significant localised problems

PRINCIPAL VULNERABILITY: Metal detecting

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Long Burgh long barrow, Alfriston, Wealden

DESIGNATION: Scheduled Monument (No.1012923)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Scrub/tree growth

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Anglo-Saxon cemetery 275m north of Comps Farm, Beddingham, Lewes

DESIGNATION: Scheduled Monument (No.1021436)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Metal detecting

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Round barrow south of Ditchling Beacon, Ditchling, Lewes

DESIGNATION: Scheduled Monument (No.1002254)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Bowl barrow 180m south west of Glydebourne Pit, Glyde, Lewes

DESIGNATION: Scheduled Monument (No.1013355)

CONDITION: Generally satisfactory but with significant localised problems

PRINCIPAL VULNERABILITY: Metal detecting

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Bowl barrow 300m SSW of Glydebourne Pit, Glyde, Lewes

DESIGNATION: Scheduled Monument (No.1013357)

CONDITION: Generally satisfactory but with significant localised problems

PRINCIPAL VULNERABILITY: Metal detecting

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WH World Heritage Site

SITE NAME: Hillfort, bowl barrow and associated remains on The Caburn, Glynde, Lewes	
DESIGNATION: Scheduled Monument (No.1014527)	CONDITION: Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY: Metal detecting	TREND: Declining
OWNER TYPE: Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow on Front Hill, Iford, Lewes	
DESIGNATION: Scheduled Monument (No.1009950)	CONDITION: Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY: Arable clipping	TREND: Declining
OWNER TYPE: Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Multiple ring-ditch at Mount Pleasant, Denton, Newhaven, Lewes	
DESIGNATION: Scheduled Monument (No.1012144)	CONDITION: Extensive significant problems
PRINCIPAL VULNERABILITY: Arable ploughing	TREND: Declining
OWNER TYPE: Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow forming part of a linear round barrow cemetery on Rookery Hill, Seaford, Lewes	
DESIGNATION: Scheduled Monument (No.1009953)	CONDITION: Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY: Arable clipping	TREND: Declining
OWNER TYPE: Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Two bowl barrows, the south easternmost pair of a group of six bowl barrows, forming part of a linear round barrow cemetery on Rookery Hill, Seaford, Lewes	
DESIGNATION: Scheduled Monument (No.1009951)	CONDITION: Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY: Arable clipping	TREND: Declining
OWNER TYPE: Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

WEALDEN



SITE NAME: **Ruins of Brambletye House, Forest Row**

DESIGNATION: Listed Building Grade I, SM

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: D (A)

OWNER TYPE: Private

The monument comprises the ruins and buried remains of an early C17 country house, which was built by Sir Henry Compton in 1631 but slighted during the Civil War by Cromwellian troops. The upstanding remains include much of the north front, containing the main entrance and three towers, the remains of an undercroft and remains of a guardhouse. Parts of the structure are currently supported by scaffold.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Argos Hill Windmill, Argos Hill, Mayfield**

DESIGNATION: Listed Building Grade II*

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: D (D)

OWNER TYPE: Local authority

Post mill suffering from lack of maintenance and scaffolded. The Argos Hill Windmill Trust have leased the windmill and have launched a fundraising campaign for its restoration.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Parish Church of All Saints, Heathfield and Waldron
DESIGNATION:	Listed Place of Worship Grade I
CONDITION:	Poor
PRIORITY:	A (New entry)
OWNER TYPE:	Religious organisation

Church of C13 built of stone rubble with tiled roof. Consists of chancel, aisled nave, north porch and west tower with higher stairs turret. Tower in the Perpendicular style. South aisle dates from 1859-62. Urgent repairs to the north aisle roof, three gables and tower are required.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Far Blacklands iron bloomery, Forest Row**

DESIGNATION:	Scheduled Monument (No.1002231)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **High Rocks Camp (part in Kent), Frant**

DESIGNATION:	Scheduled Monument (No.1002280)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Kidbrooke Park, Forest Row
DESIGNATION:	Registered Park and Garden Grade II, also 2 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	Medium
TREND:	Declining
OWNER TYPE:	Mixed, multiple owners

C18 park with extensive C19 landscape features attributed to Humphry Repton and later formal and woodland gardens. The estate was sold in 1938 then further subdivided. The house became a Steiner school which has since sold perimeter land for development and built school facilities in the grounds. It is vulnerable to development. The Environment Agency is investigating the possibility of using the lower lake as a flood storage facility which has highlighted the need for an up-to-date Conservation Management Plan.

Contact: Principal Heritage at Risk Adviser 01483 252000

OFF EAST SUSSEX



SITE NAME:	Holland No.5, SE end Royal Sovereign Bank
DESIGNATION:	Protected Wreck Site
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Private
PHOTO:	© Crown Copyright, Wessex Archaeology

The Holland No.5 was designed and built by the Holland Torpedo Boat Company at Barrow-in-Furness and was launched in May 1902. She foundered on 8th August 1912 whilst under tow to the breaker's yard. The site has been subject to unauthorised access and the removal of the bow torpedo hatch as well as fishing damage.

Contact: Principal Heritage at Risk Adviser 01483 252000

HAMPSHIRE

BASINGSTOKE AND DEANE



SITE NAME:	Barn at Manor Farm, Old Burghclere, Burghclere
DESIGNATION:	Listed Building Grade I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	C (C)
OWNER TYPE:	Private

Manorial barn, 1451, built for the Bishop of Winchester. Suffering from water ingress and failure of joints, the building needs comprehensive repair. Emergency repairs have been carried out. Full cost of repairs is very high.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	London Lodge, Highclere Park, Highclere
DESIGNATION:	Listed Building Grade II*, RPG I
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

Ceremonial archway and attached accommodation, 1793. Only emergency repairs have been carried out and negotiations continue to allow it to be repaired and occupied. Full cost of repairs is high.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of St Mary, Tufton, Hurstbourne Priors
DESIGNATION:	Listed Place of Worship Grade I
CONDITION:	Poor
PRIORITY:	D (New entry)
OWNER TYPE:	Religious organisation

Small rural church with Norman nave, chancel rebuilt in the C13, and early C19 south porch. Rendered flint rubble walls with clay tiled roofs, and medieval wall paintings to the north wall of the nave and above the chancel arch. Most of the roof slopes were re-tiled in the 1990s with grant aid from English Heritage, but the north slope of the nave is in poor condition and there is decay to the timbers to the bellcote and western narthex screen. Investigations to fully assess the extent of repairs are underway with grant aid. Repairs should take place in 2013.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Long barrow 600m south of Preston Grange, Candovers**

DESIGNATION:	Scheduled Monument (No.I013009)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **A bell barrow and a saucer barrow 315m ESE of the unfinished hillfort on Ladle Hill, Echinswell and Sydmonton**

DESIGNATION:	Scheduled Monument (No.I012035)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **The eastern of two rectangular enclosures on Great Litchfield Down, SSW of Ladle Hill, Litchfield and Woodcott**

DESIGNATION:	Scheduled Monument (No.I012040)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **The western of two rectangular enclosures on Great Litchfield Down, SSW of Ladle Hill, Litchfield and Woodcott**

DESIGNATION:	Scheduled Monument (No.I012037)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Long barrow 250m south east of Willesley Warren Farm, Overton**

DESIGNATION:	Scheduled Monument (No.I013006)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow south west of Lower Farm, Preston Candover		
DESIGNATION:	Scheduled Monument (No.1005541)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Roman site north west of Woodgarston Farm, Wootton St Lawrence		
DESIGNATION:	Scheduled Monument (No.1001857)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Site revealed by air photography at Catern crossroads, Wootton St Lawrence		
DESIGNATION:	Scheduled Monument (No.1001855)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

EAST HAMPSHIRE



SITE NAME:	Church of St Peter, Froxfield Green, Froxfield
DESIGNATION:	Listed Place of Worship Grade II
CONDITION:	Poor
PRIORITY:	B (New entry)
OWNER TYPE:	Religious organisation

Small village church built in 1886 on the site of a demolished medieval church. It was designed by AW Blomfield and comprises a single cell nave and chancel with a north porch and a vestry constructed to the south in 1932. The timber and shingle spired bell turret on the west gable is decaying and leaning, and the rainwater goods and slated roofs are in poor condition. Grant awarded from Heritage Lottery Fund for repairs planned for 2013.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Walldown enclosures, Whitehill		
DESIGNATION:	Scheduled Monument (No.1017368)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Plant growth	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

FAREHAM



SITE NAME:	Fort Fareham, Newgate Lane, Fareham
DESIGNATION:	Listed Building Grade II, SM
CONDITION:	Poor
OCCUPANCY:	Part occupied
PRIORITY:	A (A)
OWNER TYPE:	Company

Mid C19 fort forming part of a series of fortifications built to defend Portsmouth Harbour. Unoccupied parts suffering from decay and vandalism. Site now owned by various private companies.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Barn at Fernhill Farm, Mill Lane, Titchfield, Fareham
DESIGNATION:	Listed Building Grade I, CA
CONDITION:	Fair
OCCUPANCY:	Vacant
PRIORITY:	E (C)
OWNER TYPE:	Private

Tithe barn, probably C15, formally part of Titchfield Abbey. Has been damaged by casual vandalism and needs repair and a new use.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Titchfield Abbey and fishponds – “stables”, Mill Street, Titchfield, Fareham
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY:	D (D)
OWNER TYPE:	Private

Remains of possible stables to Titchfield Abbey. The Abbey was founded in 1232 and converted to a private residence in 1537. The “stables” are overgrown with vegetation and have some structural problems. Investigations leading to a repair programme now need to start.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	St Marys Church, Castle Street, Portchester Castle, Portchester
DESIGNATION:	Listed Place of Worship Grade I, CA
CONDITION:	Poor
PRIORITY:	C (C)
OWNER TYPE:	Religious organisation

Romanesque church standing within the outer bailey of Portchester Castle. Flint and rendered walls with plain tiled roofs. At risk due to slipped and missing tiles to roofs, especially on the south slope of the nave. Rainwater disposal system to south and east slopes of the tower appears broken and defective. Open joints and vegetation growth to flint rubble walls, especially to tower. Water penetration internally to south west corner of chancel.

Contact: Principal Heritage at Risk Adviser 01483 252000

GOSPORT



SITE NAME:	Fort Elson, RNAD, Military Road, Gosport
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	A (A)
OWNER TYPE:	Government

Polygonal artillery fort of 1853-60. Damaging vegetation has taken hold of the site. Programmes of vegetation removal are intermittent. A management plan has been drafted but not agreed or implemented. The building cannot be occupied because it lies within a munitions storage area.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Gilkicker Fort, Fort Road, Gilkicker Point, Gosport
DESIGNATION:	Listed Building Grade II*, SM
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	D (D)
OWNER TYPE:	Local authority

Artillery fort 1865-71. Owner has put barrack block into good order; but casemates and magazines are threatened by water penetration. Repair and conversion to residential units approved.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Workshops, boilerhouse and engine room, Haslar Gunboat Yard, HMS Dolphin, Gosport
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	A (A)
OWNER TYPE:	Company

Workshops, boiler house and offices, mid C19, cause concern. The buildings are already in a poor state of repair and are deteriorating. Parts are no longer stable (including sections of the workshops' roofs). There is no current use.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Guardrooms to Haslar Gunboat Yard, Haslar Road, HMS Dolphin, Dolphin 3, Gosport
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	A (A)
OWNER TYPE:	Government

The buildings have been unoccupied for many years and are derelict. In 1999 basic repairs were carried out to make the buildings weathertight but there has been no progress since then. An options study has been undertaken.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

HART



SITE NAME: **Garden walls and associated structures, Bramshill House, Bramshill**

DESIGNATION: Listed Building Grade I, RPG II*

CONDITION: Fair

OCCUPANCY: N/A

PRIORITY: E (E)

OWNER TYPE: Government

Walls to early C17 and C18 formal walled gardens, surrounding the house, which is situated within a park of medieval origin, landscaped in the C17, C18 and C19. Some sections of the walls are in a poor condition, but the south-east turret and some parts of the garden walls have been repaired.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **High Bridge, Bramshill House, Bramshill**

DESIGNATION: Listed Building Grade I, RPG II*

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: D (D)

OWNER TYPE: Government

The bridge is in poor condition, requiring repairs to structure and fabric. Some repairs were carried out in 2000-03 but were not completed. A programme of repair and strengthening works due to start in June 2012.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Bramshill Park, Bramshill/Eversley/Mattingley**

DESIGNATION: Registered Park and Garden Grade II*, also part in CA, 8 LBs

CONDITION: Extensive significant problems

VULNERABILITY: High

TREND: Stable

OWNER TYPE: Corporate, multiple owners

Early C17 formal walled gardens within a park of medieval origin which was landscaped in the C17 and mid C18 and later deformed and enlarged. The site became the Police Staff College in 1952, the farmland being sold and put under commercial forestry. An up-to-date landscape Conservation Management Plan is required. Repairs have been carried out to some of the buildings at risk on the estate but further work is required.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Warbrook House, Eversley**

DESIGNATION: Registered Park and Garden Grade II*, also I LB

CONDITION: Extensive significant problems

VULNERABILITY: Medium

TREND: Declining

OWNER TYPE: Mixed, multiple owners

The gardens were designed c1724 by the architect John James whose home it was. Major change occurred in the mid C20 with the conversion of the house to business use and the addition of new buildings and service areas. James' axes extend beyond the gardens but these, and the parkland, are perceived as without beneficial use and have deteriorated. A seminal site in garden history terms, this landscape needs an up-to-date Conservation Management Plan and the necessary resources and commitment to implement it.

Contact: Principal Heritage at Risk Adviser 01483 252000

NEW FOREST

SITE NAME: **Giant's Grave: a long barrow 400m north west of Down Farm, Breamore**

DESIGNATION: Scheduled Monument (No.1015980)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Extensive animal burrowing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Bowl barrow 330m north of Grim's Ditch, near Tidpit Common, Martin**

DESIGNATION: Scheduled Monument (No.1011000)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Extensive animal burrowing

TREND: Declining

OWNER TYPE: Local authority

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Long Barrow 800m north west of Paradise, Martin**

DESIGNATION: Scheduled Monument (No.1012512)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Duck's Nest: a long barrow on Rockbourne Down, Rockbourne		
DESIGNATION:	Scheduled Monument (No.1012920)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow 700m north west of Tenantry Farm, Rockbourne		
DESIGNATION:	Scheduled Monument (No.1013002)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Rockbourne Down, Spring Pond enclosure, Rockbourne		
DESIGNATION:	Scheduled Monument (No.1003453)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

NEW FOREST (NP)



SITE NAME:	Beaulieu Abbey, Beaulieu	Arcade of Chapter House and associated walls, part of C13 Abbey. Parts of arcade deteriorating and wall suffering from vegetation growth and cracking. Discussions continuing about the necessary repairs.
DESIGNATION:	Scheduled Monument, CA	
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY:	C (C)	
OWNER TYPE:	Company	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Tide Mill, High Street, Beaulieu	Early C18, one of the few remaining tide mills. Repairs were largely complete before a fire (March 2006) which destroyed much of the roof. New repairs well underway.
DESIGNATION:	Listed Building Grade II*, CA	
CONDITION:	Fair	
OCCUPANCY:	Vacant	
PRIORITY:	E (C)	
OWNER TYPE:	Trust	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bell barrow and two bowl barrows 180m south west of Stagbury Hill, Furzley Common, Bramshaw, New Forest		
DESIGNATION:	Scheduled Monument (No.1016491)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Moderate stock erosion	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Rabbit warren and four bowl barrows on Stagbury Hill, Furzley Common, Bramshaw, New Forest		
DESIGNATION:	Scheduled Monument (No.1016490)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive visitor erosion	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Twin bowl barrow on Furzley Common, 810m SSW of Stagbury Hill, Bramshaw, New Forest		
DESIGNATION:	Scheduled Monument (No.1016492)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Hillfort 400m south of Home Farm, Denny Lodge, New Forest		
DESIGNATION:	Scheduled Monument (No.1017019)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 550m north west of Avon Tyrrell, Ringwood, New Forest		
DESIGNATION:	Scheduled Monument (No.1012637)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

RUSHMOOR



SITE NAME:	Building Q121 [24 foot wind tunnel] at former Royal Aircraft Establishment site, Hall Road, Farnborough	Wind tunnel built 1934-35. The future use of the building remains uncertain.
DESIGNATION:	Listed Building Grade I	
CONDITION:	Fair	
OCCUPANCY:	Vacant	
PRIORITY:	E (E)	
OWNER TYPE:	Company	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Building R133 [Transonic wind tunnel] at former Royal Aircraft Establishment site, O'Gorman Avenue, Farnborough	Wind tunnel built 1939 and modified in 1956. The future use of the building remains uncertain.
DESIGNATION:	Listed Building Grade I	
CONDITION:	Fair	
OCCUPANCY:	Vacant	
PRIORITY:	E (E)	
OWNER TYPE:	Company	Contact: Principal Heritage at Risk Adviser 01483 252000

SOUTH DOWNS (NP)



SITE NAME:	Ruins of St Nicholas Chapel, Westbury, East Meon, East Hampshire	Small ruined medieval church of possibly C13 date and later. Designated with associated earthwork remains of contemporary settlement. Ruins are suffering from structural cracking and deferred maintenance.
DESIGNATION:	Listed Building Grade II, SM	
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY:	A (A)	
OWNER TYPE:	Private	Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Brambridge House,
Kiln Lane, Colden Common,
Winchester**

Country house, 1762 and 1872, suffering from deferred maintenance. Some repairs have been carried out but more are needed.

DESIGNATION: Listed Building Grade II*

CONDITION: Poor

OCCUPANCY: Occupied

PRIORITY: C (C)

OWNER TYPE: Company

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **King Johns House,
Warnford Park, Warnford,
Winchester**

Ruinous C13 hall house. A feature within the C18 pleasure grounds of Warnford Park, within which it is situated. Stop gap repairs have been carried out. Requires further consolidation and discussions taking place.

DESIGNATION: Listed Building Grade I, SM, RPG II

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: B (B)

OWNER TYPE: Company

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Leonard,
Hartley Mauditt,
Worldham,
East Hampshire**

Isolated small rural church of Norman origins with C14 chancel. Collection of C17 and early C18 wall monuments to chancel. Major restoration work undertaken in 1854. It has rendered walls and a tiled roof. Sunday services are held during the summer months only. Some slippage of tiles to the south slope of the nave indicating failure of fixings, defective rainwater goods and drainage, with internal dampness and algal growth.

DESIGNATION: Listed Place of Worship Grade II*, CA

CONDITION: Poor

PRIORITY: C (C)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Two bowl barrows north of Hoe Farm, Bishops Waltham, Winchester

DESIGNATION:

Scheduled Monument (No.1013078)

CONDITION:

Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY:

Scrub/tree growth

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Bowl barrow on Chalton Down, 350m south east of Manor Farm, Clanfield, East Hampshire

DESIGNATION:

Scheduled Monument (No.1020511)

CONDITION:

Extensive significant problems

PRINCIPAL VULNERABILITY:

Arable ploughing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Corhampton British village on Corhampton Down, Corhampton and Meonstoke, Winchester

DESIGNATION:

Scheduled Monument (No.1001903)

CONDITION:

Extensive significant problems

PRINCIPAL VULNERABILITY:

Arable ploughing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Four round barrows in 'Hump Field' south of Stakes Lane, Corhampton and Meonstoke, Winchester

DESIGNATION:

Scheduled Monument (No.1001886)

CONDITION:

Extensive significant problems

PRINCIPAL VULNERABILITY:

Arable ploughing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME: Bowl barrow 620m north east of Warhill Cottage, East Meon, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1019116)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Group of four bowl barrows 660m north of Warhill Cottage, East Meon, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1019115)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow 60m south east of the junction of the A32 and Fawley Lane, part of The Jumps round barrow cemetery, Froxfield, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1019120)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow 100m south east of Lower Bordean Farm, Langrish, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1017051)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Three bowl barrows on Chalton Down, 860m east of Netherley Farm, Rowlands Castle, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1020512)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Circular and rectangular enclosures at Itchen Stoke and Ovington, Titchborne, Winchester			
DESIGNATION:	Scheduled Monument (No.1001803)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow 250m west of the junction of the A32 and Fawley Lane, part of The Jumps round barrow cemetery, West Tisted, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1019118)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow 330m south west of the junction of the A32 and Fawley Lane, part of The Jumps round barrow cemetery, West Tisted, East Hampshire			
DESIGNATION:	Scheduled Monument (No.1019119)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow cemetery, Roman road and hollow ways 200m south west of Woolmer Cottages, Whitehill, East Hampshire		
DESIGNATION:	Scheduled Monument (No.1020502)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Plant growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Three disc barrows on Longmoor Common, 250m north west of the church, Whitehill, East Hampshire		
DESIGNATION:	Scheduled Monument (No.1016843)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Plant growth	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Droxford, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

SITE NAME:	Easton, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

SITE NAME:	Exton, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Improving
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

SITE NAME:	Greatham, Horsham (District)		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Catherine Jeater (LPA) 01403 215 528	NEW ENTRY:	No

SITE NAME:	Hambledon, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	No significant change
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

SITE NAME:	Itchen Stoke, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

SITE NAME:	Martyr Worthy, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Stanmer, Brighton and Hove, City of (UA)		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Low	TREND:	No significant change
CONTACT:	Tim Jefferies (LPA) 01273 293152	NEW ENTRY:	No

SITE NAME:	Twyford, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

SITE NAME:	West Meon, Winchester (District)		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	No significant change
CONTACT:	Alison Davidson (LPA) 01962 848 481	NEW ENTRY:	No

TEST VALLEY



SITE NAME: **Church of St Peter and St Paul, Kimpton**

DESIGNATION: Listed Place of Worship Grade I
 CONDITION: Poor
 PRIORITY: F (New entry)
 OWNER TYPE: Religious organisation

Village church mainly built of flint rubble with tiled roofs in the C13 and C14, with a dominating red brick and flint west tower of 1837-9, designed by Charles Parker. The main roofs were re-tiled, rainwater goods repaired and stonework conserved with grant aid, but flints are now falling from the tower parapet. PCC have raised the necessary funds and the works should be completed this year.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Ashley Wood camp, Ashley		
DESIGNATION:	Scheduled Monument (No.1014815)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow 400m south east of Moody's Down Farm, Barton Stacey		
DESIGNATION:	Scheduled Monument (No.1012515)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	The Andyke, Bransbury, Barton Stacey		
DESIGNATION:	Scheduled Monument (No.1015678)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow and two bowl barrows, 400m north of Chattis Hill House, Broughton		
DESIGNATION:	Scheduled Monument (No.1012998)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
 2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Two bowl barrows 90m south of Hill Lodge: part of a group of round barrows on Broughton Hill, Broughton		
DESIGNATION:	Scheduled Monument (No.1014844)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow 300m south east of Middlebarn Farm, Chilbolton		
DESIGNATION:	Scheduled Monument (No.1012517)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Castle Hill, Chilworth		
DESIGNATION:	Scheduled Monument (No.1001885)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Barrow cemetery 730m north of Hampshire Gap, Grately		
DESIGNATION:	Scheduled Monument (No.1014817)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 780m NNE of Hampshire Gap, Grately		
DESIGNATION:	Scheduled Monument (No.1014816)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Andover-Redbridge canal, Chalk Hill Lock, Horsebridge, Kings Somborne		
DESIGNATION:	Scheduled Monument (No.1001794)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 400m south of Waters Down Farm, Longstock		
DESIGNATION:	Scheduled Monument (No.1014863)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 250m south of Martin's Clump, Over Wallop		
DESIGNATION:	Scheduled Monument (No.1013063)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME: Flint mines, linear boundary and two bowl barrows at Martin's Clump, Porton Down, Over Wallop			
DESIGNATION:	Scheduled Monument (No.1017168)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Moderate animal burrowing	TREND:	Stable
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Long barrow and adjoining bowl barrow, 250m south of Martin's Clump, Over Wallop			
DESIGNATION:	Scheduled Monument (No.1015981)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Long Barrow 350m south east of Nutbane, Penton Grafton			
DESIGNATION:	Scheduled Monument (No.1013202)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Three bowl barrows 160m north of The Plantation: part of a dispersed group of round barrows on Stockbridge Down, Stockbridge			
DESIGNATION:	Scheduled Monument (No.1013638)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Embley Park, Wellow	
DESIGNATION:	Registered Park and Garden Grade II, also 8 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Stable
OWNER TYPE:	Mixed, multiple owners

C19 and early C20 woodland and shrub garden of late C18 origin, once the home of Florence Nightingale. After WWII the estate was divided, the house becoming a school. The school has reunited the historic core but the wider park is divided between multiple owners. The site suffers from development pressures in all directions. Unfortunately, the school's updated Conservation Management Plan only addressed land within their ownership. The issue of how to co-ordinate management of the whole designed landscape remains.

Contact: Principal Heritage at Risk Adviser 01483 252000

WINCHESTER



SITE NAME: Merdon Castle, Hursley	
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	C (C)
OWNER TYPE:	Company

Norman ringwork with a standing gatehouse surviving as core work. Overgrown and in need of consolidation. Discussions need to be held with new owners.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Walled garden to Lainston House, Lainston Park, Sparsholt	
DESIGNATION:	Listed Building Grade II*, RPG II*
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY:	F (D)
OWNER TYPE:	Company

Hexagonal walled fruit or kitchen garden, c5.3ha, c100m west of the house. Probably C18. Striking polygonal layout. Axial vista from main entrance of house, across forecourt and into walled garden. In use as hotel car park around the sides and planted in the centre. Being repaired.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	'Banjo type' native settlement, Itchen Valley		
DESIGNATION:	Scheduled Monument (No.1001814)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Late Iron Age settlement site north of Grace's Farm, Itchen Valley		
DESIGNATION:	Scheduled Monument (No.1001825)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Roman villa and earlier prehistoric settlement 400m west of Lone Farm, Itchen, Itchen Valley		
DESIGNATION:	Scheduled Monument (No.1012693)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Iron Age field system, banjo enclosure and Romano-British villa, 500m east of Woodham Farm, Kings Worthy		
DESIGNATION:	Scheduled Monument (No.1013269)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Iron Age settlement, Micheldever		
DESIGNATION:	Scheduled Monument (No.1001815)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Norsebury Ring hillfort, Micheldever		
DESIGNATION:	Scheduled Monument (No.1020317)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow and bowl barrow 440m north west of Sanctuary Farm, Wonston		
DESIGNATION:	Scheduled Monument (No.1021109)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Compton Street		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY:	No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Hursley		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Kings Worthy		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Littleton		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	New Alresford		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Improving
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Southwick		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Sparsholt		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	No significant change
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Sutton Scotney		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Wickham		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Improving
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Winchester		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

SITE NAME:	Wonston		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	No significant change
CONTACT:	Historic Environment Team (LPA) 01962 848481	NEW ENTRY?:	No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WH	World Heritage Site

OFF HAMPSHIRE



SITE NAME:	HMS Invincible, Horse and Dean Sand
DESIGNATION:	Protected Wreck Site
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Crown
PHOTO:	© Christopher Dobbs

Invincible was launched in 1744 as a third rate 74-gun French warship. Captured by the British at the first Battle of Finisterre in 1747, she was taken into the Royal Navy. In 1758, she was part of a fleet ordered to sail for Canada to assist in the routing of the French. In raising her anchor, her hawser became stuck and could not be catted (i.e. hoisted). In attempting to get clear, the ship's rudder became jammed and she ran aground on Horse Tail Sand, and eventually sank. The site has become at risk due to the continued exposure of unrecorded timbers and delicate small organic finds.

Contact: Principal Heritage at Risk Adviser 01483 252000

ISLE OF WIGHT (UA)



SITE NAME:	Northwood House, Ward Avenue, Cowes
DESIGNATION:	Listed Building Grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Part occupied
PRIORITY:	C (C)
OWNER TYPE:	Trust

Large house, 1837, with spectacular interiors. The long-term future of this partly-used building is unresolved and maintenance needs to be addressed in the short term. The cost of full repair is very high.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Hammerhead crane, Thetis Road, West Cowes, Cowes
DESIGNATION:	Listed Building Grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Private

Giant cantilever crane, also called 'hammerhead' crane, built 1911. One of a handful of this type of crane now surviving, and witness to a major local industry. Now disused and surrounded by a potential development site. In need of repair. Condition survey needs to be completed. Enforcement action must now be considered.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Norris Castle, Newbarn Road, East Cowes
DESIGNATION:	Listed Building Grade I, RPG II
CONDITION:	Poor
OCCUPANCY:	Occupied
PRIORITY:	C (D)
OWNER TYPE:	Private

Mock castle of 1799 by James Wyatt. A recent failure in the external walling has been addressed but more work is needed.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Remains of Old Quarr Abbey, Fishbourne Park Road, Binstead, Ryde
DESIGNATION:	Listed Building Grade II, SM
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	B (A)
OWNER TYPE:	Religious organisation

Cistercian foundation of 1131. In an advanced state of decline due to neglect and vegetation growth. English Heritage has carried out a photographic survey and a condition survey. Stage I Heritage Lottery Fund grant underway for works including repairs to this monument.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of St Mary, Church Road, Cowes
DESIGNATION:	Listed Place of Worship Grade II*
CONDITION:	Very bad
PRIORITY:	C (New entry)
OWNER TYPE:	Religious organisation

Large town church adjacent to Northwood Park, with large churchyard to the north. The west tower was designed by John Nash in 1816 and the rest of the church was rebuilt in 1867. Comprises a clerestoried nave with north and south aisles, chancel north porch and vestries and modern hall to the south. Built of stone with banded slate roof. Recent grant-aided repairs to tower and south roof slopes but north aisle poor and leaking.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: Church of All Saints, Church Hill, Godshell

DESIGNATION: Listed Place of Worship Grade I

CONDITION: Poor

PRIORITY: A (New entry)

OWNER TYPE: Religious organisation

Large village church, picturesquely sited on a hill top. Mainly dating from the C14 with an unusual plan with double nave and arcade continuous to chancel. Early C16 south transept with crucifixion wall painting of similar date. Outstanding set of monuments, many to the Worsley family. Structural cracking to south west corner; internal staining from leaks to central valley gutter and defective rainwater goods including, crucially, the gutter above the wall painting.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Church of St Thomas, St Thomas's Square, Newport

DESIGNATION: Listed Place of Worship Grade I

CONDITION: Poor

PRIORITY: D (New entry)

OWNER TYPE: Religious organisation

Large town church standing in central square. It was rebuilt on the site of an earlier church in 1854-6 by the architect SW Dawkes, and comprises a clerestoried nave, chancel, aisles, north east Lady Chapel, south east vestry and prominent west tower. The walls are mainly local and re-used stone rubble with Caen stone dressings and Welsh slate roofs. Previous grant-aided repairs to the stonework, windows and roofs to the Lady Chapel, roofs to the north aisle and upper tower stonework. Further phased repairs planned to remaining stonework, windows and roofs.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Holy Trinity Church, Dover Street, Ryde

DESIGNATION: Listed Place of Worship Grade II, CA

CONDITION: Poor

PRIORITY: C (C)

OWNER TYPE: Religious organisation

Large town church with prominent tower and spire, designed 1841 by Thomas Hellyer. At risk due to leaking rainwater goods, decaying stonework, water penetration and timber decay, including to the transept floors.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: St Boniface (Old Church), Bonchurch, Ventnor

DESIGNATION: Listed Place of Worship Grade II*, CA

CONDITION: Poor

PRIORITY: C (C)

OWNER TYPE: Religious organisation

Small church of Norman origin with nave, chancel and south porch. Romanesque wall paintings to south wall of nave. At risk due to structural cracking to chancel, decaying stonework and defective rainwater goods and drainage.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: St John's Church, High Street, Wroxall

DESIGNATION: Listed Place of Worship Grade II

CONDITION: Poor

PRIORITY: B (New entry)

OWNER TYPE: Religious organisation

Small village church by TR Saunders in 1876-7, with small tower added 1911 housing clock and carillon of 8 bells. Extensive decay to Greensand facing stones and corroding rainwater goods. Have applied to English Heritage/Heritage Lottery Fund for grant to carry out repairs.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Medieval settlement 100m south east and 350m north east of East Ashley Manor Farm, Brading		
DESIGNATION:	Scheduled Monument (No.1015622)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS


- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site

SITE NAME:	Bowl barrow on Newbarn Down, 1.1km south west of Rowridge, Brighstone		
DESIGNATION:	Scheduled Monument (No.1007782)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Moderate stock erosion	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	A Bronze Age barrow and Anglo-Saxon cemetery on Bowcombe Down, 575m south east of Apesdown, Isle of Wight		
DESIGNATION:	Scheduled Monument (No.1015624)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Two bowl barrows 180m WNW of Puck House, Fishbourne, Isle of Wight		
DESIGNATION:	Scheduled Monument (No.1012715)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bouldnor Battery, Shalfleet		
DESIGNATION:	Scheduled Monument (No.1010011)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	TREND:	Declining
OWNER TYPE:	Government or Agency	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

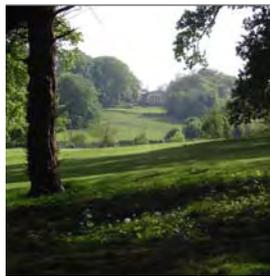

SITE NAME:	Swainston, Calbourne
DESIGNATION:	Registered Park and Garden Grade II, also 3 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Mixed, multiple owners

Mid-late C18 woodland pleasure grounds, set in parkland, with intersecting avenues, pools and a stream incorporating earlier fishponds. The reconstructed house and refurbished gardens are now a hotel, but some key features lie in the remainder of the estate and in private ownership. This includes a temple which is further isolated by a public road and some inappropriate light industrial units. Perceived low value of landscape features and levels of repair make holistic conservation and management difficult.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Brading		
DESIGNATION:	Conservation Area	CONDITION:	Fair
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Oliver Boulter (LPA) 01983 823552	NEW ENTRY:	No

SITE NAME:	Carisbrooke		
DESIGNATION:	Conservation Area	CONDITION:	Poor
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Oliver Boulter (LPA) 01983 823552	NEW ENTRY:	No

SITE NAME:	Cowes		
DESIGNATION:	Conservation Area	CONDITION:	Poor
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Oliver Boulter (LPA) 01983 823552	NEW ENTRY:	No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Godshill		
DESIGNATION:	Conservation Area	CONDITION:	Fair
VULNERABILITY:	High	TREND:	Deteriorating
CONTACT:	Oliver Boulter (LPA) 01983 823552	NEW ENTRY?:	No

SITE NAME:	Newport		
DESIGNATION:	Conservation Area	CONDITION:	Poor
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Oliver Boulter (LPA) 01983 823552	NEW ENTRY?:	No

KENT**ASHFORD**

SITE NAME: **Remains of Archbishops Palace, Market Place, Charing**

DESIGNATION: Listed Building Grade I, SM, CA

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: A (A)

OWNER TYPE: Private

Remains of palace built in C13 and C14. Farm complex converted from remains includes gatehouse, barn (east range of palace courtyard), outhouse (west range) and Palace Farmhouse (north range). Temporary support has been given to the structurally unsound barn with English Heritage grant aid. Survey carried out by the Royal Commission on the Historic Monuments of England.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Ruins of Church of St Mary, Pluckley Road, Little Chart**

DESIGNATION: Listed Building Grade II, SM

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: D (D)

OWNER TYPE: Local authority

War damaged church, circa 1500, now ruinous with tower still standing. Local authority has repaired ruined walls of nave and chancel with English Heritage grant.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Mary the Virgin, The Street, Great Chart**

DESIGNATION: Listed Place of Worship Grade I, CA

CONDITION: Poor

PRIORITY: D (D)

OWNER TYPE: Religious organisation

Ragstone-built church originating in C13, with C15 additions. Repairs required to replace missing roof covering to the north aisle and replacing eastern valley gutters and tiled roofs to the chancel and toke (north chapel). A Repair Grant for Places of Worship has been offered to support this work.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Parish Church of St Mary, High Halden**

DESIGNATION: Listed Place of Worship Grade I

CONDITION: Poor

PRIORITY: A (New entry)

OWNER TYPE: Religious organisation

Grade I listed church with C14 chancel, C15 south chapel, north transept and south aisle, with Norman nave and C14 wooden south porch. Unusual belfry tower (circa 1300) at the west end. Church was restored by Street in 1868. The bell tower is completely timber-framed and an extremely important example in Kent. The upper part is clad in cedar shingles, which are in a bad condition. The chancel floor is in a state of collapse with holes appearing in the Victorian tiles. Some external underpinning has been undertaken in recent years.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Church of St Mary,
The Street,
Westwell**

DESIGNATION: Listed Place of Worship Grade I
CONDITION: Poor
PRIORITY: B (New entry)
OWNER TYPE: Religious organisation

The mostly C13 church had important connections with Canterbury, which accounts for the high quality of its interior and fittings. Urgent repairs required to the tower and spire. Roof repairs required to north aisle and chapel southern slope. Nave roof to have patch repairs using salvaged tiles. All guttering to the north side of the aisle and chapel needs replacing, and ground gutters repairing. Gulley at west end of north aisle to be rebuilt and downpipes replaced. Grant offered December 2011 for Stage 1 project development and 'in-principle' Stage 2 main repairs.
Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Castle Toll Saxon burgh and medieval fort, Newenden

DESIGNATION:	Scheduled Monument (No.1013041)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

CANTERBURY



SITE NAME: **Greyfriars Monastery,
Stour Street,
Canterbury**

DESIGNATION: Listed Building Grade I, SM, CA
CONDITION: Very bad
OCCUPANCY: N/A
PRIORITY: A (A)
OWNER TYPE: Housing Association

Boundary walls from Tudor house built on site of the friary and one part of the friary church. Friary built in 1267.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Monuments in the precinct
of Canterbury Cathedral,
The Precinct, Canterbury**

DESIGNATION: Listed Building Grade I, WHS, SM, CA
CONDITION: Very bad
OCCUPANCY: N/A
PRIORITY: B (B)
OWNER TYPE: Religious organisation

Very important medieval ruinous structures of Christchurch Priory, which have suffered from years of decline. Major backlog of repairs; work has started with English Heritage grant to Llanfrancs dormitory and the city wall. Slow progress is being made.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Horton Manor Chapel,
Horton,
Chatham**

DESIGNATION: Listed Building Grade II, SM
CONDITION: Very bad
OCCUPANCY: N/A
PRIORITY: C (C)
OWNER TYPE: Private

Two cell medieval (C14) chapel, now roofless. Located on a farm. Repair schedule prepared.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Barn at Hardres Court,
Upper Hardres**

DESIGNATION: Listed Building Grade II*, CA
CONDITION: Poor
OCCUPANCY: Vacant
PRIORITY: C (C)
OWNER TYPE: Private

Late C15 to early C16 aisled timber barn. Damaged by fire in 1993.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



SITE NAME:	Church of St Cosmus and St Damian, Tyler Hill Road, Blean
DESIGNATION:	Listed Place of Worship Grade II*, CA
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

C13 church built of flint with stone quoins and tiled roofs. North aisle and south porch added in 1866. 800 year old crown-post roof. Repairs required to entire nave roof which is structurally unsafe following discovery of a broken collar purlin in November 2009. Temporary internal scaffolding now supporting the nave roof. A Repair Grant for Places of Worship has been offered to support the repair work, further fundraising and project development work is now underway.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Enclosures west of Woodlands, Adisham

DESIGNATION:	Scheduled Monument (No.1004191)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

DARTFORD

SITE NAME:

Roman enclosure south east of Vagniacae, Southfleet

DESIGNATION:	Scheduled Monument (No.1004226)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Springhead Roman site, Southfleet

DESIGNATION:	Scheduled Monument (No.1005140)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

DOVER



SITE NAME:	The Western Heights fortifications, Castle Hill, Dover
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied
PRIORITY:	C (C)
OWNER TYPE:	Government

An Immigration Removal Centre, managed by the Home Office, occupies the Citadel on the Western Heights. The surrounding moats and western outworks are in poor condition and there is no programme for their maintenance. Funding for a quadrennial inspection report has not been secured. There has been no progress since the previous report in 2007.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Fort Burgoyne, Connaught Barracks, Guston
DESIGNATION:	Scheduled Monument
CONDITION:	Fair
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Government

1860s polygonal-plan fort now part of a later barracks. The earth-covered terraced casemates are vacant. Structures on the ramparts (the brick-built Haxo casemates) are at risk from lack of maintenance and invasive ivy growth. The site is now owned by the Homes and Communities Agency.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	St Radegunds Abbey, Abbey Road, Hougham Without
DESIGNATION:	Listed Building Grade II*, SM
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Private

A significant C13 monastic site with standing remains of the church and claustral buildings. Heavily overgrown and fabric in a ruinous state. The site is now a farm with buildings used as barns and a farmhouse. These are in fair condition.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **The Belvedere,
Waldershare Park,
Shepherdswell with Coldred**

DESIGNATION: Listed Building Grade I, RPG II

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Private

Belvedere: 1725-7 by Lord Burlington or Colen Campbell for Sir Henry Furnese; located at the southern end of the western side of an early C18 Wilderness, overlooking the park to the north and south. Derelict for many years and now in a ruinous state. A new temporary scaffolding and protective canopy have been completed with grant aid from English Heritage.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Great Mongeham Anglo-Saxon cemetery, Great Mongeham

DESIGNATION: Scheduled Monument (No.1003124)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

St Radegund's Abbey, Poulton, Hougham Without

DESIGNATION: Scheduled Monument (No.1005196)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Collapse

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Ring ditch and enclosure 200yds (180m) east of Parsonage Farm, Preston

DESIGNATION: Scheduled Monument (No.1003121)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Four ring ditches on ridge of Sutton Hill, Sutton

DESIGNATION: Scheduled Monument (No.1004204)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Romano-Celtic temple and Iron Age site south of Worth, Worth

DESIGNATION: Scheduled Monument (No.1004225)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

GRAVESHAM



SITE NAME: **The Dairy,
Cobham Hall,
Cobham**

DESIGNATION: Listed Building Grade II*, RPG II*

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: E (E)

OWNER TYPE: Trust

Unusual Georgian model dairy, part repaired several years ago and awaiting completion of works.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WH	World Heritage Site



SITE NAME: **Church of St Mildred,
Nurstead Lane,
Nurstead,
Meopham**

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Poor

PRIORITY: D (D)

OWNER TYPE: Religious organisation

Church constructed of flint and ragstone. C15, possibly earlier with later windows; west tower C15. Chancel and nave without division and braced trussed rafter roof without tie beams. Vestry and north porch added C19, with tiled roof. Repairs required to north and south slope roofs and associated rainwater goods. A Repair Grant for Places of Worship has been offered to support these repairs.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **All Saints Church,
Perry Street,
Northfleet**

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Very bad

PRIORITY: B (B)

OWNER TYPE: Religious organisation

Large, urban, Victorian church. At risk due to roof tiling being defective, especially to south aisle, with slipped and broken tiles, and cracked and defective flashings. The west gable stonework is also decaying and falling onto the footpath beneath. A Repair Grant for Places of Worship has been offered to support the cost of repairs.

Contact: Principal Heritage at Risk Adviser 01483 252000

MAIDSTONE



SITE NAME: **Boxley Abbey Barn,
Boxley Abbey,
Boxley**

DESIGNATION: Listed Building Grade I, SM, CA

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: E (E)

OWNER TYPE: Private

Cistercian abbey founded in 1146. Main threat is to a medieval roofed range used formerly as a barn, but which is now vacant. Agricultural use now no longer feasible.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **St Andrews Chapel,
Boarley Lane,
Boxley Abbey, Boxley**

DESIGNATION: Listed Building Grade II*

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: E (E)

OWNER TYPE: Private

Late C15 chapel, no longer used for worship. Currently unoccupied and subject to vandalism. Location affected by proximity of motorway.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Dovecotes at Leeds Priory,
Lower Street,
Leeds**

DESIGNATION: Listed Building Grade II, SM

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: B (B)

OWNER TYPE: Trust

Mid C16 overgrown and roofless dovecotes from a post-dissolution mansion. Site purchased for possible new houses.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Slype and associated
remains at Leeds Priory,
Lower Street, Leeds**

DESIGNATION: Listed Building Grade II, SM

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: C (C)

OWNER TYPE: Trust

A slype (covered passage) and associated remains of medieval priory. Site purchased for possible new houses.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **11 Lower Stone Street, Maidstone**

Early C18 house. Vacant for some years.

DESIGNATION: Listed Building Grade II*, CA
 CONDITION: Fair
 OCCUPANCY: Vacant
 PRIORITY: E (E)
 OWNER TYPE: Company

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **The Dungeons at the Archbishop's Palace, Mill Street, Maidstone**

Partially ruined stone building of medieval date. Previous alterations and lack of repair are contributing to structural problems.

DESIGNATION: Listed Building Grade II*, CA
 CONDITION: Poor
 OCCUPANCY: Vacant
 PRIORITY: C (C)
 OWNER TYPE: Local authority

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Mote House, Mote Park, Maidstone**

House, 1793-1801. Recently used as an old people's home. Currently under repair for conversion to retirement housing.

DESIGNATION: Listed Building Grade II*, RPG II
 CONDITION: Fair
 OCCUPANCY: Vacant
 PRIORITY: F (F)
 OWNER TYPE: Company

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Mary Magdalene, Church Lane, Stockbury**

Tower dates from C13. A fire in 1836 destroyed the roof and parts of the nave and chancel leading to a scheme of extensive repairs in 1851. Built of flint rubblework on a brick backing with dressings of Kentish ragstone and Bath stone. Urgent masonry repairs are required to the western tower, north transept and east end, with associated drainage works. A Repair Grant for Places of Worship has been offered to support these repair works.

DESIGNATION: Listed Place of Worship Grade I, CA
 CONDITION: Poor
 PRIORITY: D (D)
 OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Leeds Priory: Augustinian Priory of St Mary and St Nicholas with associated dovecotes and slype, and the site of the 18th century Meredith mansion, Leeds

DESIGNATION: Scheduled Monument (No.1011027)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Collapse

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Binbury motte and bailey castle, Thurnham

DESIGNATION: Scheduled Monument (No.1010713)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Scrub/tree growth

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Elmstone Hole, Grafty Green, Boughton Malherbe

DESIGNATION: Conservation Area

CONDITION: Poor

VULNERABILITY: Medium

TREND: Deteriorating

CONTACT: Mike Parkinson (LPA) 01622 602 335

NEW ENTRY: No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
 2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Maidstone Centre		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Low	TREND:	Improving
CONTACT:	Mike Parkinson (LPA) 01622 602 335	NEW ENTRY:	Yes

SEVENOAKS



SITE NAME:	Church of St Mary, Church Road, Sundridge	Church founded in 1138, with C13 and C15 elements. Largely rebuilt in C19. Built of stone rubble with a slate roof. High level repairs are required to the roof and rainwater goods; urgent timber repairs required, particularly to the medieval spire structure. A Repair Grant for Places of Worship has been offered to support this work.
DESIGNATION:	Listed Place of Worship Grade I, CA	
CONDITION:	Poor	
PRIORITY:	D (D)	
OWNER TYPE:	Religious organisation	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Chapel, Maplescombe, West Kingsdown		
DESIGNATION:	Scheduled Monument (No.1005134)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Combe Bank, Sundridge with Ide Hill/Brasted	Combe Bank's gardens and pleasure grounds date from the 1720s and 1740s. After WWI the estate was sold and divided up. The house and gardens became a school in 1924. The north park became derelict after construction of the M25. The gardens suffered considerable storm damage in 1987. A joined up conservation-led management approach, in conjunction with sufficient resources, is still required.
DESIGNATION:	Registered Park and Garden Grade II*, also part in CA, 17 LBs	
CONDITION:	Extensive significant problems	
VULNERABILITY:	High	
TREND:	Declining	
OWNER TYPE:	Mixed, multiple owners	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Edenbridge		
DESIGNATION:	Conservation Area	CONDITION:	Poor
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY:	No

SITE NAME:	Riverhead		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY:	No

SITE NAME:	Seal		
DESIGNATION:	Conservation Area	CONDITION:	Poor
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY:	No

SITE NAME:	Sevenoaks High Street		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY:	No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	South Darenth		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Unknown
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY?:	No

SITE NAME:	The Vine, Sevenoaks		
DESIGNATION:	Conservation Area	CONDITION:	Fair
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY?:	No

SITE NAME:	Vine Court, Sevenoaks		
DESIGNATION:	Conservation Area	CONDITION:	Fair
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Nicole Twort (LPA) 01732 227 334	NEW ENTRY?:	No

SEVENOAKS / TUNBRIDGE WELLS



SITE NAME:	Swaylands, Penshurst/ Bidborough
DESIGNATION:	Registered Park and Garden Grade II, also part in CA, 3 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Improving
OWNER TYPE:	Private, multiple owners

Important for its terraced gardens and pleasure grounds, including extensive rockwork developed in the late C19. Work began in 2006 to convert the house into 28 apartments, including the addition of two new wings, and works to the gardens as well. The project stalled last year due to financial difficulties but thankfully work has recommenced. The park is diminutive but in need of management. The lower lake, farm and kitchen garden are in separate ownership and much neglected – here the future remains less certain.

Contact: Principal Heritage at Risk Adviser 01483 252000

SHEPWAY



SITE NAME:	Martello Tower No. 5, Folkestone
DESIGNATION:	Scheduled Monument
CONDITION:	Fair
OCCUPANCY:	Vacant
PRIORITY:	E (E)
OWNER TYPE:	Local authority

A very good example of a Martello tower. Situated in the grounds of a school and vacant but with potential for re-use by the school. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Martello Tower No. 4, The Leas, Folkestone
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

A good example of a Martello tower built 1806. Derelict and situated in the grounds of a private house. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Martello Towers Nos. 6 and 7, Shorncliffe Camp, Folkestone
DESIGNATION:	Listed Building Grade II, SM
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

Martello towers, 1806. Derelict recently sold by Ministry of Defence to private owner. (Photograph shows tower 6). The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential or other use.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Martello Tower No. 9,
Shorncliffe Camp,
Sandgate, Folkestone**

DESIGNATION: Listed Building Grade II, SM

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Private

Martello tower, 1806. Derelict, disposed by Ministry of Defence to private owner. The preservation of archaeological and historical significance will be the main consideration in assessing the suitability of proposals to convert Martello towers for residential use.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Dymchurch Redoubt,
Hythe Ranges,
Hythe**

DESIGNATION: Scheduled Monument

CONDITION: Poor

OCCUPANCY: Part occupied

PRIORITY: E (D)

OWNER TYPE: Government

Currently used as a military training facility. The original fort of 1806 is a massive brick circular structure within a dry moat, and has C20 additions. Located on MOD ranges, some parts have been brought back into use. There is brickwork deterioration to both the original fort and later additions. A conservation plan was prepared in 2005. Phased repairs are in progress.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **The Parish Church of St Mary
and St Eanswythe,
Church Street,
Folkestone**

DESIGNATION: Listed Place of Worship Grade II*, CA

CONDITION: Poor

PRIORITY: D (D)

OWNER TYPE: Religious organisation

Church mentioned in Domesday Book but greatly enlarged and extended in C13, further renovated in C15 and partly rebuilt in C19. Built of sandstone rubble with tiled roofs and shingled spire; the chancel is rendered. Repairs required to the masonry of the crenulated parapets; replacement of roofs; repair of internal plaster (damaged due to water ingress) and to the timber panelling. A Repair Grant for Places of Worship has been offered to support this work.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Romano-British building south of Burch's Rough, Lympe

DESIGNATION: Scheduled Monument (No.1004216)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Motte and Bailey Castle 200m north west of Stowting Church, Stowting

DESIGNATION: Scheduled Monument (No.1012099)

CONDITION: Generally unsatisfactory
with major localised problems

PRINCIPAL VULNERABILITY: Extensive animal burrowing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Bowl barrow 150m north east of Red House Farm, Swingfield

DESIGNATION: Scheduled Monument (No.1011765)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Bowl barrow at Minnis Beeches, Swingfield

DESIGNATION: Scheduled Monument (No.1011766)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SWALE



SITE NAME: **The ruins of Shurland Hall,
Leysdown Road,
Eastchurch**

DESIGNATION: Listed Building Grade II*, SM

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: F (F)

OWNER TYPE: Trust

Tudor courtier house with long history of neglect. English Heritage has worked with the Spitalfield Trust on a rescue project to which an English Heritage grant was offered. Works are well advanced and attention is turning to the other ruins. The property is for sale.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Medieval Stables at Abbey Farm,
Abbey Fields,
Faversham**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: F (F)

OWNER TYPE: Private

Very small medieval farm building in a very poor state of repair. Consent has been granted to use as an outbuilding to an adjacent stable conversion and repairs are underway.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Former Medway Ports
Authority Offices (Dockyard House),
Sheerness Docks, Sheerness**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: E (C)

OWNER TYPE: Trust

House, 1830. Recently taken on by the Spitalfields Historic Buildings Trust and currently undergoing restoration to a single house.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Coach Houses, Naval Terrace,
Sheerness Docks,
Sheerness**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Very bad

OCCUPANCY: Part occupied

PRIORITY: D (B)

OWNER TYPE: Private

Coach houses ancillary to numbers 1-8 Naval Terrace, 1830. Some are now restored, but others continue to suffer from a lack of repairs and maintenance.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **I-15 (consec) Regency Close,
Sheerness Docks,
Sheerness**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Fair

OCCUPANCY: Part occupied

PRIORITY: E (C)

OWNER TYPE: Private

Row of houses built 1830. Largely vacant, but taken on by the Spitalfields Historic Buildings Trust in Spring 2011 and currently undergoing restoration.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Former Royal Dockyard Church
and attached wall and railings,
Sheerness Dockyard, Sheerness**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Private

Former St Paul's Parish Dockyard Church. Built originally in 1828, architect George Taylor; but destroyed by fire and rebuilt in 1884. Empty since 1970 and damaged by fire in 2001. A consent received for conversion to apartments has now lapsed, and renewal of it is subject to an appeal. A Repairs Notice has not been complied with and a Compulsory Purchase Order is a possibility.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WH World Heritage Site



SITE NAME: **The Boat Store (No. 78),
Sheerness Dockyard,
Sheerness**

DESIGNATION: Listed Building Grade I, CA

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Company

Boat store. Built 1859. Since the destruction of the Crystal Palace and the first South Kensington Museum this is the earliest surviving example of a multi-storey iron-frame and panel structure. In minor use for storage. Discussions with Local Planning Authority and port company continuing.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Former Working Mast House,
26 Jetty Road, Sheerness Dockyard,
Sheerness**

DESIGNATION: Listed Building Grade II*

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Company

Large C19 industrial building used for constructing and storing masts and small boats. Disused and marooned at the heart of a working port. Currently threatened with demolition as part of proposals for a wind turbine manufacturing plant at the port.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Murston Old Church,
Sittingbourne**

DESIGNATION: Scheduled Monument

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: A (A)

OWNER TYPE: Trust

Originally a large church with three aisles and three chancels with a square tower and wooden turret, built between 1375 and 1550; only the southern chapel remains. The rest of the church survives as buried archaeological remains.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Sheerness Defences,
Swale**

DESIGNATION: Scheduled Monument, CA

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: C (C)

OWNER TYPE: Company

Moated artillery fortifications from C17-C20. A major complex defending the dockyard.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Church of All Saints,
Seasalter Road,
Graveney with Goodnestone**

DESIGNATION: Listed Place of Worship Grade I

CONDITION: Poor

PRIORITY: C (New entry)

OWNER TYPE: Religious organisation

C12 and C14 church with some C15 fenestration. Little restored, but downpipes dated 1870. Coursed rubble and flint with plain tiled roof. Chancel, nave with aisle, north-western tower and south porch. The north and south aisle roofs are covered in asphalt and are at the end of their lives. There is water getting into the church and damaging the plaster work. Also the tracery to the aisle windows is in poor condition.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Mary the Virgin,
Church Lane,
Newington**

DESIGNATION: Listed Place of Worship Grade I, CA

CONDITION: Poor

PRIORITY: B (B)

OWNER TYPE: Religious organisation

Large church on the northern outskirts of the village dating from C11. Has defective tiling especially to the south aisle roof, inadequate rainwater disposal, including oversized gutters and downpipes. There is decaying stonework and pointing. A Repair Grant for Places of Worship has been offered to assist in the cost of repairs.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Church of St Giles,
Church Road,
Tonge**

DESIGNATION: Listed Place of Worship Grade I
CONDITION: Poor
PRIORITY: C (C)
OWNER TYPE: Religious organisation

Originally C12 flint church with unconventional valley gutter arrangement. There is a clear structural crack on the east wall of the chancel. Recent repointing and repair of brickwork and active management of vegetation is evident though.

Contact: Principal Heritage at Risk Adviser 01483 252000

THANET



SITE NAME: **The Scenic Railway at Dreamland,
Belgrave Road,
Margate**

DESIGNATION: Listed Building Grade II*
CONDITION: Very bad
OCCUPANCY: N/A
PRIORITY: C (New entry)
OWNER TYPE: Company

Roller coaster, 1919-1920. The oldest surviving roller coaster in Britain and of an early type of roller coaster design. In 2008, a major fire believed to have been caused by arson, destroyed about a quarter of the timber superstructure. Subject of a possible compulsory purchase order in 2012, which is intended to bring about its restoration.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Dreamland Cinema,
Marine Terrace,
Margate**

DESIGNATION: Listed Building Grade II*
CONDITION: Poor
OCCUPANCY: Vacant
PRIORITY: C (C)
OWNER TYPE: Company

Cinema, 1935. The first English cinema in the style based on the Titania Palast of Berlin, a style subsequently used extensively by Odeon. Vacant and with a substantial backlog of repairs.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Barn about 50 metres east
of Ozengeil Grange,
Haine Road, Ramsgate**

DESIGNATION: Listed Building Grade II*
CONDITION: Very bad
OCCUPANCY: Vacant
PRIORITY: C (C)
OWNER TYPE: Private

Derelict late medieval grain barn, on land formerly owned by St Augustine's Abbey, Canterbury.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Augustine of England
with Cloisters attached,
St Augustine's Road,
Ramsgate**

DESIGNATION: Listed Place of Worship Grade I, CA
CONDITION: Very bad
PRIORITY: B (B)
OWNER TYPE: Religious organisation

Large town church complex standing on a cliff top, constructed by AWG Pugin. It is at risk due to blocked valley gutters, hoppers, downpipes and drains; slipped and missing roof tiles; leaking asphalt roof to tower; blocked outlet from tower; structural cracking and movement to stonework; eroding stonework; missing coping to west side of cloister; rusting ferramenta to windows; fractured and missing stonework to mullions, tracery and jambs; and defective electrical installation. A Repair Grant for Places of Worship has been offered to support the cost of repair works.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Ring ditches and enclosures 500yds (450m) ESE of College Farm, Acol

DESIGNATION: Scheduled Monument (No.1005489)
PRINCIPAL VULNERABILITY: Arable ploughing
OWNER TYPE: Private

CONDITION: Extensive significant problems

TREND: Declining

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Group of ring ditches 400yds (360m) north west of Great Brooks End Farm, Birchington

DESIGNATION: Scheduled Monument (No.1004207)
PRINCIPAL VULNERABILITY: Arable ploughing
OWNER TYPE: Private

CONDITION: Extensive significant problems

TREND: Declining

CONTACT: Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Anglo-Saxon cemetery, Dane Valley Road, Broadstairs and St Peters		
DESIGNATION:	Scheduled Monument (No.1003601)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Double ring ditch and two enclosures 400yds (360m) north west of Danes Court, Broadstairs and St Peters		
DESIGNATION:	Scheduled Monument (No.1004230)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000


SITE NAME:	Anglo-Saxon cemetery south of Ozengell Grange, Margate and Ramsgate		
DESIGNATION:	Scheduled Monument (No.1004228)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Quex Park settlements, Margate and Ramsgate		
DESIGNATION:	Scheduled Monument (No.1005137)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Settlement one mile (1610m) east of village, Margate and Ramsgate		
DESIGNATION:	Scheduled Monument (No.1005135)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Enclosure and ring ditches 200yds (180m) ENE of Minster Laundry, Minster		
DESIGNATION:	Scheduled Monument (No.1004203)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

TONBRIDGE AND MALLING

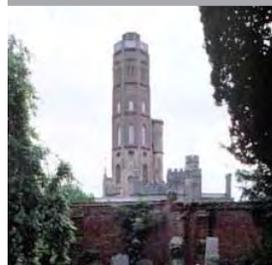

SITE NAME:	Hadlow Tower, High Street, Hadlow	Tower of an otherwise demolished late C18/early C19 country house. Recently taken on by the VIVAT Trust following a compulsory purchase order. A programme of repairs and conversion to a holiday let is underway with grant aid from English Heritage and Heritage Lottery Fund.
DESIGNATION:	Listed Building Grade I, CA	
CONDITION:	Poor	
OCCUPANCY:	Vacant	
PRIORITY:	E (D)	
OWNER TYPE:	Trust	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Romano-British villa, Anglo-Saxon cemetery and associated remains at Eccles, Aylesford		
DESIGNATION:	Scheduled Monument (No.1011770)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WH	World Heritage Site

SITE NAME:	Chapel of St Blaise, Offham		
DESIGNATION:	Scheduled Monument (No.1005488)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Town banks, Tonbridge		
DESIGNATION:	Scheduled Monument (No.1003599)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Development requiring planning permission	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

TUNBRIDGE WELLS



SITE NAME:	Providence Chapel, Stone Street, Cranbrook	Strict Baptist chapel, no longer used for worship. 1795 with early to mid C19 alterations. A temporary scaffold roof has been erected to limit water ingress.
DESIGNATION:	Listed Building Grade II*, CA	
CONDITION:	Poor	
OCCUPANCY:	Vacant	
PRIORITY:	C (C)	
OWNER TYPE:	Private	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	High Rocks Camp (part in East Sussex), Tunbridge Wells		
DESIGNATION:	Scheduled Monument (No.1003816)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Royal Tunbridge Wells		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Improving
CONTACT:	Alan Legg (LPA) 01892 554069	NEW ENTRY:	No

TUNBRIDGE WELLS / TONBRIDGE AND MALLING



SITE NAME:	Somerhill, Capel	Early C19 terraced garden probably laid out by William Sawrey Gilpin, with surrounding, later C19, ornamental gardens, all set within parkland. The site is now divided between a school, an estate and several smaller, private owners all operating diverse management regimes. The school is interested in commissioning a Conservation Management Plan if grant aid is available. This could form the basis of a coordinated management approach for the whole site. Discussions continue.
DESIGNATION:	Registered Park and Garden Grade II, also 4 LBs	
CONDITION:	Extensive significant problems	
VULNERABILITY:	Medium	
TREND:	Declining	
OWNER TYPE:	Mixed, multiple owners	Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

KENT / EAST SUSSEX

TUNBRIDGE WELLS / WEALDEN




SITE NAME:	Bayham Abbey, Lamberhurst/Frant
DESIGNATION:	Registered Park and Garden Grade II, also 7 LBs, 1 SM
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	Medium
TREND:	Declining
OWNER TYPE:	Mixed, multiple owners

Late C19 mansion gardens with formal terraces and informal pleasure ground all set within a Humphry Repton park focussed on the abbey ruins. The property was divided and sold in the 1970s and further fragmented since then. English Heritage looks after the abbey ruins but fragmentation of ownership has severely compromised this significant picturesque landscape. Co-ordinated action is needed to conserve the historic landscape – part of which lies in East Sussex and part in Kent.

Contact: Principal Heritage at Risk Adviser 01483 252000

OFF KENT

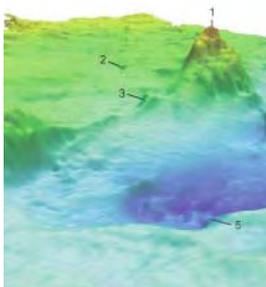

SITE NAME:	London, The Nore
DESIGNATION:	Protected Wreck Site
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Government
PHOTO:	© Wessex Archaeology and the Port of London Authority

The London was a Second Rate 'Large Ship' built in Chatham in 1654 during the Interregnum. She is known to have participated in the First Dutch War (1652-4) and later formed part of an English Squadron sent to collect Charles II from the Netherlands and restore him to the throne. The London blew-up on passage from Chatham in March 1665. A series of artefacts have been identified on the river bed and recovered to the surface. In addition, an abundance of loose material on the bottom has been noted in a remarkably well preserved state. This suggests that the site has been recently disturbed.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Rooswijk, towards the north eastern end of the Kellett Gut
DESIGNATION:	Protected Wreck Site
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Private
PHOTO:	© Private

The VOC (Dutch East Company) ship Rooswijk was built in Amsterdam in 1737 but stranded on the Goodwin Sands in 1739 while en route from the Texel to the East Indies. The site represents archaeological evidence for the practice of large-scale overseas commerce between the Netherlands and Asia during the C18. As with other sites in the Goodwins, archaeological material is at risk owing to mobile sediments causing periodic exposure.

Contact: Principal Heritage at Risk Adviser 01483 252000

MEDWAY (UA)



SITE NAME:	The Chapel of St Bartholomew, High Street, Chatham
DESIGNATION:	Listed Building Grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

Former hospital chapel, C12. Now vacant, but potentially for sale.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Cliffe Fort, Cliffe
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Company

Fort circa 1860. Fort is now flooded. Much of it is stable due to massive construction, but significant detail is vulnerable to decay or vandalism. Remains of Brennan Torpedo Rail are also vulnerable to erosion. English Heritage has carried out detailed recording in 2010.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

	<p>SITE NAME: Cooling Castle, Cooling</p> <p>DESIGNATION: Listed Building Grade I, SM</p> <p>CONDITION: Very bad</p> <p>OCCUPANCY: Part occupied</p> <p>PRIORITY: A (A)</p> <p>OWNER TYPE: Private</p>	<p>A quadrangular castle with ruined fabric, some of which is in need of major repair.</p> <p>Contact: Principal Heritage at Risk Adviser 01483 252000</p>
	<p>SITE NAME: Barn 30 yards south east of the manor, Upnor Road (south side), Frindsbury Extra</p> <p>DESIGNATION: Listed Building Grade I, CA</p> <p>CONDITION: Very bad</p> <p>OCCUPANCY: Vacant</p> <p>PRIORITY: A (A)</p> <p>OWNER TYPE: Private</p>	<p>Very fine medieval barn, more or less redundant for agricultural use. Subject to fire damage. A programme of urgent works is under discussion as a prelude to full restoration.</p> <p>Contact: Principal Heritage at Risk Adviser 01483 252000</p>
	<p>SITE NAME: Brompton Lines, Gillingham</p> <p>DESIGNATION: Scheduled Monument, CA</p> <p>CONDITION: Poor</p> <p>OCCUPANCY: N/A</p> <p>PRIORITY: D (D)</p> <p>OWNER TYPE: Government</p>	<p>Landward defences to dockyard at Chatham, subsequently used in part as a pleasure ground for officers. Defences cross Ministry of Defence owned land, housing and Brompton Barracks. Lower lines site now released to new owner. Discussions continue about management of retained MOD parts.</p> <p>Contact: Principal Heritage at Risk Adviser 01483 252000</p>
	<p>SITE NAME: Fort Darnet, Gillingham</p> <p>DESIGNATION: Scheduled Monument</p> <p>CONDITION: Very bad</p> <p>OCCUPANCY: Vacant</p> <p>PRIORITY: A (A)</p> <p>OWNER TYPE: Private</p>	<p>A Royal Commission fort circa 1860, in the Medway Estuary, partially flooded.</p> <p>Contact: Principal Heritage at Risk Adviser 01483 252000</p>
	<p>SITE NAME: No. 8 machine shop, Dock Head Road, Chatham Dockyard, Gillingham</p> <p>DESIGNATION: Listed Building Grade II*</p> <p>CONDITION: Poor</p> <p>OCCUPANCY: Vacant</p> <p>PRIORITY: C (C)</p> <p>OWNER TYPE: Quango</p>	<p>1840 former dry dock cover, later used as Machine Shop, now disused. Cladding removed and awaiting solution.</p> <p>Contact: Principal Heritage at Risk Adviser 01483 252000</p>
	<p>SITE NAME: Cockham Wood Fort, Hoo St Werburgh</p> <p>DESIGNATION: Scheduled Monument</p> <p>CONDITION: Very bad</p> <p>OCCUPANCY: Vacant</p> <p>PRIORITY: A (A)</p> <p>OWNER TYPE: Private</p>	<p>A rare C17 artillery fort. The brick lower battery is very decayed as it is washed by the tidal Medway. The higher earthwork batteries survive but in woodland, with the remains of a redoubt and commander's house.</p> <p>Contact: Principal Heritage at Risk Adviser 01483 252000</p>

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

	SITE NAME: Fort Hoo, Hoo St Werburgh	Sister fort to Fort Darnet circa 1860. Fort lies abandoned on an island in the Medway.
	DESIGNATION: Scheduled Monument	
	CONDITION: Poor	
	OCCUPANCY: Vacant	
	PRIORITY: C (C)	
	OWNER TYPE: Company	Contact: Principal Heritage at Risk Adviser 01483 252000
	SITE NAME: Artillery Tower (Grain Tower), Isle of Grain	Artillery tower of 1855 with C20 additions. Forms part of the defences to Sheerness dockyard. Abandoned and surrounded by the sea at high tide.
	DESIGNATION: Listed Building Grade II, SM	
	CONDITION: Very bad	
	OCCUPANCY: Vacant	
	PRIORITY: C (C)	
	OWNER TYPE: Private	Contact: Principal Heritage at Risk Adviser 01483 252000
	SITE NAME: Brompton Lines (Fort Amherst), Rochester	Part of the major C18 landward defence to the dockyard at Chatham. Open to the public as part of the Great Lines Heritage Park. Grants from English Heritage and local authority have conserved main part but significant areas still derelict.
	DESIGNATION: Scheduled Monument, CA	
	CONDITION: Poor	
	OCCUPANCY: Vacant	
	PRIORITY: B (B)	
	OWNER TYPE: Trust	Contact: Principal Heritage at Risk Adviser 01483 252000
	SITE NAME: 351 High Street, Rochester	Early C18 town house, last used as a shop in 1980s. Empty since then, but a programme of repairs is currently under discussion.
	DESIGNATION: Listed Building Grade II*, CA	
	CONDITION: Poor	
	OCCUPANCY: Vacant	
	PRIORITY: C (E)	
	OWNER TYPE: Company	Contact: Principal Heritage at Risk Adviser 01483 252000
SITE NAME: Gillingham Green	DESIGNATION: Conservation Area	CONDITION: Poor
	VULNERABILITY: High	TREND: No significant change
	CONTACT: Alice Brockway (LPA) 01634 334 317	NEW ENTRY: No
SITE NAME: Halling	DESIGNATION: Conservation Area	CONDITION: Poor
	VULNERABILITY: High	TREND: No significant change
	CONTACT: Alice Brockway (LPA) 01634 334 317	NEW ENTRY: No
SITE NAME: Star Hill to Sun Pier	DESIGNATION: Conservation Area	CONDITION: Fair
	VULNERABILITY: Medium	TREND: Deteriorating
	CONTACT: Alice Brockway (LPA) 01634 334 317	NEW ENTRY: No

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WH	World Heritage Site

MILTON KEYNES (UA)



SITE NAME: **Orchard House,
67 and 69 High Street,
Olney**

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: C (A)

OWNER TYPE: Private

Pair of C18 houses converted into a single dwelling in 1904 by Ellis Anderson for Joseph William Mann. Impressive and exceptionally complete Edwardian interior. The building has been unoccupied for some time and is in poor condition. While the owner has carried out temporary repairs which have halted the deterioration of the built fabric, its long term future still needs to be secured.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Roman town of Magiovinium and Roman fort, Bletchley and Fenny Stratford

DESIGNATION: Scheduled Monument (No.1006943)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Wood Farm moat, Clifton Keynes

DESIGNATION: Scheduled Monument (No.1006919)

CONDITION: Generally satisfactory
but with significant localised problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

St Martin's Church (site of), Emberton

DESIGNATION: Scheduled Monument (No.1021373)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Roman villa 300m south east of Newton Lodge Farm, Newton Blossomville

DESIGNATION: Scheduled Monument (No.1014794)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Roman site at Olney, Olney

DESIGNATION: Scheduled Monument (No.1006918)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Group of ring ditches and enclosures at Tyringham, Tyringham and Filgrave

DESIGNATION: Scheduled Monument (No.1006924)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

OXFORDSHIRE

CHERWELL



SITE NAME: **Hampton Gay Manor House,
Hampton Gay,
Hampton Gay and Poyle**

Manor house, late C16. Burnt down in 1887. Now a roofless ruin.

DESIGNATION: Listed Building Grade II, SM


CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: A (A)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000

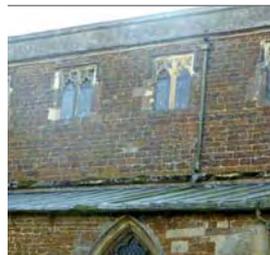

SITE NAME: **Church of St Peter,
High Street,
Hook Norton,
Banbury**

Large church constructed of coursed rubble ironstone with limestone ashlar dressings, dating from Norman period. Roof coverings are failing and allowing water ingress. Repairs required to chancel roof, gutters, associated timbers, and stonework repointing. A Repair Grant for Places of Worship has been offered to support this work.

DESIGNATION: Listed Place of Worship Grade I, CA

CONDITION: Poor

PRIORITY: D (D)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Lawrence,
Main Road,
Milcombe**

C13 church, with restoration by GE Street in 1859 (Pevsner). Ironstone with Welsh slate roof. Church applied for a Repair Grant for Places of Worship for repair of roof slating to the nave, north aisle, chancel, porch and vestry and associated repair to timber, plaster and rainwater goods. Grant aid has been offered for all works other than chancel works as a Chancel Liability is in place for this area of the church.

DESIGNATION: Listed Place of Worship Grade II

CONDITION: Poor

PRIORITY: B (New entry)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Ilbury Camp hillfort, Deddington

DESIGNATION:

Scheduled Monument (No.1015167)

CONDITION:

Generally satisfactory but with significant localised problems

PRINCIPAL VULNERABILITY:

Extensive animal burrowing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Islip Roman villa, 300m east of Hillside Farm, Islip

DESIGNATION:

Scheduled Monument (No.1015161)

CONDITION:

Extensive significant problems

PRINCIPAL VULNERABILITY:

Arable ploughing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

RAF Bicester: World War II airfield, Laughton

DESIGNATION:

Scheduled Monument (No.1021455)

CONDITION:

Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY:

Extensive animal burrowing

TREND:

Declining

OWNER TYPE:

Government or Agency

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Castle Bank Enclosure, North Newington

DESIGNATION:

Scheduled Monument (No.1021414)

CONDITION:

Extensive significant problems

PRINCIPAL VULNERABILITY:

Arable ploughing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Blenheim Villa, a Roman villa and associated field system 200m north east of Little Cote, Shipton-on-Cherwell and Thrupp		
DESIGNATION:	Scheduled Monument (No.1021367)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow 730m south west of Enslow Bridge, Shipton-on-Cherwell and Thrupp		
DESIGNATION:	Scheduled Monument (No.1021413)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Banbury Grimsbury		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Low	TREND:	Deteriorating significantly
CONTACT:	Rose Todd (LPA) 01295 221846	NEW ENTRY:	No

SITE NAME:	RAF Bicester, Caversfield		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Low	TREND:	Deteriorating significantly
CONTACT:	Rose Todd (LPA) 01295 221846	NEW ENTRY:	No

SITE NAME:	RAF Upper Heyford, Ardley		
DESIGNATION:	Conservation Area	CONDITION:	Very bad
VULNERABILITY:	Medium	TREND:	Deteriorating
CONTACT:	Rose Todd (LPA) 01295 221846	NEW ENTRY:	No

OXFORD



SITE NAME: **Church of St Thomas the Martyr,
St Thomas Street**

Church with chancel dating to late C12 and C15-C16 nave, west tower and north chapel. Important for connections with the early history of the Oxford Movement through the Vicar from 1842-92 Canon Chamberlain. Roof in poor condition though structurally sound overall. The rainwater goods are generally adequate apart from one gutter, and stonework is fair to poor.

DESIGNATION: Listed Place of Worship Grade II

CONDITION: Poor

PRIORITY: C (C)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Swing bridge, LNWR Station, Oxford		
DESIGNATION:	Scheduled Monument (No.1003651)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SOUTH OXFORDSHIRE



SITE NAME: **Well house,
Wick Farmhouse, Barton,
Beckley and Stowood**

Well house associated with Wick Farmhouse, late C17, in poor condition and not in use. Square plan ashlar structure in Baroque style with stone benches lining walls. Well now filled in. Not in use

DESIGNATION: Listed Building Grade II*

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: C (C)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Bix Old Church, Bix, Bix and Assendon
DESIGNATION:	Listed Building Grade II, SM
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Religious organisation

Ruins of church of St James. Norman chancel with later additions. Very overgrown. Roofless, with considerable collapse at west end. Further collapse likely. English Heritage Section 17 management agreement with PCC to control vegetation (2010).

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Gothic Temple, Shotover Park, Forest Hill with Shotover
DESIGNATION:	Listed Building Grade II*, RPG I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	C (C)
OWNER TYPE:	Private

Gothic Temple within the grade I Shotover Park, designed as a garden temple or boathouse c1740, possibly William Townsend of Oxford for General James Tyrrell in Gothick style. The temple lies at the eastern end of the main axis of the early C18 layout of the formal garden. Front repaired 10 years ago but rear structure in need of repairs to roof and rainwater goods. Conservation Management Plan completed 2009.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Walled garden approximately 30 metres west of manor, North Weston, Great Haseley
DESIGNATION:	Listed Building Grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Private

Walled garden with loggia dating from early C18. Built of brick with limestone ashlar details and a plain tile roof to the loggia. The wall has a moulded brick coping. It was formerly part of the North Weston Manor which was largely demolished in early C19. The wall tops are disintegrating; there are structural cracks and the loggia is propped to prevent collapse.


Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Fernhouse, archway, gateway and walls, The Street, Mapledurham
DESIGNATION:	Listed Building Grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

Fernhouse, archway, gateway and walls. C17 and C18. The Fernhouse is roofless.

Contact: Principal Heritage at Risk Adviser 01483 252000

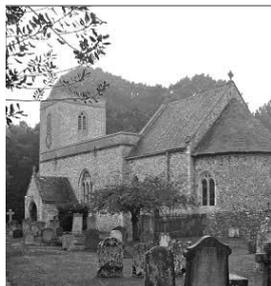

SITE NAME:	Church of St Peter and St Paul, Checkendon
DESIGNATION:	Listed Place of Worship Grade I, CA
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

A small Norman church of flint and stone with ashlar dressing. It is little altered since the medieval period and is in a small rural village location. Rare find of original wall paintings in the north chancel wall were revealed in recent years, dating from 1330-1340. Requires repairs to the roofs of the nave, chancel and apse, to drainage and rainwater disposal systems and remedial works to apse walls and the wall paintings. A Repair Grant for Places of Worship has been offered to support these works.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of St Peter, Main Street, Little Wittenham
DESIGNATION:	Listed Place of Worship Grade II*, CA
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

Rural hamlet church with C14 to C15 tower and staircase turret. Nave rebuilt and restored 1862 and extension to north side of chancel 1902. Tower work is decayed and allowing water ingress. Extensive repairs required to much of tower and associated timbers. A Repair Grant for Places of Worship has been offered to support this work.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.


- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

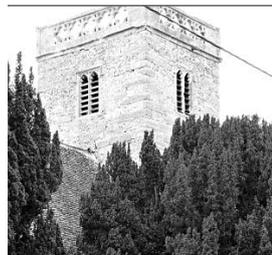

SITE NAME: **Church of All Saints,
Church Street,
North Moreton**

DESIGNATION: Listed Place of Worship Grade I, CA
CONDITION: Very bad
PRIORITY: D (F)
OWNER TYPE: Religious organisation

Church, mainly flint and sandstone, with tiled nave and chancel, and sheet roof to south aisle. Mostly mid C13 to C14, altered C15 and restored in Victorian era. Tower roof currently under repair but chantry chapel and south aisle in need of urgent repairs too. Several phases of work likely to be required to fully repair and recover the remaining roofs. Two Repair Grants for Places of Worship have been offered to support the work so far.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Church of St Mary,
Church Lane,
Pyrton**

DESIGNATION: Listed Place of Worship Grade II*
CONDITION: Poor
PRIORITY: D (New entry)
OWNER TYPE: Religious organisation

Church. Early C12, C15 porch; rebuilt in 1856 by JC Buckler. Knapped and coursed flint, limestone ashlar dressings; gabled old tile roof. Chancel with vestry and nave with porch and west bellcote. Chancel side walls each have early C12 roll-moulded lancet. Early C12 south doorway has hood of grapes, leaves and fruit over zig-zag arch. In need of high level repairs for which investigations are taking place in 2012 followed by repairs in 2013.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **North Stoke henge and ring ditch site, Crowmarsh**

DESIGNATION:	Scheduled Monument (No.I006335)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Dike Hills, Dorchester**

DESIGNATION:	Scheduled Monument (No.I006364)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Ring ditches, cursus, enclosures and settlement site, Dorchester**

DESIGNATION:	Scheduled Monument (No.I006344)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Settlement site at Northfield Farm, Long Wittenham**

DESIGNATION:	Scheduled Monument (No.I002925)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Site of Roman kilns, Marsh Baldon**

DESIGNATION:	Scheduled Monument (No.I006337)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Long barrow 140m north west of Cooks Cottages, Warborough**

DESIGNATION:	Scheduled Monument (No.I016629)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME: Long barrow 340m north west of Cooks Cottages, Warborough			
DESIGNATION:	Scheduled Monument (No.1016632)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Romano-British settlement 520m north west of Cooks Cottages, Warborough			
DESIGNATION:	Scheduled Monument (No.1016630)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Thomley deserted medieval village, Waterperry with Thomley			
DESIGNATION:	Scheduled Monument (No.1006295)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Camp on Bozedown, Whitchurch on Thames			
DESIGNATION:	Scheduled Monument (No.1003704)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

VALE OF WHITE HORSE



SITE NAME: **Milton Manor House,
High Street,
Milton**

DESIGNATION: Listed Building Grade I, CA
CONDITION: Poor
OCCUPANCY: Occupied
PRIORITY: A (New entry)
OWNER TYPE: Private

Manor House built circa 1670 in classical style with later attached flanking wings, (one of which includes a chapel), kitchen and brewhouse range added circa 1776. Chapel and stable roofs in poor condition, much guttering failed or missing and cornice to main block in very poor condition.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Castle mound at Fitzharris, Abingdon			
DESIGNATION:	Scheduled Monument (No.1006311)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive visitor erosion	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Sutton Wick settlement site, Abingdon			
DESIGNATION:	Scheduled Monument (No.1003671)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Settlement site south east of church, Appleford-on-Thames			
DESIGNATION:	Scheduled Monument (No.1004849)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WH World Heritage Site

SITE NAME:	Settlement site, Drayton		
DESIGNATION:	Scheduled Monument (No.1004852)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	East Hendred Down bowl barrow, East Hendred		
DESIGNATION:	Scheduled Monument (No.1016982)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Yew Down round barrow 950m south west of Butterbush Reservoir, Lockinge		
DESIGNATION:	Scheduled Monument (No.1018719)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Disc barrow 700m north east of Sevenbarrows House: part of the Seven Barrows cemetery, Sparsholt		
DESIGNATION:	Scheduled Monument (No.1012343)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Roman villa east of Cornhill Farm, West Challow		
DESIGNATION:	Scheduled Monument (No.1004854)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000


WEST OXFORDSHIRE



SITE NAME:	Church of St Britius, Station Road, Brize Norton
DESIGNATION:	Listed Place of Worship Grade II*
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

A Norman church, later enlarged in C13 when west tower was added. Considerable restoration carried out in 1868. Walls of coursed limestone rubble and roofs of gabled stone slates. Roofs are in a very poor condition; a tarpaulin has been put up inside to catch plaster falls caused by areas of stone slate slippage. A Repair Grant for Places of Worship has been offered to support remedial repairs to high level masonry.

Contact: Principal Heritage at Risk Adviser 01483 252000

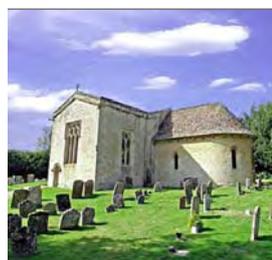

SITE NAME:	Church of St Nicholas, Kiddington
DESIGNATION:	Listed Place of Worship Grade II*
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

A mostly C14 rural village church with a C12 core, restored 1879 with addition of vestry. Constructed of coursed limestone rubble with stone slates to chancel. Repairs required to nave roof, which is failing and allowing water ingress, and to parapet stonework and rainwater goods. A Repair Grant for Places of Worship has been offered to support this work, and repairs should be completed in 2012.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Church of St Michael and All Angels, Lower End, Leafield**

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Poor

PRIORITY: B (New entry)

OWNER TYPE: Religious organisation

Gothic Revival style church. Circa 1858, tower not completed until 1874, and rebuilt in shorter form early C20. By Sir George Gilbert Scott. Squared coursed stone; imitation stone tile roofs, stone spire, four-bay aisled nave, central tower; and chancel. 1960s re-roofing in concrete tiles with increased size and depth to the original has resulted in 'squeezed' valley gutters which block very easily, let water in, and eaves which cause water to overshoot the rainwater goods. Repair Grant for Places of Worship successfully applied for: Investigations underway 2012 with repairs to follow in 2013.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Iron Age settlement centring 500m south west of Black Bourton, Alvescot

DESIGNATION: Scheduled Monument (No.1002924)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Asthal Barrow: an Anglo-Saxon burial mound 100m SSW of Barrow Farm, Asthal

DESIGNATION: Scheduled Monument (No.1008414)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Scrub/tree growth

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Ring ditches, Aston, Cote, Shifford and Chimney

DESIGNATION: Scheduled Monument (No.1006341)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Interrupted ditch system, Broadwell

DESIGNATION: Scheduled Monument (No.1006340)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Bowl barrow 525m north of Barter's Hill Farm, Chadlington

DESIGNATION: Scheduled Monument (No.1014562)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

Besbury Lane bowl barrow, 450m north east of Conduit Farm, Churchill

DESIGNATION: Scheduled Monument (No.1015324)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Extensive animal burrowing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME:

One of a pair of bowl barrows 370m north west of High Lodge, Cornbury and Wychwood

DESIGNATION: Scheduled Monument (No.1011219)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	One of a pair of bowl barrows 370m north west of High Lodge, Cornbury and Wychwood		
DESIGNATION:	Scheduled Monument (No.1011227)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Pair of bowl barrows immediately south of Blindwell Wood, Crawley		
DESIGNATION:	Scheduled Monument (No.1015212)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Sites discovered by aerial photography, near Foxley Farm, Eynsham		
DESIGNATION:	Scheduled Monument (No.1006333)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Oaklands Farm Roman villa, Fawler		
DESIGNATION:	Scheduled Monument (No.1012901)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Linear earthworks east of Callow Hill Roman villa forming part of the north Oxfordshire Grim's Ditch, Glympton		
DESIGNATION:	Scheduled Monument (No.1014751)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Ring ditches, Grafton and Radcot		
DESIGNATION:	Scheduled Monument (No.1006339)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Beaconsfield Farm Roman villa, Great Tew		
DESIGNATION:	Scheduled Monument (No.1006352)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	145m section of the north Oxfordshire Grim's Ditch situated 200m west of Grimsdyke Farm, Kiddington with Asterleigh		
DESIGNATION:	Scheduled Monument (No.1012905)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WH	World Heritage Site

SITE NAME:	Medieval settlement and church of Asterleigh, Kiddington with Asterleigh		
DESIGNATION:	Scheduled Monument (No.1020966)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Pump Copse earthwork, Kiddington with Asterleigh		
DESIGNATION:	Scheduled Monument (No.1003242)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Enclosures and trackways, Langford		
DESIGNATION:	Scheduled Monument (No.1006327)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Rectangular enclosures 1100yds (1010m) north west of Mount Owen Farm, Lew		
DESIGNATION:	Scheduled Monument (No.1006348)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Enclosures 1500m south east of Little Faringdon, Little Faringdon		
DESIGNATION:	Scheduled Monument (No.1006316)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Shipton Barrow: a bowl barrow, Saxon barrow, and associated earthwork enclosure 350m north of Downs Lodge, Shipton-under-Wychwood		
DESIGNATION:	Scheduled Monument (No.1008493)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Complex of rectangular enclosures, ring ditches and tracks, Standlake		
DESIGNATION:	Scheduled Monument (No.1006342)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Callow Hill Roman villa, Stonesfield		
DESIGNATION:	Scheduled Monument (No.1014750)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	90m section of the north Oxfordshire Grim's Ditch 350m south of Grim's Dyke Farm, Wootton		
DESIGNATION:	Scheduled Monument (No.1012909)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PORTSMOUTH, CITY OF (UA)



SITE NAME:	Wymering Manor, Old Wymering Lane, Cosham,	Manor house with Medieval fabric and later work, most recently a youth hostel. In need of some structural repair and general renovation. Condition survey completed.
DESIGNATION:	Listed Building Grade II*, CA	
CONDITION:	Fair	
OCCUPANCY:	Vacant	
PRIORITY:	C (C)	
OWNER TYPE:	Local authority	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Fort Southwick, moat and ramparts, Portsdown Hill, Portsmouth	Fort circa 1860s. Part of Palmerston's Portsmouth defences. In poor condition in parts. Fort is now in private ownership following disposal by Defence Estate. Owner has started repairs but more are needed.
DESIGNATION:	Listed Building Grade I, SM	
CONDITION:	Fair	
OCCUPANCY:	Part occupied	
PRIORITY:	F (F)	
OWNER TYPE:	Company	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Fort Cumberland, Fort Cumberland Road, Eastney, Portsmouth	Coastal fort of 1746-1812 with later buildings and features. Some repairs have been carried out, and the number of buildings being used by the Centre for Archaeology and others has increased. The Guardhouse, a stand-alone structure within the Fort Cumberland complex and the only surviving element of the 1747 Demarets Fort, is suffering from water ingress and associated decay.
DESIGNATION:	Listed Building Grade II*, SM	
CONDITION:	Poor	
OCCUPANCY:	Part occupied	
PRIORITY:	F (F)	
OWNER TYPE:	English Heritage	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Hilsea Lines - Bastion No. 5, Hilsea, Portsmouth	Earthwork defence dating from 1858-1869, with batteries, magazines and barracks. Bastion No. 5 is continuing to suffer from vandalism and neglect.
DESIGNATION:	Scheduled Monument, CA	
CONDITION:	Poor	
OCCUPANCY:	N/A	
PRIORITY:	A (A)	
OWNER TYPE:	Local authority	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	No. 25 Store, Yard Services Manager's Office, 1/118 Jago Road, HM Naval Base, Portsmouth	Two storey storehouse of 1782, with internal courtyard. In fair condition but vacant. Future use uncertain.
DESIGNATION:	Listed Building Grade II*, CA	
CONDITION:	Fair	
OCCUPANCY:	Vacant	
PRIORITY:	C (C)	
OWNER TYPE:	Government	Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: 2-8 The Parade,
HM Naval Base,
Portsmouth

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: A (A)

OWNER TYPE: Government

Terrace of dockyard officers' lodgings, 1715-19. Partially converted to office use c1995, but now empty. Prone to wet rot and some structural movement. A repairs schedule promised by May 2009 has not been circulated. Background heating has been introduced, reducing damp levels. However, problems persist with detailing between the main building and the rear extensions.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Iron and Brass Foundry,
1/140 Victoria Road,
HM Naval Base, Portsmouth

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Fair

OCCUPANCY: Part occupied

PRIORITY: C (C)

OWNER TYPE: Government

The main part of the building was converted to office use in 2003. The east wing (Building 1/136) remains unused and at risk. There are concerns over water ingress.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Former Royal Naval Academy
(Buildings 1/14 and 1/116-9),
HM Naval Base Portsmouth,
Portsmouth

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: A (A)

OWNER TYPE: Government

One of the oldest structures in the Dockyard, this building is a Georgian forerunner of the Britannia Royal Naval College at Dartmouth. Natural ventilation has been introduced, reducing damp levels. Background heating was installed during winter months, however there are still signs of water ingress.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: The Beneficial School,
Kent Street, Portsea,
Portsmouth

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Fair

OCCUPANCY: Occupied

PRIORITY: C (D)

OWNER TYPE: Company

Charity school, 1784 and 1836. Now in use as a dance-drama school but needs further repair.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: No. 6 Dock, Basin No. 1,
Portsmouth Dockyard,
Portsmouth

DESIGNATION: Listed Building Grade I, SM, CA

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: C (C)

OWNER TYPE: Government

Naval dock c1690 rebuilt 1737, immediately adjacent to the Block Mills. The dock is suffering from rotation, and mortar joints on the stonework altars on the north side have opened up.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Horse Sand Fort,
Solent,
Portsmouth

DESIGNATION: Scheduled Monument

CONDITION: Poor

OCCUPANCY: Vacant

PRIORITY: C (C)

OWNER TYPE: Company

C19 sea fort in state of dereliction. Recently purchased by a company which is looking to convert the property into a museum.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.
- E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA Conservation Area
- LB Listed Building
- LPA Local Planning Authority
- NP National Park
- RPG Registered Park and Garden
- SM Scheduled Monument
- UA Unitary Authority
- WHS World Heritage Site



SITE NAME: Church of St Mary,
Fratton Road,
Kingston

DESIGNATION: Listed Place of Worship Grade II*, CA

CONDITION: Poor

PRIORITY: C (F)

OWNER TYPE: Religious organisation

The church has received a lot of grant in three phases, which have recently concluded, and this has dealt with the roofs and tower; leaving no major problems, though some stonework repair is still needed to the tower and structural problems at the east end of the sanctuary have been reported. Internally water staining is very clear at the east end though it is unclear if active ingress is occurring. The church is well used.

Contact: Principal Heritage at Risk Adviser 01483 252000

READING (UA)



SITE NAME: Chazey Farm barn,
The Warren,
Reading

DESIGNATION: Listed Building Grade I

CONDITION: Very bad

OCCUPANCY: Vacant

PRIORITY: A (A)

OWNER TYPE: Company

A very large seven bay red brick barn C17 or earlier. Structural cracking and gable currently has temporary shoring. The building forms part of a larger site proposal for a healthcare development. Ground works for new development undertaken spring 2010. No works to barn.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: St David's Hall,
Portland Place,
24-30 London Road, Reading

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Fair

OCCUPANCY: Vacant

PRIORITY: E (New entry)

OWNER TYPE: Educational Body

Grand Greek Revival Terrace circa 1830 formerly listed as 'Portland Place' now in educational use. Recent works have repaired external envelope to a high standard and eradicated an outbreak of dry rot. However, the building does not have a beneficial use and no proposals for a new use have been tabled.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Reading Abbey: a Cluniac and Benedictine monastery and Civil War earthwork, Reading		
DESIGNATION:	Scheduled Monument (No.1007932)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SOUTHAMPTON, CITY OF (UA)



SITE NAME: Star Hotel,
26-27 High Street

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Poor

OCCUPANCY: Occupied

PRIORITY: C (C)

OWNER TYPE: Private

Important coaching inn of C18, suffering from deferred maintenance. A condition survey is underway.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Chapel Mills,
American Wharf,
Elm Street, Southampton

DESIGNATION: Listed Building Grade II*

CONDITION: Poor

OCCUPANCY: Occupied

PRIORITY: D (D)

OWNER TYPE: Company

Former steam mill, 1781 and 1800, built to produce ship's biscuits for the Navy. Now used as storage and suffering from lack of maintenance. An application for domestic use could now be implemented.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



SITE NAME:	Red Lion Public House, 55 High Street, Southampton
DESIGNATION:	Listed Building Grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied
PRIORITY:	C (C)
OWNER TYPE:	Private

C15 hall house now commercial premises, suffering from water ingress and deferred maintenance. Condition survey needed as the first step towards repair.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	St Denys Church, St Denys Road, St Denys
DESIGNATION:	Listed Place of Worship Grade II
CONDITION:	Poor
PRIORITY:	C (C)
OWNER TYPE:	Religious organisation

Large suburban church designed by Sir George Gilbert Scott in 1868 and built of brick. At risk due to some severely corroded cast iron downpipes to the north elevation, some slipped and uneven roof tiling and falls of ceiling plaster internally.

Contact: Principal Heritage at Risk Adviser 01483 252000

SURREY

ELMBRIDGE



SITE NAME:	The Railway Straight-Brooklands Motor Racing Circuit, Byfleet
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	B (B)
OWNER TYPE:	Company

The designated section of the Railway Straight comprising c700m of the 1907 circuit, from the eastern boundary of the Mercedes-Benz History and Technology Centre to the modern break in the circuit north of Avro Way. Agreed works need to be undertaken.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Former kitchen garden walls to Claremont House, Claremont Park Road, Esher
DESIGNATION:	Listed Building Grade II*, RPG I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	D (C)
OWNER TYPE:	Private

Garden walls, 1717 by Vanbrugh. Unusually monumental. Suffering from vegetation and mortar loss and in need of general repair. Investigations for possible repairs completed with one of the owners. These repairs now need to take place as an exemplar.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	The Belvedere, Claremont Park, Esher
DESIGNATION:	Listed Building Grade II*, SM, RPG I
CONDITION:	Fair
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Charity

Eye-catcher and viewpoint in the form of a mock castle, 1717 by Sir John Vanbrugh. In need of repair to bring it back into use as a focal point of the grade I registered landscape of Claremont Park.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Brooklands

DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Deteriorating
CONTACT:	Clare Smith (LPA) 01372 474828	NEW ENTRY:	No

PRIORITY (FOR BUILDINGS)

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.
- E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA Conservation Area
- LB Listed Building
- LPA Local Planning Authority
- NP National Park
- RPG Registered Park and Garden
- SM Scheduled Monument
- UA Unitary Authority
- WH World Heritage Site

EPSOM AND EWELL



SITE NAME: **Riding School at The Durdans,
Chalk Lane,
Epsom**

Covered riding school of 1881, designed by George Devey for Lord Rosebery. Now used as part of a stable. The yard is now tenanted and the school is being repaired.

DESIGNATION: Listed Building Grade II*, CA

CONDITION: Fair

OCCUPANCY: N/A

PRIORITY: F (D)

OWNER TYPE: Company

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Epsom Town Centre, Epsom**

DESIGNATION: Conservation Area

CONDITION: Poor

VULNERABILITY: Low

TREND: Deteriorating

CONTACT: Anthony Evans (LPA) 01372 732394

NEW ENTRY?: No

SITE NAME: **Ewell Village**

DESIGNATION: Conservation Area

CONDITION: Very bad

VULNERABILITY: Low

TREND: Deteriorating

CONTACT: Anthony Evans (LPA) 01372 732394

NEW ENTRY?: No

SITE NAME: **Horton, Epsom**

DESIGNATION: Conservation Area

CONDITION: Poor

VULNERABILITY: Low

TREND: Deteriorating

CONTACT: Anthony Evans (LPA) 01372 732394

NEW ENTRY?: Yes

SITE NAME: **Linton's Lane, Epsom**

DESIGNATION: Conservation Area

CONDITION: Poor

VULNERABILITY: Low

TREND: Deteriorating

CONTACT: Anthony Evans (LPA) 01372 732394

NEW ENTRY?: No

GUILDFORD



SITE NAME: **St Mary's Church,
Quarry Street**

Impressive medieval town centre church. At risk due to roof tiles being in poor condition, especially to east end, with slipped and missing tiles and ineffective rainwater goods. Decaying stonework including to window surrounds. Deep perimeter drainage channel with defective joints. Water penetration has caused internal water damage at low level to plaster and stonework. A Repair Grant for Places of Worship was offered in 2009 to support repair work, though several phases of repair work will be required overall.

DESIGNATION: Listed Place of Worship Grade I, CA

CONDITION: Very bad

PRIORITY: B (B)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Clandon Park,
West Clandon**

Lancelot Brown designed Clandon's landscape park c1776-81. The house and garden are now owned by the National Trust but the park is privately owned. It is currently unsympathetically managed thus affecting the overall integrity of the design and the setting of the house. Discussions regarding a proposed business park development and a future landscape Conservation Management Plan, part funded by Natural England, are ongoing but successful resolution of these issues will hopefully reverse the current trajectory.

DESIGNATION: Registered Park and Garden Grade II, also part in CA, 8 LBs

CONDITION: Extensive significant problems

VULNERABILITY: High

TREND: Declining

OWNER TYPE: Mixed, multiple owners

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site

MOLE VALLEY



SITE NAME: **Ruins of Betchworth Castle,
Reigate Road,
Betchworth**

Late C17 ruined house built on site of medieval castle. Consolidation works should be completed during 2012 which will allow the monument to be removed from the Register.

DESIGNATION: Listed Building Grade II, SM

CONDITION: Fair

OCCUPANCY: N/A

PRIORITY: E (B)

OWNER TYPE: Private

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Brockham Lime Works,
Brockham**

The remains include an eastern battery of eight kilns and a western battery of two. The eastern battery, originally built in 1870, comprises four pairs of linked flare kilns. The northern two pairs were modified to the Brockham patent, as was the western battery, and comprises the type site for this type of kiln. Parts of the kilns remain in a very poor condition.

DESIGNATION: Listed Building Grade II, SM

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: B (B)

OWNER TYPE: Trust

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Providence Chapel,
Chapel Road,
Charlwood**

Originally built in Horsham as a barracks for troops to repel an invasion by Napoleon. Moved to Charlwood in 1815 and opened as a non-denominational chapel. Now in need of repair and its long term future decided.

DESIGNATION: Listed Place of Worship Grade II*

CONDITION: Poor

PRIORITY: A (New entry)

OWNER TYPE: Religious organisation

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME: **Lime kilns at Betchworth Quarry, Betchworth**

DESIGNATION: Scheduled Monument (No.1021346)

CONDITION: Generally unsatisfactory
with major localised problems

PRINCIPAL VULNERABILITY: Deterioration - in need of management

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME: **Anstiebury Camp: a large multivallate hillfort south east of Crockers Farm, Capel**

DESIGNATION: Scheduled Monument (No.1007891)

CONDITION: Generally unsatisfactory
with major localised problems

PRINCIPAL VULNERABILITY: Scrub/tree growth

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

SITE NAME: **Bell barrow in Deerleap Wood, Wotton**

DESIGNATION: Scheduled Monument (No.1007878)

CONDITION: Generally unsatisfactory
with major localised problems

PRINCIPAL VULNERABILITY: Scrub/tree growth

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories
are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Ashted Park, Ashted
DESIGNATION:	Registered Park and Garden Grade II, also part in CA, 19 LBs, 1 SM
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Improving
OWNER TYPE:	Mixed, multiple owners

Begun as a C17 park, Ashted was developed during the C18 and C19 by successive owners. Although the estate was sold as 51 lots in the 1920s, the historic landscape is largely in two ownerships. The main house and surrounds are a school which is preparing a new master plan that, it is hoped, will be informed by an almost complete landscape Conservation Management Plan. The northern park is managed as public open space by Surrey Wildlife Trust who are willing to acknowledge the site's history in management decisions.

Contact: Principal Heritage at Risk Adviser 01483 252000

REIGATE AND BANSTEAD



SITE NAME:	Alderstead (Merstham) Fort, Shepherd's Hill, Reigate
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Private

C19 mobilisation centre, one of 13 constructed on the North Downs for the defence of London. The scheduling comprises the infantry fort and detached tool store. Tree growth and poor drainage are causing problems and the fort has no current use.

Contact: Principal Heritage at Risk Adviser 01483 252000

RUNNYMEDE



SITE NAME:	Woburn Farm, Aldlestone
DESIGNATION:	Registered Park and Garden Grade II, also 5 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	Medium
TREND:	Declining
OWNER TYPE:	Mixed, multiple owners

An Arcadian landscaped 'ferme omée' designed by Philip Southcote from 1734-5, it was highly influential in the history of garden design but rather ephemeral in nature. The site is now in divided public and private ownership, including a school with intrusive sports facilities, some private residences and an area owned by the Local Planning Authority but leased for various inappropriate uses. A member of the Surrey garden history trust is assessing and recording the survival of historic features on site.

Contact: Principal Heritage at Risk Adviser 01483 252000

SPELTHORNE



SITE NAME:	Parish Church of St Matthew, Church Road, Ashford, Staines
DESIGNATION:	Listed Place of Worship Grade II
CONDITION:	Poor
PRIORITY:	B (New entry)
OWNER TYPE:	Religious organisation

Large town church of 1858-65 by William Butterfield, on site of an earlier church. Nail fixings to aisle roofs are failing and valleys either side of pitched roof are cracked and leaking. Funding secured from Heritage Lottery Fund towards a programme of repairs due to start in 2012.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of St Mary the Virgin, Church Street, Sunbury
DESIGNATION:	Listed Place of Worship Grade II*, CA
CONDITION:	Poor
PRIORITY:	D (D)
OWNER TYPE:	Religious organisation

The domed tower and cupola of St Mary's forms a prominent local landmark, surrounded by trees, standing alongside the River Thames. The tower and nave date to 1752, with the chancel and restoration works carried out in 1856 by Teulon. Sgraffito decoration was added in 1892. The tower was repaired with grant aid offered in 2002 but a defective aluminium roof to the nave continues to cause substantial problems. A Repair Grant for Places of Worship has been offered to support repair work.

Contact: Principal Heritage at Risk Adviser 01483 252000

TANDRIDGE



SITE NAME:	Bletchingly Castle, Bletchingly
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	D (D)
OWNER TYPE:	Private

Norman ringwork and bailey. Some trees are growing too close to the fragile masonry which is in need of consolidation. Owners have previously had plans for development approved. A Conservation Management Plan has also been approved and work now needs to start.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Large multivallate hillfort at War Coppice Camp, Bletchingley		
DESIGNATION:	Scheduled Monument (No.1008498)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Other	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

WAVERLEY

SITE NAME:	Four bowl barrows 30m south east of Tilford Barrows: part of The Barrows round barrow cemetery, Tilford		
DESIGNATION:	Scheduled Monument (No.1007883)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

WOKING

SITE NAME:	Brookwood Cemetery, Brookwood
DESIGNATION:	Registered Park and Garden Grade I, also CA, 18 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Mixed, multiple owners

The largest cemetery in England, founded in 1852 to house London's dead. Part remains a working cemetery and is owned by a limited company. The scale of maintenance and restoration work required is immense. With the help of Woking Borough Council, the company is considering a landscape Conservation Management Plan, partly funded by English Heritage. This will help the company to prioritise work, engage with other owners, and fulfil their ambitions to restore this historic site.

Contact: Principal Heritage at Risk Adviser 01483 252000

WEST BERKSHIRE (UA)

SITE NAME:	Chapel of St Leonard, east of Manor Farmhouse, Brimpton Road, Brimpton
DESIGNATION:	Listed Building Grade II*, SM
CONDITION:	Good
OCCUPANCY:	Vacant
PRIORITY:	E (E)
OWNER TYPE:	Private

Former chapel. C12 and later. Structure is generally sound, with repair programme completed. Planning permission and scheduled monument consent granted for sympathetic conversion to office use.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Pair of gate piers 103 metres south of east end of church, Park Lane, Hamstead Marshall
DESIGNATION:	Listed Building Grade I, RPG II
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Private

Gate piers (built before 1718) to C17 house, burnt down in 1718. The gate piers remain in the north west corner of the park. Stone cornice eroded in places with open joints and weed growth. The landscape is generally in good condition, but other pairs of gate piers and C17 walled gardens are also at risk.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Pair of gate piers 204 metres east of entrance to Home Farm, Park Lane, Hamstead Marshall
DESIGNATION:	Listed Building Grade I, RPG II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	D (C)
OWNER TYPE:	Private

Gate piers (before 1718) to C17 house, burnt down in 1718. The piers remain in the north west corner of the park. Some of the bricks have eroded. The landscape is generally in good condition, but other pairs of gate piers and the C17 walled garden are also at risk. Consent granted and Higher Level Stewardship grant from Natural England given in 2012 for repair works.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: Pair of gate piers 210 metres south of church tower, Park Lane, Hamstead Marshall

DESIGNATION: Listed Building Grade I, RPG II

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: C (C)

OWNER TYPE: Private

Gate piers (built before 1718) to C17 house, burnt down in 1718. The gate piers remain in the north west corner of the park. The landscape is generally in good condition, but other pairs of gate piers and the C17 walled gardens are also at risk. The stonework is in poor condition and a section of cornice has fallen away.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Pair of gate piers 30 metres south of east end of church, Park Lane, Hamstead Marshall

DESIGNATION: Listed Building Grade I, RPG II

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: D (A)

OWNER TYPE: Private

Gate piers (before 1718) to C17 house, burnt down in 1718. The piers remain in the north west corner of the park. Bricks and pointing have eroded and the stone cornices are damaged. Shrubs are growing from the joints and a section of the base and the pier corner has fallen away. Other pairs of gate piers and the C17 walled gardens are also at risk. Consent granted and HLS grant given in 2012 for repair works.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Three pairs of gate piers and walls around gardens and terrace at Home Farm, Park Lane, Hamstead Marshall

DESIGNATION: Listed Building Grade I, RPG II

CONDITION: Very bad

OCCUPANCY: N/A

PRIORITY: D (C)

OWNER TYPE: Private

Two late C17 walled gardens (one with raised terrace) and three pairs of gate piers located in the north west corner of the park. Formerly the gardens to the C17 house, burnt down in 1718. Used by the C19 as kitchen gardens for Hamstead Lodge. The walls are in joint ownership. Some sections have open joints. One of the gate piers has weed growth to the cornice. Parts are being repaired.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Church of St Mary, Church Street, Hampstead Norreys

DESIGNATION: Listed Place of Worship Grade I, CA

CONDITION: Poor

PRIORITY: D (D)

OWNER TYPE: Religious organisation

Spacious medieval village church, set back from the main street in a large churchyard. At risk due to structural cracking to tower; decaying render and stonework including to north porch and poor rainwater disposal system. A Repair Grant for Places of Worship has been offered to support the repair work required.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: Church of St Peter and St Paul, Yattendon Lane, Yattendon

DESIGNATION: Listed Place of Worship Grade I, CA

CONDITION: Poor

PRIORITY: B (B)

OWNER TYPE: Religious organisation

Medieval village church with impressive nave roof. The roof tiling to nave and chancel are deteriorating, rainwater disposal system is not operating efficiently – underground drainage system to north is blocked. Plaster has fallen internally beneath a defective brick gutter to boiler room. A Repair Grant for Places of Worship has been offered to support the costs of repair work.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Long barrow at Combe Gibbet, Gallows Down, Combe	
DESIGNATION:	Scheduled Monument (No.1013198)	CONDITION: Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Extensive vehicle damage/erosion	TREND: Declining
OWNER TYPE:	Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	East Ilsley Down round barrows, East Ilsley	
DESIGNATION:	Scheduled Monument (No.1006986)	CONDITION: Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND: Declining
OWNER TYPE:	Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE: 2011 priority categories are given in brackets.

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site

SITE NAME:	Long barrow on Sheep Down, 1km north of East Ilsley, East Ilsley		
DESIGNATION:	Scheduled Monument (No.1013056)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 30m north of Bitham Lane, Inkpen		
DESIGNATION:	Scheduled Monument (No.1009455)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Membury Camp (part in Wiltshire (UA)), Lambourn		
DESIGNATION:	Scheduled Monument (No.1003818)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Two bowl barrows 500m north east of Stancombe Farm, Lambourn		
DESIGNATION:	Scheduled Monument (No.1012349)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Extensive animal burrowing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Aldermaston Court, Aldermaston
DESIGNATION:	Registered Park and Garden Grade II, also part in CA, 11 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	Medium
TREND:	Declining
OWNER TYPE:	Corporate, single owner

An important mid-late C19 landscape with remains of C17/C18 pleasure grounds relating to an earlier manor house. Following WWII, the Victorian mansion house was sold for corporate use then converted into a hotel and conference centre. The registered area is a fragment of an extensive park. It is owned by one owner but leased to two tenants. A perceived lack of beneficial use and resources threaten this landscape. A conservation-led approach to management is required.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Sandford Priory, Greenham
DESIGNATION:	Registered Park and Garden Grade II, also 2 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Mixed, multiple owners

A mid/late C18 landscape laid out to designs by Lancelot Brown, surrounding a Gothick house remodelled by James Wyatt. In 1947 the estate was sold into divided ownership, the house, gardens and core of the park being used as a school. Other ownerships have fallen prey to development (housing, waste disposal) leaving the core compromised as a design fragment which in turn is under-resourced in its management. The setting of the house and park and garden is extremely vulnerable to development.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Shaw House, Shaw cum Donnington/Newbury
DESIGNATION:	Registered Park and Garden Grade II, also CA, 6 LBs
CONDITION:	Extensive significant problems
VULNERABILITY:	Medium
TREND:	Declining
OWNER TYPE:	Local authority, single owner

This site consists of rare earthworks of a late C16 or early C17 garden laid out by the Dolman family and a complex of early C18 water gardens by the Duke of Chandos. Shaw House is now restored, with Heritage Lottery Fund and English Heritage grant aid, as a conference centre and heritage attraction. The local authority need help and additional funding to restore all the garden areas and to integrate the proposed new facilities within them.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **First Battle of Newbury, Enborne/Newbury/Speen**

DESIGNATION: Registered Battlefield
 CONDITION: Generally satisfactory but with minor localised problems
 VULNERABILITY: High
 TREND: Stable
 OWNER TYPE: Private

Site of the 1643 First Battle of Newbury (English Civil War) between Parliamentary and Royalist forces. This battle probably represented the best chance King Charles ever had of winning the Civil War. It marked the turning point of the whole war and is accordingly an important place in English history. Already some of the south eastern periphery of the battlefield is built over and the A34 Newbury bypass clips a corner of it. The battlefield is at risk from housing development around its fringes and until such time as the Core Strategy confirms a strategic housing location elsewhere at Newbury.

Contact: Principal Heritage at Risk Adviser 01483 252000

WEST SUSSEX

ADUR

SITE NAME:	Southlands	
DESIGNATION:	Conservation Area	CONDITION: Very bad
VULNERABILITY:	Medium	TREND: Improving significantly
CONTACT:	Colette Blackett (LPA) 01273 263242	NEW ENTRY?: No

ARUN



SITE NAME: **Maison Dieu, Mill Road, Arundel**

DESIGNATION: Listed Building Grade II, SM, CA
 CONDITION: Very bad
 OCCUPANCY: N/A
 PRIORITY: B (B)
 OWNER TYPE: Private

C14 remains of the former hospital of the Holy Trinity. The monument is in two distinct parts, with different owners, divided by a road. One part is in a fair condition and not deemed to be at risk, whilst the other is in very bad condition. Grant aided repairs should be completed in 2012.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Littlehampton Fort, Littlehampton**

DESIGNATION: Scheduled Monument
 CONDITION: Poor
 OCCUPANCY: N/A
 PRIORITY: C (C)
 OWNER TYPE: Private

Fort C19. The fort is partly covered in ivy which poses the main threat to the building. Part of the fort is engulfed by sand dunes which have Site of Special Scientific Interest status.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Romano-British villa and traces of Iron Age occupation 500m WSW of New Barn, Angmering	
DESIGNATION:	Scheduled Monument (No.1015886)	CONDITION: Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND: Declining
OWNER TYPE:	Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

CHICHESTER



SITE NAME: **Former Church of the Assumption, Church Farm Lane, East Wittering**

DESIGNATION: Listed Building Grade II*
 CONDITION: Fair
 OCCUPANCY: Vacant
 PRIORITY: E (E)
 OWNER TYPE: Private

Medieval church, restored 1875-6. Not used for worship for some years. Repairs have now been made but future use is not yet agreed.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
 2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME: **Parish Church of St Bartholomew, South Street, Rogate**

DESIGNATION: Listed Place of Worship Grade I

CONDITION: Poor

PRIORITY: D (New entry)

OWNER TYPE: Religious organisation

Chancel with north and south chapels, nave with aisles, north porch, north west vestry and west tower rising to a shingled bell-turret with stumpy broach spire. Largely C13, restored in 1875. Architect JW Penfold. Massive timber-framing for the tower supporting the bell-turret. Roofs now need recovering. Investigations into the extent of the repairs are underway; repair works should follow in 2013.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

A Romano-Celtic temple, Iron Age shrine and associated remains 250m north west of Ratham Mill, Funtington

DESIGNATION: Scheduled Monument (No.1018354)

CONDITION: Extensive significant problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Devil's Ditch, section extending 200yds (180m) east from Chapel Lane, Funtington

DESIGNATION: Scheduled Monument (No.1005880)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Devil's Ditch, section extending 400yds (370m) west from Chapel Lane, Funtington

DESIGNATION: Scheduled Monument (No.1005881)

CONDITION: Generally unsatisfactory with major localised problems

PRINCIPAL VULNERABILITY: Arable ploughing

TREND: Declining

OWNER TYPE: Private

CONTACT: Principal Heritage at Risk Adviser 01483 252000



SITE NAME: **Lavington Park, East Lavington/Duncton, Chichester (District)**

DESIGNATION: Registered Park and Garden Grade II, also 7 LBs

CONDITION: Extensive significant problems

VULNERABILITY: High

TREND: Stable

OWNER TYPE: Corporate, single owner

Late C18 and C19 garden, laid out on the site of a former late C16 house and garden and further altered in the C20, set within a park largely planted in the C19 but of C18 origin. The property is now a school. Two relatively substantial developments were granted planning permission earlier this year. The opportunity to rationalise development within the park was considered to outweigh the negative impacts. There is now a conservation plan for the landscape, but no management commitment for areas unaffected by development.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Graylingwell, Chichester

DESIGNATION: Conservation Area

CONDITION: Very bad

VULNERABILITY: High

TREND: Improving significantly

CONTACT: Lone Le Vay (LPA) 01243 534688

NEW ENTRY: No

HORSHAM



SITE NAME: **Sedgwick Castle, Moated site, Nuthurst**

DESIGNATION: Scheduled Monument, RPG II

CONDITION: Poor

OCCUPANCY: N/A

PRIORITY: A (A)

OWNER TYPE: Private

Moated medieval castle. Ruinous. The exposed parts of this structure are in a very poor state of repair. A conservation strategy has been agreed but needs to be implemented.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

	SITE NAME: Parish Church of St Peter, Station Road, Cowfold	Large medieval village church built of Wealden sandstone with Horsham slab roofs. Recent grant-aided repairs to tower, valley gutter, drainage and inner roof slopes. At risk due to defective Horsham slab to outer slopes. Grant offered and accepted for these repairs.
	DESIGNATION: Listed Place of Worship Grade I	
	CONDITION: Very bad	
	PRIORITY: D (New entry)	
	OWNER TYPE: Religious organisation	Contact: Principal Heritage at Risk Adviser 01483 252000
	SITE NAME: Parish Church of St Nicholas, Itchingfield	Village church dating from the C12 with unusual C15 timber-framed tower. Extensive restoration by Sir Giles Gilbert Scott in 1865. At risk due to rotten timbers to tower; decay to the Horsham slab roofing, defective rainwater goods and fall of ceiling plaster in the chancel.
	DESIGNATION: Listed Place of Worship Grade II*	
	CONDITION: Very bad	
	PRIORITY: C (New entry)	
	OWNER TYPE: Religious organisation	Contact: Principal Heritage at Risk Adviser 01483 252000
	SITE NAME: Blue Idol Meeting House and Guest House, Coolham, Thakeham	Late C16 timber-framed farmhouse in rural setting, converted in 1691 to a Friends Meeting House. The roofs are mainly covered in Horsham slab and the timber frame has some wattle and daub and some brick infill panels, with weatherboarding to the south and east elevations. The Horsham slab roofing is in poor condition and the plastic rainwater goods are undersized and poorly aligned. Investigation grant offered to assess fully the repairs required. Repairs should take place in 2013.
	DESIGNATION: Listed Place of Worship Grade II*	
	CONDITION: Poor	
	PRIORITY: D (New entry)	
	OWNER TYPE: Religious organisation	Contact: Principal Heritage at Risk Adviser 01483 252000
	SITE NAME: Parish Church of St Peter, Church Lane, Upper Beeding	Medieval village church built of a mixture of ashlar and rubble stone with areas of flint. The roofs have Horsham slab on the outer slopes and tiled inner slopes. The church is at risk due to defects to the tower parapet, roofs, central valley gutter and the rainwater goods. Funding has been secured from the Heritage Lottery Fund towards repairs planned for 2013.
	DESIGNATION: Listed Place of Worship Grade II*	
	CONDITION: Very bad	
	PRIORITY: B (New entry)	
	OWNER TYPE: Religious organisation	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow on Black Hill, Colgate	
DESIGNATION:	Scheduled Monument (No.1011596)	CONDITION: Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Other	TREND: Declining
OWNER TYPE:	Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Alfoldean Roman site, Slinfold	
DESIGNATION:	Scheduled Monument (No.1005838)	CONDITION: Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND: Declining
OWNER TYPE:	Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

MID SUSSEX

SITE NAME:	Motte and bailey castle 240m east of Dean's Mill, Lindfield Rural	
DESIGNATION:	Scheduled Monument (No.1011776)	CONDITION: Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND: Declining
OWNER TYPE:	Private	CONTACT: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SOUTH DOWNS (NP)



SITE NAME:	The chapel at the former King Edward VII Hospital, Easebourne, Chichester
DESIGNATION:	Listed Building Grade II*, RPG II
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	B (B)
OWNER TYPE:	Company

Remarkable L-shaped former chapel for tuberculosis patients by Charles Holden, 1903-6. In need of roof repairs as part of scheme to convert the hospital. Permission now given so repairs now need to take place.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	North Park Furnace, Linchmere, Chichester
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant
PRIORITY:	C (C)
OWNER TYPE:	Trust

The furnace is one of the most complete charcoal fired blast furnaces surviving from the Wealden iron industry but is in need of urgent repairs. Heritage Lottery Fund grant application to be made to fund repairs.


Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Amberley Limeworks; Bagmenders shed and Locomotive shed, Houghton Bridge, Amberley, Horsham
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	D (D)
OWNER TYPE:	Trust

C19 limeworks including kilns and associated buildings. The ingress of rain and inadequate maintenance in the past have led to structural weaknesses to two buildings which are the items at risk.

Contact: Principal Heritage at Risk Adviser 01483 252000

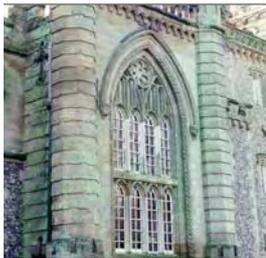

SITE NAME:	Castle Goring, Arundel Road, Worthing
DESIGNATION:	Listed Building Grade I
CONDITION:	Very bad
OCCUPANCY:	Part occupied
PRIORITY:	A (A)
OWNER TYPE:	Private

Large house. Built by Shelley's grandfather, Sir Bysshe Shelley, about 1797-8. The condition is very grave, and enforcement action for repairs must now be considered.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Church of St Nicholas, London Road, Arundel, Arun
DESIGNATION:	Listed Place of Worship Grade I, CA
CONDITION:	Very bad
PRIORITY:	B (A)
OWNER TYPE:	Religious organisation

Well proportioned town church, re-built in 1380. Unusually the adjacent Fitzalan Chapel and Lady Chapel to the east are in Roman Catholic use. At risk due to blocked and leaking gutters and downpipes leading to damp penetration internally, spalling stonework to tower, rotting timber framing and defective tiling to north porch. A full programme of repairs is needed and is planned to be carried out in 2013 with funding now secured from the Heritage Lottery Fund.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:

Duncton Common round barrow cemetery, Duncton, Chichester

DESIGNATION:

Scheduled Monument (No.1009329)

CONDITION:

Generally satisfactory but with significant localised problems

PRINCIPAL VULNERABILITY:

Extensive animal burrowing

TREND:

Declining

OWNER TYPE:

Private

CONTACT:

Principal Heritage at Risk Adviser
01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

D Slow decay; solution agreed but not yet implemented.

E Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

F Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:		Harting Beacon: a hilltop enclosure, Anglo-Saxon burial mound and telegraph station on Beacon and Pen Hills, Elsted and Treyford, Chichester	
DESIGNATION:	Scheduled Monument (No.1015915)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:		Flint mine and a bowl barrow on Church Hill, 400m south west of Findon Place, Findon, Arun	
DESIGNATION:	Scheduled Monument (No.1015238)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:		Devil's Ditch, section extending 900yds (820m), Lye Wood, West Stoke, Funtington, Chichester	
DESIGNATION:	Scheduled Monument (No.1005882)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:		Flint mine on Stoke Down, immediately north of Stoke Clump, Funtington, Chichester	
DESIGNATION:	Scheduled Monument (No.1018563)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:		Linear boundary on Stoke Down, 800m north of West Stoke House, Funtington, Chichester	
DESIGNATION:	Scheduled Monument (No.1018564)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:		Bowl barrow 350m WNW of Barnett's Bridge, Graffham, Chichester	
DESIGNATION:	Scheduled Monument (No.1009916)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Forestry	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:		Bowl barrow 500m WNW of Barnett's Bridge, Graffham, Chichester	
DESIGNATION:	Scheduled Monument (No.1009910)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME: Bowl barrow on Gallows Hill, 150m east of Millborough House, Graffham, Chichester			
DESIGNATION:	Scheduled Monument (No.1009905)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Two bowl barrows on Gallows Hill, 200m east of Millborough House, Graffham, Chichester			
DESIGNATION:	Scheduled Monument (No.1009906)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Forestry	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bexley Bushes earthworks, Lavant, Chichester			
DESIGNATION:	Scheduled Monument (No.1005892)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Devil's Ditch, section 230yds (210m) long from Chichester main road to Pook Lane, Lavant, Chichester			
DESIGNATION:	Scheduled Monument (No.1005877)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Local authority	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Devil's Ditch, section extending 530yds (480m) west from Lavant Lodge, Lavant, Chichester			
DESIGNATION:	Scheduled Monument (No.1005878)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Bowl barrow on Gallows Hill, 300m east of Millborough House, Lodsworth, Chichester			
DESIGNATION:	Scheduled Monument (No.1009908)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Plant growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME: Motte and bailey castle in Pulborough Park, Pulborough, Horsham			
DESIGNATION:	Scheduled Monument (No.1017547)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Plant growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Bowl barrow on Fitzhall Rough, 330m ENE of Fitzhall: part of Fitzhall Rough round barrow cemetery, Stedham with Iping, Chichester		
DESIGNATION:	Scheduled Monument (No.1008503)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Bowl barrow 950m south west of Grey Friars Farm: part of a dispersed round barrow cemetery on Kithurst Hill, Storrington and Sullington, Horsham		
DESIGNATION:	Scheduled Monument (No.1015711)	CONDITION:	Generally unsatisfactory with major localised problems
PRINCIPAL VULNERABILITY:	Scrub/tree growth	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

WORTHING



SITE NAME:	Holy Trinity Church, Shelley Road
DESIGNATION:	Listed Place of Worship Grade II, CA
CONDITION:	Poor
PRIORITY:	C (C)
OWNER TYPE:	Religious organisation

Large town church built with stone dressings. Designed by Henry Coe and Stephen Robinson and built 1882-88. At risk due to decayed high level brick and stonework, especially to tower. Roof and lightning conductor repairs and upgrading are also required.

Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	St Botolph's Church, Lansdowne Road, Worthing
DESIGNATION:	Listed Place of Worship Grade II
CONDITION:	Poor
PRIORITY:	C (New entry)
OWNER TYPE:	Religious organisation

Large suburban church mainly constructed between 1872 and 1879 and designed by Edmund E Scott of Brighton. There are open joints to the brick and stonework and some of the flint facings are missing. There are areas of slipped slating caused by loose fixings to the south elevation and some blocked rainwater gullies.

Contact: Principal Heritage at Risk Adviser 01483 252000

WINDSOR AND MAIDENHEAD (UA)



SITE NAME:	Noahs Boathouse, Stonehouse Lane (Off), Cookham
DESIGNATION:	Listed Building Grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY:	A (A)
OWNER TYPE:	Private

1930, by Colin Lucas for his father; constructed of monolithic reinforced concrete with a flat roof. An early and pioneering example of Modern Movement architecture by one of the major figures in the movement. The building floods regularly and is derelict. The roof is leaking and the concrete is spalling.

Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Royal Mausoleum, The Home Park, Windsor
DESIGNATION:	Listed Building Grade I, RPG I
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY:	D (C)
OWNER TYPE:	Crown

Mausoleum of Queen Victoria and Prince Albert, 1862-71. Damp problems are placing external and internal historic fabric at risk, including the internal frescoes. The original rainwater drainage is inadequate and poorly designed, running within the wall fabric, and is difficult to maintain. Environmental monitoring has been carried out, and temporary remedial works are proposed.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Beenham's Heath		
DESIGNATION:	Conservation Area	CONDITION:	At risk
VULNERABILITY:	Unknown	TREND:	Improving
CONTACT:	Jane Wylie (LPA) 01628 685687	NEW ENTRY?:	No

WOKINGHAM (UA)

SITE NAME:	Site of St Bartholomews Church, Arborfield, Arborfield and Newland	Old parish church, now a roofless ruin. Originally C13 in flint and stone, with substantial probable C18 brick rebuilding. One wall partially standing, with fragments of later brick segments. Very overgrown. Risk of further collapse.
DESIGNATION:	Listed Building Grade II, SM	
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY:	A (A)	
OWNER TYPE:	Religious organisation	Contact: Principal Heritage at Risk Adviser 01483 252000



SITE NAME:	Infirmary Stables, Arborfield Garrison, Arborfield, Finchampstead	A specialised 'horse hospital' built 1911-12. The building is redundant by virtue of changes in army practices (reduced cavalry activity).
DESIGNATION:	Scheduled Monument	
CONDITION:	Very bad	
OCCUPANCY:	Vacant	
PRIORITY:	A (A)	
OWNER TYPE:	Government	Contact: Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Cropmark complex south west of St Patrick's Avenue, Charvil		
DESIGNATION:	Scheduled Monument (No.1006964)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Cropmark enclosure and pits north east of St Patrick's Avenue, Charvil		
DESIGNATION:	Scheduled Monument (No.1006966)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Ring ditch cropmark east of St Patrick's Avenue, Charvil		
DESIGNATION:	Scheduled Monument (No.1006965)	CONDITION:	Extensive significant problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

SITE NAME:	Cropmark site east of Broadmoor Lane, Sonning		
DESIGNATION:	Scheduled Monument (No.1006963)	CONDITION:	Generally satisfactory but with significant localised problems
PRINCIPAL VULNERABILITY:	Arable ploughing	TREND:	Declining
OWNER TYPE:	Private	CONTACT:	Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



SITE NAME:	Bearwood College, Arborfield and Newland/Barkham
DESIGNATION:	Registered Park and Garden Grade II*, also part in CA, 5 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
OWNER TYPE:	Corporate, multiple owners

This C19 landscape park and woodland surrounds a Victorian country house standing on formal terraces, with gardens by William Sawrey Gilpin and Pulham. The school which now occupies the house helped secure its future after WWI. The landscape park is now subdivided into two golf courses. Subsequent and current development and management of the gardens and woodland, plus a lack of specialist guidance and resources, challenge the integrity and survival of the historic landscape.

Contact: Principal Heritage at Risk Adviser 01483 252000

PRIORITY (FOR BUILDINGS)

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair; but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; functionally redundant buildings with new use agreed but not yet implemented.

NOTE:
2011 priority categories are given in brackets.

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



ENGLISH HERITAGE

This document is one in a series of publications produced as part of English Heritage's national Heritage at Risk programme. More information about Heritage at Risk and other titles in the series can be found at www.english-heritage.org.uk/risk

HERITAGE AT RISK

Published September 2012 by English Heritage
1 Waterhouse Square, 138-142 Holborn,
London EC1N 2ST

© Copyright English Heritage 2012